



BMW 5er 525d

Stock number:	<i>GX13348</i>
Build year:	2013
First registration:	11/2013
Odometer reading:	223,913 km
Fuel type:	Diesel
Horsepower:	160 kW / 218 HP
Cylinder capacity:	1,995 ccm
Gear box:	Automatic
Inspection expires:	08/2024
Body type:	Sedan
Total number of owners:	3
Keys:	2
Prior damage / Accident according to previous owner	Yes
Repair Cost	Unknown
Country of origin:	DE
Country of last registration:	-
Environmental class:	EURO 6
COC papers:	Yes
Seats:	5
Color:	Gray (Original)
Upholstery:	Leather (Original)
Door count:	4
CO2 Emissions:	128g/km

Car location

DE, Dornach



0:01 / 0:42







MAIN CAR DETAILS

CAR HIGHLIGHTS / ADDITIONAL PHOTOS



General



General

CAR EQUIPMENT

Some content has been automatically translated.

 Towbar	Trailer hitch (swiveling ball head)
 Xenon lights	Bi-Xenon headlights
 Heated seats	Front seat heating
 Park Distance Control	Park-Distance-Control (PDC) front and rear
 Power steering	Power steering Servotronic
 Hands-free system	Bluetooth hands-free system with advanced smartphone integration Voice processor system
 Sport seats	Sports seats in front
 Navigation System	ConnectedDrive navigation package Professional audio-navigation system
 Airbag	Disconnectable passenger airbag Driver side airbag / passenger side airbag Rear Cranial Airbag System Front head airbag system Front side airbag
 AC System	Automatic climate control 2 zones with automatic air recirculation control, extended range
 DPF / FAP	Particulate filter
 Power windows	Electric windows front + rear
 ESP	Dynamic Stability Control (DSC)
 Immobilizer	Immobilizer
 On-board computer	External temperature indicator On-board computer



Entertainment system

BMW Professional audio system (Radio / DVD player compatible with MP3)



ABS

Anti-lock Braking System (ABS)

CAR SERVICE DETAILS

Service book details:

Digital service book

Service appointment:

Some

Last service on:

10/14/2024

Last service Mileage:

222,789 km

Drive belt change on:

-

Drive belt change Mileage:

-

Car service images 4 images available



TEST DRIVE INFORMATION

TEST DRIVE LOCATION: ON PUBLIC STREET < 80KM/H (LOWER SPEED)



Steering:

Steering wheel off centre.

CAR DATA ACCORDING TO IDENTIFICATION NUMBER (VIN)

Some content has been automatically translated.



Driver Assistance System: Front collision warning with brake function



Driving Assistance System: Driving Assistant Plus



Driving Assistance System: Driving Assistant



Automatic position lights



Control-Display with color monitor (9.2 inches)



AUX-IN connection (AUX-IN)



Security system Active Protection



Active headrests



Active Engine Hood



LED turn signals

OTHER NOTES

Some content has been automatically translated. [Show original](#)

Vehicle heavily soiled,
Cables unprofessionally routed in the interior



PAINT THICKNESS NEW

Hood	120 µm
Roof	112 µm
Front fender left	133 µm
Front fender right	122 µm
Rear fender left	118 µm
Rear fender right	126 µm
Front door left	445 µm
Front door right	117 µm
Rear door left	108 µm
Rear door right	125 µm
Tailgate (Boot lid)	119 µm


CAR DAMAGE

DAMAGE AREAS

Sub-area images are merely displayed for orientation purposes and the damage summary reports the area's condition in detail. Please note that we take photos of all significant damages. Minor damage will be displayed below in the table without a corresponding image.

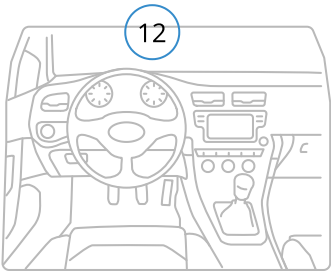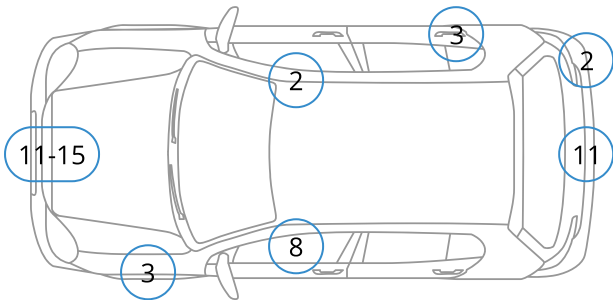

1/21

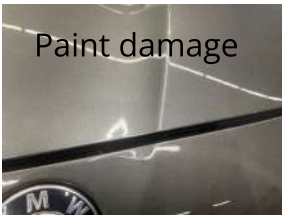

2/21



3/21



4/21



5/21



6/21



Deep scratch - down to primer

7/21



Non-professional repaint

8/21



Deep scratch

9/21



10/21



11/21



12/21



13/21



14/21



15/21



16/21



17/21



18/21



19/21



20/21



21/21

Damage and severity

FRONT BUMPER

2 FRACTURES

Length: ≥20mm & <50mm, Width: <5mm

HOOD

6-10 STONE CHIPS

Width: ≤3mm Paint damage

WINDSCREEN

3 STONE CHIPS

Width: ≤3mm Not in driver's eyeline


DAMAGE SUMMARY

The results of this car's evaluation are summarised in the DAMAGE SUMMARY table and visualised in the DAMAGE AREAS section below.

Damage / Part	Severity
5 DENTS Rear left door (3) Rear bumper (2)	Width: ≥5mm & <20mm , Paint damage
2 FRACTURES Front bumper (2)	Length: ≥20mm & <50mm, Width: <5mm
1 REPAINT Front left door (1)	Thickness: ≥250µm & <500µm , Non-professional repaint
2 SCRATCHES Rear right door (2)	Length: ≥100mm , Deep scratch - down to primer
7 SCRATCHES Front left door (2) Rear bumper (3) Rear right fender (2)	Length: ≥20mm & <50mm , Deep scratch - down to primer
12 SCRATCHES Front left rim (3) Secondary wheel first rim (3) Secondary wheel second rim (3) Rear right rim (3)	Length: <25mm , Deep scratch
2 SCRATCHES Left mirror housing (2)	Length: <20mm , Deep scratch - down to primer
6-10 Hood (6-10)	Width: ≤3mm , Paint damage
3 STONE CHIPS Windscreen (3)	Width: ≤3mm , Not in driver's eyeline
7 UPHOLSTERY DAMAGES Passenger seat (1) Other seats (1) Headliner (1) Headliner (1) Floor covering (1) Trunk inside cover left (1) Trunk inside cover right (1)	
1 DIRTY Floor covering (1)	
2 SCRATCHES Front door interior left (1) Center console (1)	Length: <50mm
2 WORN OUT Driver seat (1) Steering Wheel (1)	

MAIN WHEELS DETAILS

This section visualises the state of the car's tires, brake pad and disc condition. In the case that any rim-related damages are found on this car they will be displayed in the car damages section.

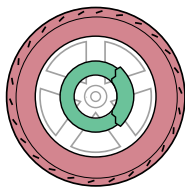

FRONT LEFT - (1/4)

Tire type

Winter

DOT

1111

Profile depth (mm)

5

Tire condition

Porous 

Rim type

Aluminium

Brake type

Disc brake

Brake pad thickness

≥ 3mm 

Brake disc condition

No issues found 

SECONDARY WHEELS DETAILS

FRONT LEFT - (1/4)

Tire type

Summer

DOT

1522

Profile depth (mm)

4

Tire condition

No issues found 

Rim type

Aluminium