




BMW 3er 318d GT Advantage

Stock number:	UT00645
Build year:	2015
First registration:	10/2015
Odometer reading:	153,799 km
Fuel type:	Diesel
Horsepower:	110 kW / 150 HP
Cylinder capacity:	1,995 ccm
Gear box:	Manual
Inspection expires:	01/2026
Body type:	Sedan
Total number of owners:	Not available
Keys:	2
Prior damage / Accident according to previous owner	No
Country of origin:	BE
Country of last registration:	BE
Environmental class:	EURO 6b
COC papers:	Yes
Seats:	5
Color:	Gray (Original)
Upholstery:	Leather (Original)
Door count:	5

Car location

-

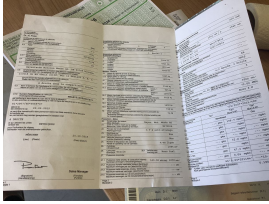



MAIN CAR DETAILS

CAR EQUIPMENT

Some content has been automatically translated.

 Xenon lights	Bi-Xenon headlights
 Heated seats	Front seat heating
 Sunroof	Panoramic roof (Transparent)
 Park Distance Control	Park-Distance-Control (PDC) front and rear
 Power steering	Power steering Servotronic
 Hands-free system	Bluetooth hands-free system with USB audio interface Bluetooth hands-free system with USB audio interface Bluetooth hands-free system with advanced smartphone integration
 Navigation System	Professional audio-navigation system
 Airbag	Disconnectable passenger airbag Driver side airbag / passenger side airbag Rear Cranial Airbag System Front head airbag system Side airbag rear Front side airbag
 AC System	Automatic dual-zone air conditioning with automatic air circulation control
 DPF / FAP	Particulate filter
 Power windows	Electric windows front + rear
 ESP	Dynamic Stability Control (DSC)
 Immobilizer	Immobilizer
 On-board computer	External temperature indicator On-board computer



Theft alarm system / security alarm

Alarm system



ABS

Anti-lock Braking System (ABS)

CAR SERVICE DETAILS

Service book details:	Not available
Service appointment:	None
Last service on:	-
Last service Mileage:	-
Drive belt change on:	-
Drive belt change Mileage:	-

TECHNICAL INSPECTION

Date of latest technical inspection:	01/20/2025
Mileage at latest technical inspection:	153,293 km

Technical inspection images 1 image



TEST DRIVE INFORMATION

TEST DRIVE LOCATION: ON PUBLIC STREET < 80KM/H (LOWER SPEED)

NO SPECIFIC FINDINGS

CAR DATA ACCORDING TO IDENTIFICATION NUMBER (VIN)

Some content has been automatically translated.

-  Color monitor (6.5 """)
-  AUX-IN connection (AUX-IN)
-  Advantage
-  Active Engine Hood
-  Exhaust system (1-pipe system) with mask
-  Check Control System
-  Dynamic brake lights
-  Remote unlocking tailgate
-  Velour floor mats
-  Trunk cover / Blind



PAINT THICKNESS NEW

Hood	143 µm
Roof	144 µm
Front fender left	157 µm
Front fender right	175 µm
Rear fender left	187 µm
Rear fender right	167 µm
Front door left	176 µm
Front door right	199 µm
Rear door left	156 µm
Rear door right	187 µm
Tailgate (Boot lid)	167 µm

CAR DAMAGE

DAMAGE AREAS

Sub-area images are merely displayed for orientation purposes and the damage summary reports the area's condition in detail. Please note that we take photos of all significant damages. Minor damage will be displayed below in the table without a corresponding image.

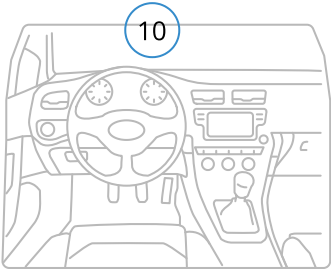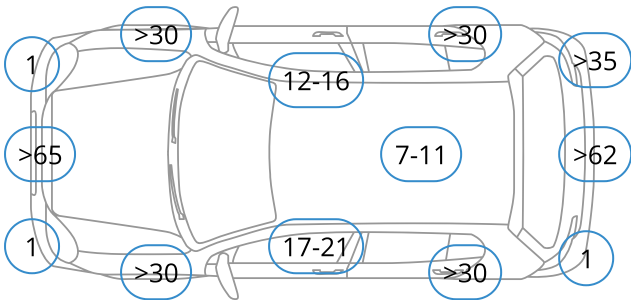

Professional repaint

1/25

No damage specific images



Deep scratch - down to primer

2/25



Deep scratch - down to primer

3/25



Minimal not fitting parts, no grinding issues

4/25



Professional repaint

5/25

No damage specific images



Deep scratch

6/25



Deep scratch - down to primer

7/25

No damage specific images



Deep scratch

8/25



Deep scratch - down to primer

9/25



Deep scratch - down to primer

10/25

No damage specific images



Deep scratch - down to primer

11/25

No damage specific images



Professional repaint

12/25

No damage specific images



Deep scratch

13/25



Paint damage

14/25

No damage specific images



Deep scratch

15/25



16/25



17/25



18/25



19/25



20/25



21/25



22/25



23/25



24/25



Damage and severity

FRONT LEFT FENDER

1 REPAINT

 0

Thickness: $\geq 125\mu\text{m}$ & $< 250\mu\text{m}$ Professional repaint


DAMAGE SUMMARY

The results of this car's evaluation are summarised in the DAMAGE SUMMARY table and visualised in the DAMAGE AREAS section below.

Damage / Part	Severity
1 BODY GAP Front bumper (1)	Minimal not fitting parts, no grinding issues
14-18 Front left door (4) Rear left door (6-10) Rear right fender (4)	Width: $< 5\text{mm}$, Paint damage
11 REPAINT Hood (1) Front left fender (1) Front left door (1) Rear left door (1) Rear left fender (1) Tailgate (1) Rear right fender (1) Rear right door (1) Front right door (1) Front right fender (1) Roof (1)	Thickness: $\geq 125\mu\text{m}$ & $< 250\mu\text{m}$, Professional repaint
2 REPAINT Front bumper (1) Rear bumper (1)	Thickness: $< 125\mu\text{m}$, Professional repaint
>46 SCRATCHES Front bumper (16-20) Rear right fender (> 30)	Length: $\geq 100\text{mm}$, Deep scratch - down to primer
>120 SCRATCHES Front left rim (> 30) Rear left rim (> 30) Rear right rim (> 30) Front right rim (> 30)	Length: $\geq 25\text{mm}$, Deep scratch
>30 SCRATCHES Windscreen (> 30)	Length: $< 20\text{mm}$, Deep scratch
>97 SCRATCHES Hood (16-20) Rear left door (5) Rear bumper (> 30) Tailgate (> 30) Rear right door (6-10) Front right door (4) Roof (6-10)	Length: $< 20\text{mm}$, Deep scratch - down to primer
10 UPHOLSTERY DAMAGES Front door interior right (1) Dashboard (1) Center console (1) Door interior rear right (1) Passenger seat (1) Hat rack (1) Door interior rear left (1) Front door interior left (1) Steering Wheel (1) Driver seat (1)	

MAIN WHEELS DETAILS [i](#)

This section visualises the state of the car's tires, brake pad and disc condition. In the case that any rim-related damages are found on this car they will be displayed in the car damages section.

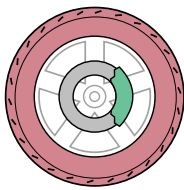

FRONT LEFT - (1/4)

Tire type
All season

DOT
0118

Profile depth (mm)
1 

Tire condition
N/A

Rim type
Aluminium

Brake type
Disc brake

Brake pad thickness
≥ 3mm 

Brake disc condition
Not measurable