

Thank you for ordering from us!

www.checkvin.eu

Vehicle

BMW 320D A, 140KW

WBA8H91000K663780



Development code

Colour

Actual integration level

Start of warranty

F31

mineral-grau metallic

F020-22-07-530

4 November 2015

Technical campaigns

Warranty extension/VIN-based goodwill

Special information

Restrictions on the warranty

There are no restrictions on the warranty.

⚠ Market-specific restrictions are not currently displayed. Please check this in WDF/WXE via S-Gate.

Live Diagnosis

i There are no service solutions for Live Diagnosis.

Service contracts

No BSI contracts

Information on faults workshop/Service Consultation

There is no information on faults.

Navigation map

Installed map

Enabling code (subscription)

Latest navigation map
included in subscription

Latest navigation map subject
to charge

Road Map EUROPE Route
2015-2A (As of: 27 May
2024)

Enabling code valid for navigation
maps with release date up to 31
Dec 2025 (SWID: 00B4008F).

Road Map EUROPE WEST
Route 2025

-

Vehicle details

Vehicle type	Passenger car
Brand	BMW
Model	320D A
Body	TOUR
Vehicle identification number (last 7 digits)	K663780
Vehicle identification number (17 digits)	WBA8H91000K663780
Development code	F31
Steering	LL
Engine	B47O
Engine number	75869415
Exhaust re-treatment	EURO6, W, PI/CI, M, N1 I
Transmission	AUT
Transmission number	0143565ZEN
Head unit serial number	MM01DFF1210139
Drive	HECK
Integration level, works	F020-15-07-506
Production date	22 Oct 2015
Production plant	Muenchen
Delivery date	23 Oct 2015
Delivering retailer	Autohaus Kaltenbach, Remscheid, DE
National-market version	EUR
Paint code	B39
Upholstery code	CCL1
Model code	8H01
Basic type	8H91
Lead type	8H01

Optional equipment

Optional equipment ex works:

01CA Selection of COP-relevant vehicles
01CB CO2 equipment
0205 Automatic transmission
0216 Hydro steering-servotronic
0230 EU-specific additional contents
0255 Sports leather steering wheel
0258 Tyres with runflat properties
02A6 BMW LA wheel, double spoke 392
02VB Tyre pressure display
0322 Comfort access
03L8 Exterior equipment, aluminium, satinised
0423 Floor mats velours

Retrofitted optional equipment:

This vehicle has no retrofits.

0428 Warning triangle and first aid kit
0431 Interior mirror with automatic-dip
0481 Sports seat
0488 Lumbar support, driver and passenger
0493 Storage compartment package
0494 Seat heating driver/passenger
04AE Armrest front, retractable
04LV black high-gloss accent korall-rot
0508 Park Distance Control (PDC)
0521 Rain sensor
0534 Automatic air conditioning
0544 Cruise control with brake function
0548 Kilometre speedo
0563 Lights package
0575 Additional 12V power socket
05A1 LED Fog lights
05A2 LED headlight
05AC High-beam assistant
05DA Passenger airbag deactivation
05DC Rear-seat headrests, folding
0606 Navigation system Business
0698 Area-Code 2 for DVD
06AC Intelligent emergency call
06AE Teleservices
06NH Hands-free system with USB interface
06WA Instrument panel with extended scope
07AC Sport Line
07LD Modell Sport Line
0801 German version
0851 Language version German
0879 On-board literature, German
08KA Oil service interval 24 mths / 30,000 km
09BD Business Package
A090 90 Ah AGM battery
POL5 Cloth cushion

Vehicle histories

	Date	Type	Vehicle mileage	Retailer	Overview
—	27/05/2024	Key	177155 Km	04746	Key 1
	 13000 06/2025  13000 06/2025  13000 06/2025  13000 06/2025  90000  10/2024  70000  13000 06/2025				
—	27/05/2024	Warranty	177155 Km	04746	Job: F1x F2x F3x G0x G1x G3x B47O B47K B47U B47T Replacing EGR cooler (high-temperature)
Job: F1x F2x F3x G0x G1x G3x B47O B47K B47U B47T Replacing EGR cooler (high-temperature)					
Description: F1x F2x F3x G0x G1x G3x B47O B47K B47U B47T Replacing EGR cooler (high-temperature)					
Considered as a repeat visit No					
Customer's own words					
Replace exhaust gas recirculation cooler, including exhaust gas recirculation valve Flat rate unit I 00 74 057					25 FRU
Additional work: run function test for pressure sensor system Flat rate unit I 00 74 636					3 FRU
Additional work: enter component identification of new exhaust gas recirculation cooler in diagnostic system Flat rate unit I 00 74 637					1 FRU
Additional work cleaning the exhaust gas recirculation pipe					6 FRU

Flat rate unit | 00 74 638

F1x F2x F3x G0x G1x G3x B47O B47K B47U B47T Replacing EGR cooler (high-temperature)
Defect | 00 11 13 07 00

Exhaust gas radiator high temperature
Part | 11 71 7 822 347

1

EGR small parts set
Part | 11 71 8 490 640

1

Holder
Part | 61 13 1 369 832

1

Connection piece
Part | 11 65 7 803 012

1

O-ring
Part | 11 61 8 512 681

1

Acoustic cover front
Part | 11 14 8 490 577

1

Pipe union
Part | 11 71 7 799 853

2

Pipe
Part | 13 71 7 823 517

1

13/09/2023 Key 167656 Km 03105 Remote KeyRead



21000
06/2025



21000
06/2025



21000
06/2025



21000
06/2025



90000



10/2024



90000



21000
06/2025

19/06/2023 Service 162676 Km OSS-60063252 Kfz-Meisterbetrieb Boni GbR, Aachen Manual



✓





✓





✓









\$



\$



\$

13/10/2022 Key 151264 Km 04746 Key 1



29000
10/2024





29000
10/2024





27000



10/2024



100000



60000
10/2026

13/10/2022 Warranty 151264 Km 04746 Job: F1x F2x F3x B47O B47K B47U Programming control units (DDE)

Job: F1x F2x F3x B47O B47K B47U Programming control units (DDE)

Description: F1x F2x F3x B47O B47K B47U Programming control units (DDE)

Considered as a repeat visit No

Customer's own words















Program control units

8 FRU

Flat rate unit I 00 71 907

F1x F2x F3x B47O B47K B47U Programming control units (DDE)

Defect I 00 13 50 03 00

—	04/10/2022	Service	150444 Km	OSS- 60063252 Kfz- Meisterbetrieb Boni GbR, Aachen	Manual					
										
	✓	✓	✓			✓	✓		✓	✓
—	30/09/2022	Key	150379 Km	04746	Remote KeyRead					
										
	12000 07/2023	12000 07/2023	12000 07/2023	12000 07/2023	28000 -59 8.1 %	13000	12000 07/2023			
—	27/07/2021	Service	133077 Km	OSS- 60063252 Kfz- Meisterbetrieb Boni GbR, Aachen	Manual					
										
	✓									
—	25/09/2020	Service	120603 Km	OSS- 60063252 Kfz- Meisterbetrieb Boni GbR, Aachen	Manual					
										
	✓	✓	✓				✓			
—	12/04/2019	Key	94248 Km	04746	Key 1					
										
	-600 06/2019	0	-600 79	0	80000 08/2020	0	70000	28000 06/2021		
—	12/04/2019	Service	94248 Km	04746 Kohl- Automobile GmbH, Aachen	Manual					
										
	✓		✓							
—	12/04/2019	Repair	94248 Km	04746 Kohl- Automobile	Job Job					

GmbH ,
Aachen

Job
Job
Job

— Job

Description:

Considered as a repeat visit No

Customer's own words

— Job

Description:

Considered as a repeat visit No

Customer's own words

Package I 0000105

— Job

Description:

Considered as a repeat visit No

Customer's own words

Package I 0000616

Microfilter/activated Carbon container
Part I 64119237555

1

— Job

Description:

Considered as a repeat visit No

Customer's own words

Package I 0000610

!!! unknown BMW-Id FTT0030 Castrol Edge Prof. 0W30 !!!
Part I FTT0030

Local

5

Set oil-filter element
Part I 11428575211

1

— Job

Description:

Considered as a repeat visit No

Customer's own words

— 12/04/2019 Repair 94249 Km 04746 Kohl- Automobile GmbH , Aachen Job Job Job Job

— Job

Description: CBS: Standardumfang

Considered as a repeat visit No

Customer's own words

Service - standard scope
Flat rate unit I 00 00 105

2 FRU

— Job

Description: CBS: Mikrofilter (ggf. weiter Zusatzarbeit(en) beachten)**Considered as a repeat visit** No**Customer's own words**

Microfilter service	2 FRU
Flat rate unit I 00 00 616	

Microfilter/activated Carbon container	1
Part I 64 11 9 237 555	

— Job

Description: CBS: Motoröl**Considered as a repeat visit** No**Customer's own words**

Engine oil service	3 FRU
Flat rate unit I 00 00 610	

Set oil-filter element	1
Part I 11 42 8 575 211	


BMW Engine Oil LL04 0W30	5
Part I 83 21 2 405 950	

— Job

Description: Nein, Service Beratung am Fahrzeug wird NICHT gewünscht**Considered as a repeat visit** No**Customer's own words**

Vehicle check in course of reception	1 FRU
Flat rate unit I 00 52 054	

— 04/04/2019 Key 94105 Km 04746 Key 1

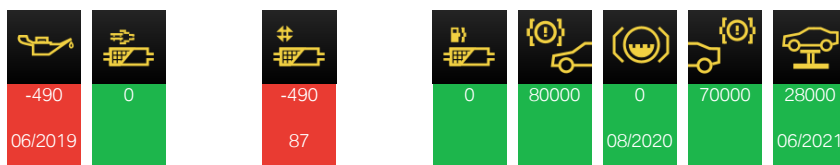

— 04/04/2019 Repair 94105 Km 04746 Kohl-Automobile GmbH, Aachen Job
Job
Job
Job

— Job

Description:**Considered as a repeat visit** No**Customer's own words**

Package I 0000105

— Job

Description:**Considered as a repeat visit** No**Customer's own words**

Package I 0000616

Microfilter/activated Carbon container
Part I 64119237555

1

— Job

Description:

Considered as a repeat visit No

Customer's own words

Package I 0000610

!!! unknown BMW-Id FTT0030 Castrol Edge Prof. 0W30 !!!
Part I FTT0030

Local

5

Set oil-filter element
Part I 11428575211

1

— Job

Description:

Considered as a repeat visit No

Customer's own words

— 04/04/2019 Repair 94105 Km 04746 Kohl- Automobile GmbH , Aachen Job Job Job Job

— Job

Description: Erreichbar unter

Considered as a repeat visit No

Customer's own words

0176/34410491
Flat rate unit I ESTIMAT

Local

0 FRU

— Job

Description: CBS: Standardumfang

Considered as a repeat visit No

Customer's own words

Service - standard scope
Flat rate unit I 00 00 105

0 FRU

— Job

Description: CBS: Mikrofilter (ggf. weiter Zusatzarbeit(en) beachten)

Considered as a repeat visit No

Customer's own words

Microfilter service
Flat rate unit I 00 00 616

0 FRU

Microfilter/activated Carbon container
Part I 64 11 9 237 555

1

— Job

Description: CBS: Motoröl

Considered as a repeat visit No


Customer's own words

Engine oil service
Flat rate unit | 00 00 610 0 FRU

Set oil-filter element
Part | 11 42 8 575 211 1

BMW Engine Oil LL04 0W30
Part | 83 21 2 405 950 5

— 04/02/2019 Key 91088 Km 04746 Key 1

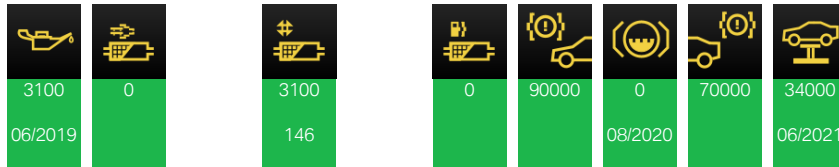

— 04/02/2019 Warranty 91090 Km 04746 Job: F10 F11 F25 F26 F31 F34 F36 B47O Replacing exhaust-gas recirculation cooler

— Job: F10 F11 F25 F26 F31 F34 F36 B47O Replacing exhaust-gas recirculation cooler

Description: F10 F11 F25 F26 F31 F34 F36 B47O Replacing exhaust-gas recirculation cooler

Considered as a repeat visit No

Customer's own words

Replace exhaust gas recirculation cooler and clean exhaust gas recirculation pipe
Flat rate unit | 00 66 167 28 FRU

Perform additional work for pressure sensor system function
Flat rate unit | 00 67 695 3 FRU

Additional work of checking EGR cooler
Flat rate unit | 00 67 703 1 FRU

F10 F11 F25 F26 F31 F34 F36 B47O Replacing exhaust-gas recirculation cooler
Defect | 00 11 83 04 00

exhaust cooler
Part | 11 71 8 477 659 1

EGR small parts set
Part | 11 71 8 490 222 1

— 21/12/2018 Warranty 88158 Km 04746 Job: F1x F2x F3x B47 programming control units and if necessary, replacing the EGR valve

— Job: F1x F2x F3x B47 programming control units and if necessary, replacing the EGR valve

Description: F1x F2x F3x B47 programming control units and if necessary, replacing the EGR valve


Considered as a repeat visit No

Customer's own words


Carrying out the ABL and programming the control units
Flat rate unit | 00 64 941 8 FRU

F1x F2x F3x B47 programming control units and if necessary, replacing the EGR valve
Defect | 00 11 45 04 00

— 20/12/2018 Key 88141 Km 04746 Key 1

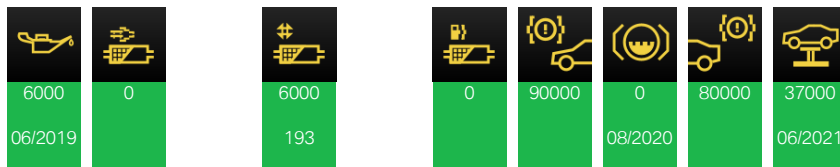

— 27/08/2018 Service 83266 Km 02712 Autohaus Kaltenbach, Wipperfürth Manual

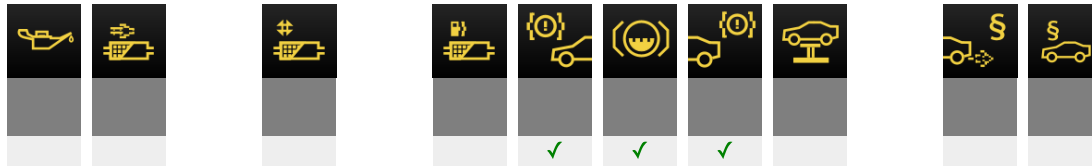

— 20/08/2018 Repair 83266 Km 02712 Autohaus Kaltenbach GmbH & Co. KG, Wipperfürth Job
Job
Job

— Job

Description:

Considered as a repeat visit No

Customer's own words

Auslieferungsdurchsicht - GW - Flat rate unit I 01 00 004	Local	8 FRU
Fahrzeugwäsche mit Innen- reinigung NW / VF / GW Flat rate unit I 01 00 002	Local	12 FRU
Service - standard scope Flat rate unit I 00 00 105		2 FRU
Brake fluid service Flat rate unit I 00 00 618		4 FRU
Service, front brakes Flat rate unit I 00 00 612		6 FRU
Removing and installing or replacing both front brake discs Flat rate unit I 34 11 613		3 FRU
Service, rear brakes Flat rate unit I 00 00 614		7 FRU
Brake fluid DOT4 LV, low viscosity Part I 83 13 2 184 843		1
Repair kit, brake pads asbestos-free Part I 34 10 6 859 181		1
Inner hex bolt Part I 34 21 1 161 806		2
Brake pad wear sensor, front left Part I 34 35 6 792 289		1
Brake disc, ventilated Part I 34 11 6 792 219		2
Repair kit, brake pads asbestos-free Part I 34 21 6 873 093		1

Brake-pad sensor, rear
Part I 34 35 6 792 292

1

Windshield washer antifreeze
Part I 83 12 2 413 059

1

— Job

Description:

Considered as a repeat visit No

Customer's own words

Presentation for emission inspection
Flat rate unit I 00 00 527

5 FRU

(Statutory) vehicle inspection
Flat rate unit I 00 12 159

0 FRU

— Job

Description:

Considered as a repeat visit No

Customer's own words

HU intern 00000000
Flat rate unit I 99 99 999

Local







1 FRU

— 05/01/2018 Key

83258 Km

00353

Key 0

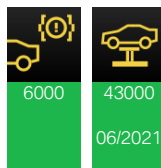



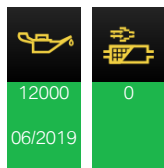


— 16/06/2017 Key

63466 Km

00353

Key 0

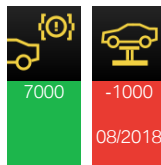






— 16/06/2017 Key

63466 Km

00353

Key 0

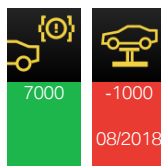






— 16/06/2017 Service

63466 Km

00353
Autohaus
Kaltenbach
GmbH&Co.
KG, Wiehl

Automatic

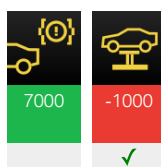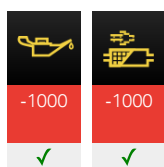

— 16/06/2017 Repair

63466 Km

00353
Autohaus
Kaltenbach

Job
Job
Job
Job

— Job

Description:

Considered as a repeat visit No

Customer's own words

Service - standard scope	2 FRU
Flat rate unit I 00 00 105	

— Job

Description:

Considered as a repeat visit No

Customer's own words

Engine oil service	3 FRU
Flat rate unit I 00 00 610	

Set oil-filter element	1
Part I 11 42 8 575 211	

BMW Engine Oil LL04 5W30	5
Part I 83 21 2 405 948	

— Job

Description:

Considered as a repeat visit No

Customer's own words

Microfilter service	2 FRU
Flat rate unit I 00 00 616	

Microfilter/activated Carbon container	1
Part I 64 11 9 237 555	

— Job

Description:

Considered as a repeat visit No

Customer's own words

Service, vehicle check	6 FRU
Flat rate unit I 00 00 624	

Windshield washer antifreeze	1
Part I 83 12 2 409 031	

— Job

Description:

Considered as a repeat visit No

Customer's own words

Service - air filter element	2 FRU
Flat rate unit I 00 00 602	

Air filter element	1
Part I 13 71 8 511 668	

— Job

Description:

Considered as a repeat visit No


Customer's own words

Service fuel filter 3 FRU
Flat rate unit I 00 00 604

Fuel filter cartridge 1
Part I 13 32 8 572 522

Hose clamp 1
Part I 07 12 9 952 104

— 18/08/2016 Key 31486 Km 00353 Key 0

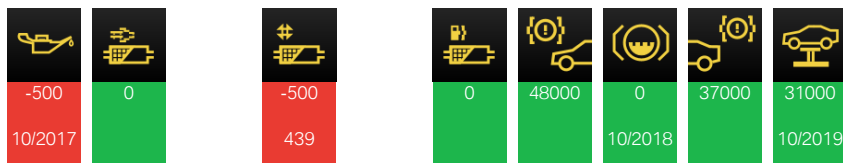

— 18/08/2016 Service 31486 Km 00353 Automatic
Autohaus
Kaltenbach
GmbH&Co.
KG, Wiehl



— 18/08/2016 Repair 31486 Km 00353 Job
Autohaus
Kaltenbach
GmbH & Co.
KG , Wiehl

— Job

Description:

Considered as a repeat visit No

Customer's own words

Service - standard scope 2 FRU
Flat rate unit I 00 00 105

— Job

Description:

Considered as a repeat visit No

Customer's own words

Engine oil service 3 FRU
Flat rate unit I 00 00 610

Set oil-filter element 1
Part I 11 42 8 575 211

BMW Engine Oil LL04 5W30 5
Part I 83 21 2 405 948

— Job

Description:


Considered as a repeat visit No

Customer's own words

Microfilter service	2 FRU
Flat rate unit I 00 00 616	

Microfilter/activated Carbon container	1
Part I 64 11 9 237 555	

— 07/04/2016 Key 16719 Km 00353 Key 0

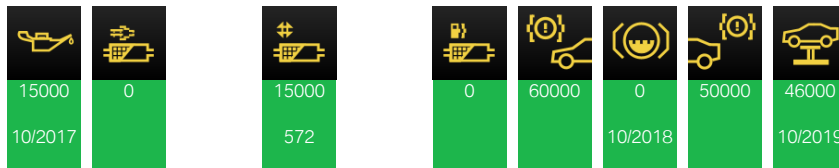

— 07/04/2016 Repair 16719 Km 00353 Job
Autohaus
Kaltenbach
GmbH & Co.
KG, Wiehl

— Job

Description:

Considered as a repeat visit No

Customer's own words

Fehler PDC	Local	40 FRU
Flat rate unit I -		

— Job

Description:

Considered as a repeat visit No

Customer's own words

Vorne linke Seite wurde schon erneuert ev.Steuerg.	Local	1 FRU
Flat rate unit I -		

— 07/04/2016 Warranty 16724 Km 00353 Job: Ultrasonic sensor, front (PDC / PMA)

— Job: Ultrasonic sensor, front (PDC / PMA)

Description: Ultrasonic sensor, front (PDC / PMA)

Considered as a repeat visit No

Customer's own words

Performing vehicle test	4 FRU
Flat rate unit I 00 00 006	

Troubleshooting electrical/electronic system	15 FRU
Flat rate unit I 61 00 009	

Replacing front bumper wiring harness	11 FRU
Flat rate unit I 61 12 562	

Ultrasonic sensor, front (PDC / PMA)
Defect I 66 20 07 15 00

Universal socket housing uncoded	1
Part I 61 13 8 383 300	

Set of cables, front apron	1
Part I 61 12 9 365 042	

Repair kit, socket housing	1
----------------------------	---

Part I 61 13 2 359 991

— 24/03/2016 Warranty 13210 Km 00353 Job: Ultrasonic sensor, front (PDC / PMA)

— Job: Ultrasonic sensor, front (PDC / PMA)

Description: Ultrasonic sensor, front (PDC / PMA)

Considered as a repeat visit No

Customer's own words


Performing vehicle test 4 FRU
Flat rate unit I 00 00 006

Removing and installing/replacing ultrasonic sensor, front left 10 FRU
Flat rate unit I 66 20 515

Ultrasonic sensor, front (PDC / PMA)
Defect I 66 20 07 15 00

Ultrasonic sensor Mineral Grey 1
Part I 66 20 9 261 581

— 09/03/2016 Key 13210 Km 00353 Key 0

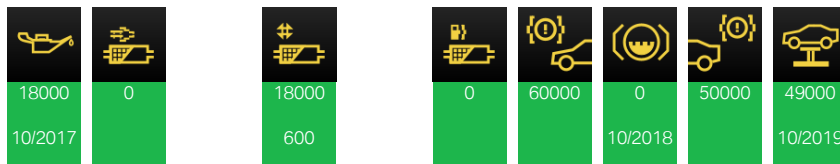

— 02/11/2015 Repair 0 Km 23309 Job
Autohaus Job
Kaltenbach Job
GmbH & Co. Job
KG,
Remscheid

— Job

Description:

Considered as a repeat visit No

Customer's own words

Free pre-delivery check 9 FRU
Flat rate unit I 00 00 009

Windshield washer antifreeze 5
Part I 83 12 2 413 061

— Job

Description:

Considered as a repeat visit No

Customer's own words

Job time without allowance for / body equipment 0 FRU
Flat rate unit I 51 99 000

WARNWESTEN Set 2 Stück Local 1
Part I FT99 99 9 999 7

— Job

Description:

Considered as a repeat visit No

Customer's own words

Freischaltcode Navigation angefordert Flat rate unit I 01 00 006	Local	1 FRU
Code HU-B-Navig. card/map Europe Initial Part I 65 90 2 410 336		1

— Job

Description:

Considered as a repeat visit No

Customer's own words

UMWELTPLAKETTE Flat rate unit I 99 99 999	Local	1 FRU
--	-------	-------