

Thank you for ordering from us!

www.checkvin.eu

Vehicle

BMW 320D XDR A, 140KW

WBA8J11050K629386



Development code
Colour
Actual integration level
Start of warranty

F31
black-sapphire metallic
F020-22-07-530
19 February 2016

Technical campaigns

There are no Campaigns for this vehicle.

Warranty extension/VIN-based goodwill

Status	Campaign number	Description
Open	1SACC011056	Exhaust gas recirculation cooler Bx7 Local campaign number: -

Special information

There are no Campaigns for this vehicle.

Restrictions on the warranty

There are no restrictions on the warranty.

⚠ Market-specific restrictions are not currently displayed. Please check this in WDF/WXE via S-Gate.

Live Diagnosis

 There are no service solutions for Live Diagnosis.

Service contracts

No BSI contracts

Information on faults workshop/Service Consultation

There is no information on faults.

Navigation map

Installed map	Enabling code (subscription)	Latest navigation map included in subscription	Latest navigation map subject to charge
Road Map EUROPE Route 2016-1 (As of: 5 Sept 2024)	Enabling code valid for navigation maps with release date up to 31 Dec 2025 (SWID: 00B4008F).	Road Map EUROPE WEST Route 2025	-

Vehicle details

Vehicle type	Passenger car
Brand	BMW
Model	320D XDR A
Body	TOUR
Vehicle identification number (last 7 digits)	K629386
Vehicle identification number (17 digits)	WBA8J11050K629386
Development code	F31
Steering	LL
Engine	B47O
Engine number	60659527
Exhaust re-treatment	EURO6, W, PI/CI, M, N1 I
Transmission	AUT
Transmission number	0089762ZN5
Head unit serial number	MM01DFG1352328
Drive	ALLR
Integration level, works	F020-15-11-505
Production date	10 Feb 2016
Production plant	Muenchen
Delivery date	11 Mar 2016
Delivering retailer	Fuhrpark, München, DE
National-market version	EUR
Paint code	475
Upholstery code	CBAT
Model code	8J21
Basic type	8J11
Lead type	8J21

Optional equipment

Optional equipment ex works:

- 01CA Selection of COP-relevant vehicles
- 0205 Automatic transmission
- 0216 Hydro steering-servotronic
- 0230 EU-specific additional contents
- 0258 Tyres with runflat properties
- 02FM BMW LA wheel, V-spoke 398
- 02VB Tyre pressure display
- 02XE Leather sports steering wheel
- 0302 Alarm system
- 0322 Comfort access system
- 03AA Roof railing black
- 03AC Trailer coupling
- 0423 Floor mats velours
- 0428 Warning triangle and first aid kit
- 0430 Interior/outside mirror with auto dip
- 0431 Interior mirror with automatic-dip
- 0481 Sports seat
- 0488 Lumbar support, driver and passenger
- 0493 Storage compartment package
- 0494 Seat heating driver/passenger
- 04AE Armrest front, retractable
- 04LV black high-gloss accent korall-rot
- 0508 Park Distance Control (PDC)
- 0521 Rain sensor
- 0534 Automatic air conditioning
- 0544 Cruise control with braking function
- 0548 Kilometre speedo
- 0563 Lights package
- 0575 Additional 12V power socket
- 05A2 LED headlight
- 05AC High-beam assistant
- 05AL Active Protection
- 05DA Passenger airbag deactivation
- 05DC Rear-seat headrests, folding
- 0606 Navigation system Business
- 0698 Area-Code 2 for DVD
- 06AC Intelligent emergency call
- 06AE Teleservices
- 06AK Connected Drive Services
- 06AM Real-Time Traffic Information
- 06AN Concierge Services
- 06AP Remote Services
- 06NH Hands-free system with USB interface
- 06WA Instrument panel with extended scope
- 07AC Sport Line
- 07LD Modell Sport Line
- 07S9 Connected Drive Services Paket
- 0801 German version
- 0851 Language version German
- 0879 On-board literature, German
- 08KA Oil service interval 24 mths / 30,000 km
- 08TH Road sign detection
- 09BD Business Package
- 0XL3 BMW Individual leather steering wheel
- A090 90 Ah AGM battery
- POLS Cloth cushion

Retrofitted optional equipment:

This vehicle has no retrofits.

Vehicle histories

Date		Type	Vehicle mileage		Retailer	Overview	
—		05/09/2024	Key	209022 Km	04776	Key 0	
							
26000	26000	26000	26000	50000	45000	60000	
06/2026	06/2026	06/2026	06/2026		06/2026	06/2028	02/2025

—	05/09/2024	Warranty	209024 Km	04776	Job: F1x F2x F3x G0x G1x G3x B47O B47K B47U B47T Replacing EGR cooler (high-temperature) Job: E84 Fx Gx Bx7 Nx7 Customer notification exhaust gas recirculation cooler Job: Fx Checking driver's airbag and replacing if necessary (SDI conversion)
---	------------	----------	-----------	-------	---

- Job: F1x F2x F3x G0x G1x G3x B47O B47K B47U B47T Replacing EGR cooler (high-temperature)

Description: F1x F2x F3x G0x G1x G3x B47O B47K B47U B47T Replacing EGR cooler (high-temperature)

Considered as a repeat visit No

Customer's own words

Replace exhaust gas recirculation cooler, including exhaust gas recirculation valve Flat rate unit I 00 74 057	25 FRU
---	--------

Additional work: run function test for pressure sensor system Flat rate unit I 00 74 636	3 FRU
---	-------

Additional work: enter component identification of new exhaust gas recirculation cooler in diagnostic system Flat rate unit I 00 74 637	1 FRU
--	-------

Additional work cleaning the exhaust gas recirculation pipe Flat rate unit I 00 74 638	6 FRU
---	-------

F1x F2x F3x G0x G1x G3x B47O B47K B47U B47T Replacing EGR cooler (high-temperature)
Defect I 00 11 13 07 00

Exhaust gas radiator high temperature Part I 11 71 7 822 347	1
---	---

Acoustic cover front Part I 11 14 8 490 577	1
--	---

EGR small parts set Part I 11 71 8 490 640	1
---	---

Vacuum hose black Part I 11 65 8 595 650	1
---	---

Pipe union Part I 11 71 7 799 853	2
--------------------------------------	---

Holder Part I 61 13 1 369 832	1
----------------------------------	---

Connection piece Part I 11 65 7 803 012	1
--	---

O-ring Part I 11 61 8 512 681	1
----------------------------------	---

- Job: E84 Fx Gx Bx7 Nx7 Customer notification exhaust gas recirculation cooler

Description: E84 Fx Gx Bx7 Nx7 Customer notification exhaust gas recirculation cooler

Considered as a repeat visit No

Customer's own words

Administrative effort 1 FRU
Flat rate unit | 00 74 758

E84 Fx Gx Bx7 Nx7 Customer notification exhaust gas recirculation cooler
Defect | 00 11 35 07 00

— Job: Fx Checking driver's airbag and replacing if necessary (SDI conversion)

Description: Fx Checking driver's airbag and replacing if necessary (SDI conversion)


Considered as a repeat visit No

Customer's own words


Check steering wheel (airbag module not affected) 1 FRU
Flat rate unit | 00 76 854

Fx Checking driver's airbag and replacing if necessary (SDI conversion)
Defect | 00 32 55 03 00


— 29/08/2024 Key 208646 Km 34388 Remote KeyRead

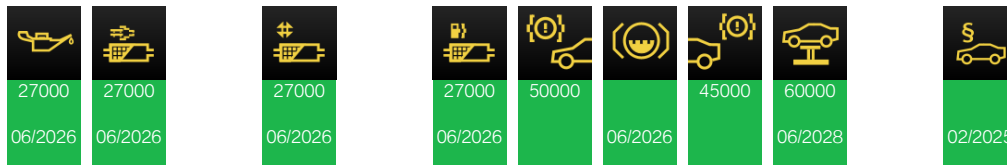

— 10/10/2023 Key 190812 Km 04776 Key 0

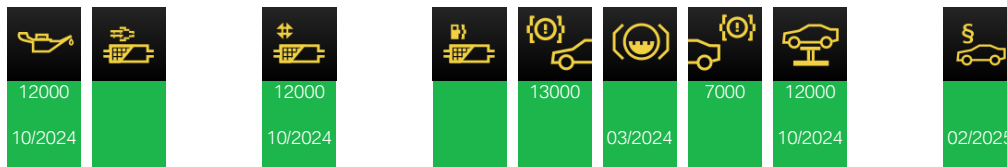

— 02/10/2023 Key 189913 Km 04776 Key 0

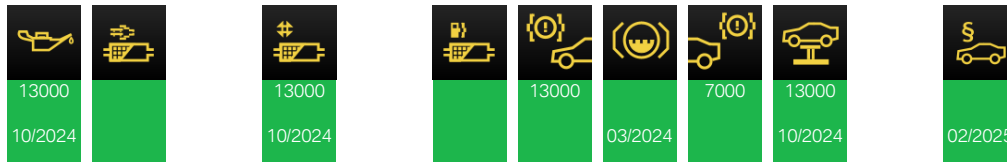

— 02/10/2023 Repair 189913 Km 04776 Autohaus Fischer GmbH, Münchberg Job Job

— Job

Description: Fahrzeugtest durchführen

Considered as a repeat visit No

Customer's own words

Performing vehicle test 4 FRU
Flat rate unit | 00 00 006

Supporting the voltage of the vehicle electrical system/recharging the vehicle electrical system battery 1 FRU
Flat rate unit | 61 21 528

Troubleshooting 6 FRU
Flat rate unit | 12 00 009

Replace charging pressure sensor 1 FRU
Flat rate unit | 13 62 535


— Job

Description:
Considered as a repeat visit No
Customer's own words

Continuing vehicle test and deleting fault memory 2 FRU
Flat rate unit I 61 00 980

Sensor Ladedruck Local 1
Part I 13 62 8 637 896

— 28/09/2023 Key 189775 Km 04776 Key 0

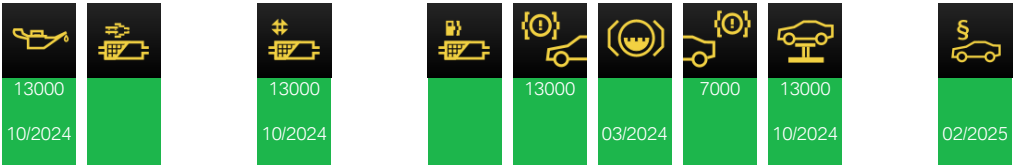

— 28/09/2023 Repair 189775 Km 04776 Job
Autohaus
Fischer GmbH ,
Münchberg

— Job

Description: Fehlermeldung: keine volle Antriebsleistung
Considered as a repeat visit No
Customer's own words

!!! unknown BMW-Id M000001 Verschraubung für Lamdasonde Local 4 FRU
anwärmen und Gewinde nachschneiden !!!
Flat rate unit I M00 00 01

Performing vehicle test 4 FRU
Flat rate unit I 00 00 006

Supporting the voltage of the vehicle electrical system/recharging the 1 FRU
vehicle electrical system battery
Flat rate unit I 61 21 528


Troubleshooting 6 FRU
Flat rate unit I 12 00 009

Replacing the monitoring oxygen sensor 4 FRU
Flat rate unit I 13 62 664

Continuing vehicle test and deleting fault memory 2 FRU
Flat rate unit I 61 00 980

Lambdasonde L=540 Local 1
Part I 13 62 8 589 104

— 03/05/2023 Key 183539 Km Key 0

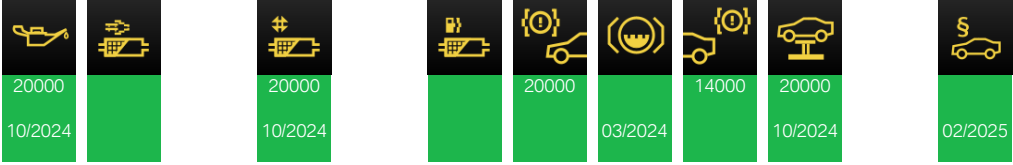

— 03/05/2023 Repair 183539 Km 04776 Job
Autohaus
Fischer GmbH ,
Münchberg

— Job

Description: Eine Radelektronik RDC ersetzen (Rad abgebaut) (ohne Auswuchten und Reifendruck-Kontrolle initialisieren)

Considered as a repeat visit No

Customer's own words


Replacing one TPM wheel electronics	3 FRU
Flat rate unit I 36 11 537	

Radelektronikmodul RDCi m. Schraubventil	Local	1
Part I 36 10 6 881 890		

— 27/10/2022 Key

173602 Km

Key 0

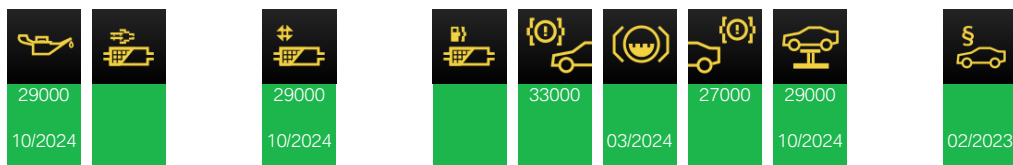

— 17/10/2022 Repair

173604 Km

04776
Autohaus
Fischer GmbH,
Münchberg

Job

— Job

Description:

Considered as a repeat visit No

Customer's own words

!!! unknown BMW-Id KN00000 Zeitzuschlag für eine Hauptarbeit !!!	Local	2 FRU
Flat rate unit I KN00 00 0		

Removing and installing rear bumper panel	5 FRU
Flat rate unit I 51 12 656	

Replacing rear bumper panel	1 FRU
Flat rate unit I 51 12 657	

Removing and installing/replacing rear centre bumper guide	2 FRU
Flat rate unit I 51 12 825	

Additional work with Park Distance Control	5 FRU
Flat rate unit I 66 20 602	

Panel, bumper, primed, rear	1
Part I 51 12 7 384 619	

Set, mounting, PDC/PMA sensor, rear	1
Part I 51 12 7 445 160	

Trim strip, black	1
Part I 51 12 7 384 571	

Adhesive set K6	1
Part I 83195A547C4	

Guide, centre rear	1
Part I 51 12 7 260 462	


Ultrasonic sensor black	1
Part I 66 20 9 261 582	

— 18/08/2022 Key

170901 Km

04776

Key 0

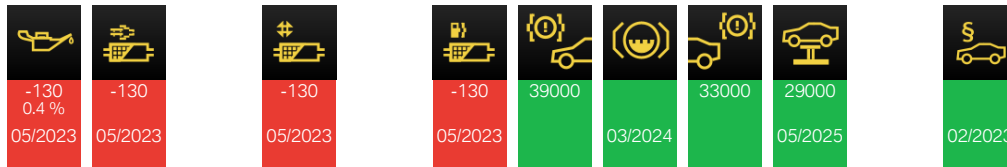

— 18/08/2022 Warranty 170906 Km 04776 Job: F1x F2x F3x B47O B47K B47U Programming control units (DDE)

— Job: F1x F2x F3x B47O B47K B47U Programming control units (DDE)

Description: F1x F2x F3x B47O B47K B47U Programming control units (DDE)

Considered as a repeat visit No

Customer's own words

Program control units 9 FRU
Flat rate unit I 00 71 349

F1x F2x F3x B47O B47K B47U Programming control units (DDE)
Defect I 00 13 50 03 00

— 10/12/2021 Repair 155285 Km 04776 Job
Autohaus
Fischer GmbH ,
Münchberg

— Job

Description: Schlüssel-Freigeben--sperren--

Considered as a repeat visit No

Customer's own words

Performing vehicle test 4 FRU
Flat rate unit I 00 00 006

Supporting the voltage of the vehicle electrical system/recharging the
vehicle electrical system battery 1 FRU
Flat rate unit I 61 21 528

Vehicle diagnosis - carrying out the ABL 2 FRU
Flat rate unit I 61 00 006

Continuing vehicle test and deleting fault memory 2 FRU
Flat rate unit I 61 00 980

Radio remote control Sport Line 1
Part I 66125A407E7

Slide-in key 1
Part I 51 21 7 268 293

— 19/08/2021 Repair 113100 Km 04776 Job
Autohaus
Fischer GmbH ,
Münchberg

— Job

Description:

Considered as a repeat visit No

Customer's own words

Estimating costs to repair car damaged in accident 1 FRU
Flat rate unit I 00 12 209

— 12/02/2020 Repair 113100 Km 04776 Job
 Autohaus
 Fischer GmbH ,
 Münchberg

— Job

Description:


Considered as a repeat visit No

Customer's own words


Estimating costs to repair car damaged in accident
 Flat rate unit I 00 12 209

1 FRU

— 31/07/2019 Key 113095 Km 04776 Key 1

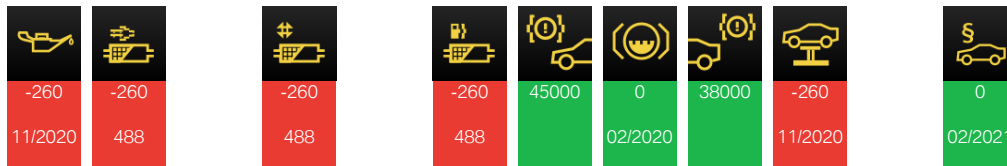


— 31/07/2019 Key 113095 Km 04776 Key 1

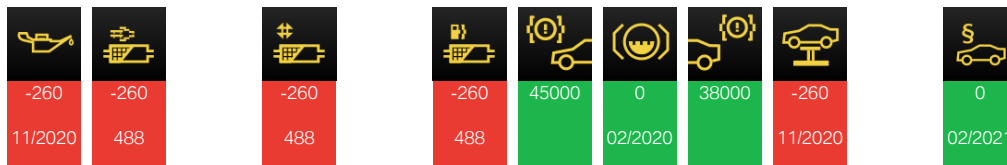

— 31/07/2019 Service 113095 Km 04776 Automatic

Autohaus
 Fischer GmbH,
 Münchberg

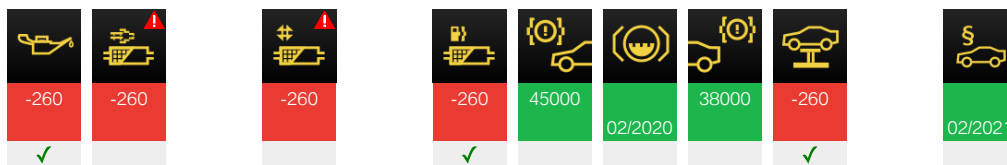

— 31/07/2019 Repair 113100 Km 04776 Job
 Autohaus
 Fischer GmbH ,
 Münchberg

— Job

Description: Service

Considered as a repeat visit No

Customer's own words

Service - standard scope
 Flat rate unit I 00 00 105

2 FRU

Engine oil service
 Flat rate unit I 00 00 610

3 FRU

Service fuel filter
 Flat rate unit I 00 00 604

3 FRU

Service, vehicle check
 Flat rate unit I 00 00 624

6 FRU

!!! unknown BMW-Id 99999005030 MOTORÖL 5W30 eni i-Sint MS Local
 5w-30 !!!
 Part I 99 99 9 005 030

5

Set oil-filter element Part I 11 42 8 575 211	1
Fuel filter cartridge Part I 13 32 8 572 522	1
Clamping bracket Part I 13 32 7 789 220	1
Expanding rivet Part I 51 47 1 911 992	2

— Job

Description: 0011830400 : AGR-Kühler prüfen und ggf. ersetzen

Considered as a repeat visit No

Customer's own words

Check exhaust gas recirculation cooler index Flat rate unit I 00 67 702	3 FRU
Replace exhaust-gas recirculation cooler and replace or remount exhaust-gas recirculation valve; clean exhaust gas recirculation pipe Flat rate unit I 00 66 955	28 FRU
Perform additional work for pressure sensor system function Flat rate unit I 00 67 695	3 FRU
exhaust cooler Part I 11 71 8 596 444	1
Set of small parts Part I 11 71 8 597 652	1
Pipe union Part I 11 71 7 799 853	2
O-ring Part I 11 61 8 512 681	1
Oval head screw Part I 35 21 7 685 343	2
Anti-freeze Part I 83 19 2 218 347	1.5
Vent screw Part I 11 53 7 793 373	1

— 31/07/2019 Warranty 113100 Km 04776 Job: F10 F11 F25 F26 F31 F34 F36 B47O Replacing exhaust-gas recirculation cooler

— Job: F10 F11 F25 F26 F31 F34 F36 B47O Replacing exhaust-gas recirculation cooler

Description: F10 F11 F25 F26 F31 F34 F36 B47O Replacing exhaust-gas recirculation cooler

Considered as a repeat visit No

Customer's own words

Check exhaust gas recirculation cooler index Flat rate unit I 00 67 702	3 FRU
Replace exhaust-gas recirculation cooler and replace or remount exhaust-gas recirculation valve; clean exhaust gas recirculation pipe Flat rate unit I 00 66 955	28 FRU
Perform additional work for pressure sensor system function Flat rate unit I 00 67 695	3 FRU

F10 F11 F25 F26 F31 F34 F36 B47O Replacing exhaust-gas
recirculation cooler
Defect I 00 11 83 04 00

exhaust cooler
Part I 11 71 8 596 444

1

Set of small parts
Part I 11 71 8 597 652

1

Pipe union
Part I 11 71 7 799 853

2

O-ring
Part I 11 61 8 512 681

1

Oval head screw
Part I 35 21 7 685 343

2

Vent screw
Part I 11 53 7 793 373

1

— 20/02/2019 Warranty 98129 Km 04776 Job

— Job

Description:

Considered as a repeat visit No

Customer's own words

Check index exhaust-gas recirculation cooler (then continue check with
exhaust-gas recirculation cooler)
Flat rate unit I 00 67 710

1 FRU

Visual inspection of EGR cooler output and checking cooler intake with
CCM coolant level
Flat rate unit I 00 67 153

13 FRU

Defect I 00 11 10 05 00










Gasket Steel
Part I 11 71 8 579 364

1

Oval head screw
Part I 35 21 7 685 343

2

— 19/02/2019 Key 98128 Km 04776 Key 1



— 19/02/2019 Repair 98128 Km 04776 Job

Autohaus
Fischer GmbH,
Münchberg

Job

— Job

Description:

Considered as a repeat visit No

Customer's own words

— Job

Description:

Considered as a repeat visit No

Customer's own words

— 09/11/2018 Key 85177 Km Key 1

 -4100 02/2020	 0	 -4100 477	 0	 17000	 0 02/2020	 9000	 24000 02/2022	 0 03/2019
---	--	---	--	--	---	---	--	---

— 09/11/2018 Key 85177 Km Key 1

 -4100 02/2020	 0	 -4100 477	 0	 17000	 0 02/2020	 9000	 24000 02/2022	 0 03/2019
---	--	---	--	--	---	---	--	---

— 09/11/2018 Service 85177 Km 04776 Automatic
Autohaus
Fischer GmbH,
Münchberg

 -4100 ✓	 0	 -4100 ✓	 0	 17000	 0 02/2020	 9000	 24000	 03/2019
---	--	---	--	--	---	---	---	--

— 09/11/2018 Repair 85183 Km 04776 Job
Autohaus
Fischer GmbH,
Münchberg

— Job

Description: Service Motoröl

Considered as a repeat visit No

Customer's own words

Engine oil service 3 FRU
Flat rate unit I 00 00 610

Service - standard scope 2 FRU
Flat rate unit I 00 00 105

Microfilter service 2 FRU
Flat rate unit I 00 00 616

!!! unknown BMW-Id 99999005030 MOTORÖL 5W30 eni i-Sint MS Local 5
5w-30 !!!
Part I 99 99 9 005 030


Set oil-filter element 1
Part I 11 42 8 575 211

Microfilter/activated Carbon container 1
Part I 64 11 9 237 555

— 16/10/2018 Key 81338 Km Key 1

 -300 02/2020	 0	 -300 501	 0	 18000	 0 02/2020	 11000	 26000 02/2022	 0 03/2019
--	--	--	--	--	---	--	--	---

— 03/04/2018 Key 59762 Km 04776 Key 1

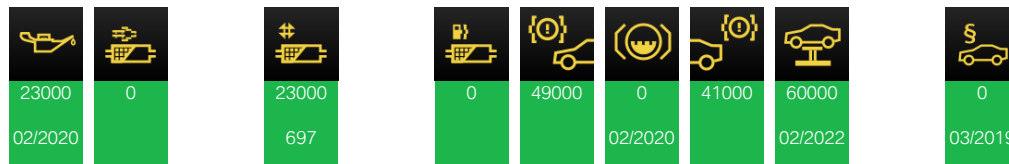

— 03/04/2018 Warranty 59762 Km 04776 Job: Exhaust manifold

— Job: Exhaust manifold

Description: Exhaust manifold

Considered as a repeat visit No

Customer's own words

Working time without specification/exhaust system 0 FRU
Flat rate unit | 18 99 000

Removing and installing/replacing the exhaust manifold 0 FRU
Flat rate unit | 18 40 040

Exhaust manifold
Defect | 11 62 00 48 00

Gasket ring 1
Part | 11 62 8 519 884

Gasket 1
Part | 18 30 8 513 651

Clamp 1
Part | 11 62 8 519 885

V-band clamp 1
Part | 18 30 8 512 137

Gasket Steel 2
Part | 11 62 8 509 783

Gasket Steel 1
Part | 11 62 8 576 287

Torx bolt 2
Part | 11 71 2 249 909

Gasket ring 2
Part | 13 62 7 811 934

Flange nut 8
Part | 11 62 8 597 827

Gasket ring 2
Part | 07 11 9 905 041

Hex Bolt with washer 10
Part | 31 10 6 858 433

ASA-Bolt 1
Part | 07 12 9 904 559

— 07/03/2018 Warranty 55956 Km 04776 Job: Exhaust turbocharger (ATL)

— Job: Exhaust turbocharger (ATL)

Description: Exhaust turbocharger (ATL)

Considered as a repeat visit No

Customer's own words








Performing vehicle test Flat rate unit I 00 00 556	2 FRU
Supporting the voltage of the vehicle electrical system/recharging the vehicle electrical system battery Flat rate unit I 61 21 528	1 FRU
Job time without allowance for / engine Flat rate unit I 11 99 000	2 FRU
Removing and installing/replacing exhaust turbocharger Flat rate unit I 11 65 520	18 FRU
Job time without allowance for / engine Flat rate unit I 11 99 000	2 FRU
Exhaust turbocharger (ATL) Defect I 11 65 05 39 00	
Exhaust turbocharger Part I 11 65 8 570 083	1
Exhaust turbocharger add-on kit Part I 11 65 2 456 228	1
Filtered air pipe with resonator Part I 13 71 8 573 994	1
Pipe Part I 13 71 8 473 146	1
Oil pipe inlet Part I 11 42 8 513 616	1
Hex Bolt with washer Part I 31 10 6 858 433	10
Gasket ring Part I 13 62 7 811 934	2

— 06/03/2018 Key

55956 Km

04776

Key 1

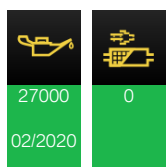

— 08/02/2018 Warranty

54496 Km

04776

Job: F1x F2x F3x B47
programming control units and if
necessary, replacing the EGR valve

— Job: F1x F2x F3x B47 programming control units and if necessary, replacing the EGR valve

Description: F1x F2x F3x B47 programming control units and if necessary, replacing the EGR valve**Considered as a repeat visit** No**Customer's own words**

Carrying out the ABL, programming the control units and replacing the exhaust-gas recirculation valve
Flat rate unit I 00 64 942

F1x F2x F3x B47 programming control units and if necessary, replacing the EGR valve
Defect I 00 11 45 04 00

EGR-valve
Part I 11 71 8 594 492

Gasket Steel
Part I 11 71 8 579 364

Oval head screw
Part I 35 21 7 685 343

2

Hose clamp
Part I 07 12 9 952 104


2

— 06/02/2018 Key

54488 Km

04776

Key 1

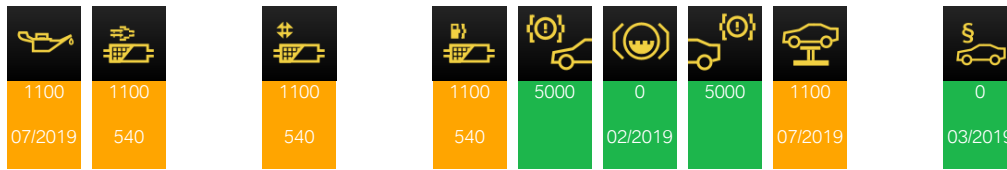


— 06/02/2018 Service

54488 Km

04776

Automatic

Autohaus
Fischer GmbH,
Münchberg

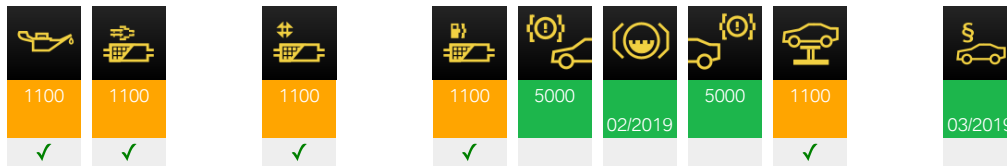

— 06/02/2018 Repair

54496 Km

04776

Job

Autohaus
Fischer GmbH ,
Münchberg

— Job

Description: Service fällig

Considered as a repeat visit No

Customer's own words

Engine oil service 3 FRU
Flat rate unit I 00 00 610

Service - standard scope 2 FRU
Flat rate unit I 00 00 105

Service - air filter element 2 FRU
Flat rate unit I 00 00 602

Service fuel filter 3 FRU
Flat rate unit I 00 00 604

Microfilter service 2 FRU
Flat rate unit I 00 00 616

Service, vehicle check 6 FRU
Flat rate unit I 00 00 624

Bleed the cooling system and check it for watertightness with the special tool 3 FRU
Flat rate unit I 17 00 539

!!! unknown BMW-Id 99999005030 MOTORÖL 5W30 AGIP Local 5
MOTORÖL FORMULA MS 5W30 !!!
Part I 99 99 9 005 030

!!! unknown BMW-Id 90122298525 Scheibenklar mit Frostschutz !!! Local 1
Part I 90 12 2 298 525

Set oil-filter element 1
Part I 11 42 8 575 211

Air filter element Part I 13 71 8 511 668	1
Fuel filter cartridge Part I 13 32 8 572 522	1
Microfilter/activated Carbon container Part I 64 11 9 237 555	1
Clamping bracket Part I 13 32 7 789 220	1
Hex Bolt with washer Part I 07 11 9 906 200	1
Axial securing clip Part I 13 32 8 511 095	1
Anti-freeze Part I 83 19 2 218 347	1

— Job

Description: Steuergeräte prog--AGR-prüfen**Considered as a repeat visit** No**Customer's own words**

Carrying out the ABL, programming the control units and replacing the exhaust-gas recirculation valve
Flat rate unit I 00 64 942

EGR-valve
Part I 11 71 8 594 492

Gasket Steel
Part I 11 71 8 579 364

Oval head screw
Part I 35 21 7 685 343

Hose clamp
Part I 07 12 9 952 104

— 17/07/2017 Key

26912 Km

04776

Key 1

									
1600	0	1600	0	31000	0	23000	30000	0	0
02/2018		226			02/2019		02/2020		03/2019

— 17/07/2017 Service

26912 Km

04776

Automatic

Autohaus
Fischer GmbH,
Münchberg

									
1600		1600		31000	02/2019	23000	30000		03/2019
✓		✓							

— 17/07/2017 Repair

26918 Km

04776

Job

Autohaus
Fischer GmbH ,
Münchberg

— Job

Description: Service fällig
Considered as a repeat visit No
Customer's own words

Service - standard scope Flat rate unit I 00 00 105	2 FRU
Engine oil service Flat rate unit I 00 00 610	3 FRU
Microfilter service Flat rate unit I 00 00 616	2 FRU
!!! unknown BMW-Id 99999005030 MOTORÖL 5W30 AGIP MOTORÖL FORMULA MS 5W30 !!! Part I 99 99 9 005 030	Local5
Set oil-filter element Part I 11 42 8 575 211	1
Microfilter/activated Carbon container Part I 64 11 9 237 555	1
Pollen-filter housing cleaner Part I 83 19 2 180 509	1

— 23/01/2017 Repair 4779 Km 04776 Job
Autohaus
Fischer GmbH ,
Münchberg

— Job

Description: 4 Kpl.-Räder wechseln. 891,- incl.
Considered as a repeat visit No
Customer's own words

!!! unknown BMW-Id 3600006 Vier Räder wechseln (LM-Felgen) !!! Flat rate unit I 36 00 006	Local6 FRU
--	------------

— 20/01/2017 Key 4782 Km 04776 Key 0

 22000 02/2018	 0	 22000 405	 0	 50000	 0 02/2019	 50000	 50000	 50000 02/2020	 0 03/2019
---	--	---	--	--	---	--	---	---	---