

Thank you for ordering from us!

www.checkvin.eu

Vehicle

BMW 520D XDR A, 140KW

WBA5E71010D785455



Development code
Colour
Actual integration level
Start of warranty

F10
space-grey metallic
F010-14-07-505
2 December 2014

Technical campaigns

There are no Campaigns for this vehicle.

Warranty extension/VIN-based goodwill

Status	Campaign number	Description
Open	1SACC011056	Exhaust gas recirculation cooler Bx7 Local campaign number: -

Special information

There are no Campaigns for this vehicle.

Restrictions on the warranty

There are no restrictions on the warranty.

⚠ Market-specific restrictions are not currently displayed. Please check this in WDF/WXE via S-Gate.

Live Diagnosis

 There are no service solutions for Live Diagnosis.

Service contracts

No BSI contracts

Information on faults workshop/Service Consultation

There is no information on faults.

Navigation map

Installed map	Enabling code (subscription)	Latest navigation map included in subscription	Latest navigation map subject to charge
Road Map EUROPE Next 2014-2 (As of: 27 Sept 2023)	Enabling code valid for navigation maps with release date up to 31 Dec 2025 (SWID: 00A9008F).	Road Map EUROPE WEST Next 2025	-

Vehicle details

Vehicle type	Passenger car
Brand	BMW
Model	520D XDR A
Body	LIM
Vehicle identification number (last 7 digits)	D785455
Vehicle identification number (17 digits)	WBA5E71010D785455
Development code	F10
Steering	LL
Engine	B47O
Engine number	91249058
Exhaust re-treatment	EURO6, W, PI/CI, M, N1 I
Transmission	AUT
Transmission number	0031773XAT
Head unit serial number	HB2068E7904949
Drive	ALLR
Integration level, works	F010-14-07-505
Production date	28 Oct 2014
Production plant	Dingolfing
Delivery date	31 Oct 2014
Delivering retailer	BAYERN AUTO SPORT, COUDEKERQUE BRANCHE, FR
National-market version	EUR
Paint code	A52
Upholstery code	LCSW
Model code	5E81
Basic type	5E71
Lead type	5E81

Optional equipment

Optional equipment ex works:

01CA Selection of COP-relevant vehicles
 01CB CO2 equipment
 01CC Auto start/stop function
 01CD Brake Energy Regeneration
 0230 EU-specific additional contents
 0255 Sports leather steering wheel
 0258 Tyres with runflat properties
 02K2 BMW LA wheel, V spoke 328
 02PA Locking wheel bolt
 02TE Automatic transmission w/ shift paddles
 02VB Tyre pressure display
 0423 Floor mats velours
 0428 Warning triangle and first aid kit
 0430 Interior/outside mirror with auto dip
 0431 Interior mirror with automatic-dip
 0441 Smoker package
 0459 Seat adjustment, electric, with memory
 0465 Through-loading system
 04AT Interior trim finishers black high-gloss
 04U2 Driving experience switch incl. ECO PRO
 0502 Headlight cleaning system
 0508 Park Distance Control (PDC)
 0548 Kilometre speedo
 0609 Navigation system Professional
 0698 Area-Code 2 for DVD
 06AC Intelligent emergency call
 06AE Teleservices
 06AK Connected Drive Services
 06AM Real-Time Traffic Information
 06AN Concierge Services
 06AP Remote Services
 07S9 Connected Drive Services Paket
 0854 Language version, French
 0881 On-board literature, French
 08KA Oil service interval 24 mths / 30,000 km
 08S3 Automatic locking during starting
 08TF Active pedestrian protection
 A105 105 Ah AGM battery
 LEDE Leather equipment

Retrofitted optional equipment:

This vehicle has no retrofits.

Vehicle histories

	Date	Type	Vehicle mileage		Retailer	Overview				
—	27/09/2023	Key	160075 Km		32338	Key 0				
										
	12000 07/2024		12000 07/2024		70000	-88 12 %	-88 12 %	80000	43000 07/2026	-238 32.6 %
—	05/04/2023	Key	151361 Km			Key 0				
										
	19000 07/2024		19000 07/2024		60000 07/2023			90000	47000 07/2026	-63 8.6 %
—	05/04/2023	Warranty	151361 Km		32338	Job: F1x F2x F3x G0x G1x G3x B47O B47K B47U B47T Replacing EGR cooler (high-temperature)				
— Job: F1x F2x F3x G0x G1x G3x B47O B47K B47U B47T Replacing EGR cooler (high-temperature)										
Description:						F1x F2x F3x G0x G1x G3x B47O B47K B47U B47T Replacing EGR cooler (high-temperature)				

Considered as a repeat visit No

Customer's own words

Replace exhaust gas recirculation cooler, including exhaust gas recirculation valve
Flat rate unit I 00 72 999

20 FRU

Additional work cleaning the exhaust gas recirculation pipe
Flat rate unit I 00 73 502

2 FRU

Additional work: enter component identification of new exhaust gas recirculation cooler in diagnostic system
Flat rate unit I 00 73 501

1 FRU

Additional work: run function test for pressure sensor system
Flat rate unit I 00 73 500

3 FRU

F1x F2x F3x G0x G1x G3x B47O B47K B47U B47T Replacing EGR cooler (high-temperature)
Defect I 00 11 60 06 00

Exhaust gas radiator high temperature
Part I 11 71 7 822 347

1

Pipe union
Part I 11 71 7 799 853

2

EGR small parts set
Part I 11 71 8 490 640

1

Connection piece
Part I 11 65 7 803 012

1

Holder
Part I 61 13 1 369 832

1

Vacuum hose black
Part I 11 65 8 595 650

1






Acoustic cover front
Part I 11 14 8 490 575

1

— 17/03/2021 Key

120228 Km

Key 0



— 17/03/2021 Warranty

120228 Km

32338

Job: F1x F2x F3x G0x G1x G3x B47O B47T B47U B47K Check and, if required, replace EGR cooler (recheck)

— Job: F1x F2x F3x G0x G1x G3x B47O B47T B47U B47K Check and, if required, replace EGR cooler (recheck)

Description: F1x F2x F3x G0x G1x G3x B47O B47T B47U B47K Check and, if required, replace EGR cooler (recheck)

Considered as a repeat visit No

Customer's own words

Vis. insp. of EGR cooler outlet and inlet (OK), check CC message for coolant level (OK) and note the prod. date of the installed exhaust gas recirc. cooler
Flat rate unit I 00 70 532

11 FRU

F1x F2x F3x G0x G1x G3x B47O B47T B47U B47K Check and, if required, replace EGR cooler (recheck)
Defect I 00 11 89 05 00

—	28/10/2020	Key	114440 Km				Key 0	
								
28000	28000	28000	28000	5000	-297 40.7 %	6000	60000	
10/2022	693	693	693				1413	02/2021
—	28/10/2020	Warranty	114440 Km	32338	Job: F1x F2x F3x F4x G0x G1x G3x B47 Check and if required replace exhaust-gas recirculation cooler			

— Job: F1x F2x F3x F4x G0x G1x G3x B47 Check and if required replace exhaust-gas recirculation cooler

Description: F1x F2x F3x F4x G0x G1x G3x B47 Check and if required replace exhaust-gas recirculation cooler

Considered as a repeat visit No

Customer's own words

Check exhaust-gas recirculation cooler production date (then no further repairs necessary) 5 FRU
Flat rate unit I 00 68 163

F1x F2x F3x F4x G0x G1x G3x B47 Check and if required replace exhaust-gas recirculation cooler
Defect I 00 11 40 05 00

—	27/03/2019	Key	81979 Km	32338	Key 0			
								
-500	0	-500	0	5000	0	20000	29000	0
03/2019		3			01/2020		03/2021	11/2019
—	27/03/2019	Service	81979 Km	32338	Automatic			
				BAYERN				
				AUTO SPORT,				
				ARQUES				
								
-500		-500		5000	01/2020	20000	29000	11/2019
✓		✓						
—	27/03/2019	Repair	81979 Km	32338	Job: -----			
				BAYERN	Forfait Service Huile Moteur			
				AUTO SPORT	273€TTC			
				SAINT OMER ,	Job: -----			
				ARQUES	Forfait Microfiltre 159€TTC			

— Job: -----Forfait Service Huile Moteur 273€TTC

Description: 273€ TTC

Considered as a repeat visit No

Customer's own words

-----Forfait Service Huile Moteur 273€TTC	Local	
Package I 2		
!!! unknown BMW-Id 0000105 Service prestations standard !!!	Local	2
Flat rate unit I 00 00 105		
!!! unknown BMW-Id 0000610 Service huile moteur !!!	Local	10
Flat rate unit I 00 00 610		
HUILE 0W30 LL04	Local	5

Part I 83212405674

Inspection kit I Value Line
Part I 88002449250

1

Windshield washer antifreeze
Part I 83122409031

1

— Job: -----Forfait Microfiltre 159€TTC

Description: 159€TTC

Considered as a repeat visit No

Customer's own words

-----Forfait Microfiltre 159€TTC

Local

Package I 12

!!! unknown BMW-Id 0000616 Service microfiltre !!!
Flat rate unit I 00 00 616

Local







3

— 17/01/2018 Key

62713 Km

32338

Key 0

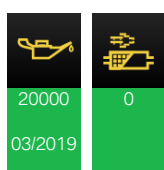




— 17/01/2018 Service

62713 Km

32338

Automatic

BAYERN
AUTO SPORT,
ARQUES

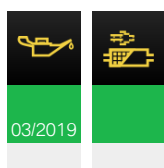

— 17/01/2018 Repair

62713 Km

32338

BAYERN
AUTO SPORT
SAINT OMER,
ARQUES

Job: [40] Forfait Liquide de Freins.
Service liquide de frein
Job
Job

— Job: [40] Forfait Liquide de Freins. Service liquide de frein

Description: 63€ TTC

Considered as a repeat visit No

Customer's own words

[40] Forfait Liquide de Freins. Service liquide de frein

Local

Package I 28

!!! unknown BMW-Id 0000105 Service prestations standard !!!
Flat rate unit I 00 00 105

Local

2

!!! unknown BMW-Id 0000618 Service liquide de frein !!!
Flat rate unit I 00 00 618

Local

6

Brake fluid DOT4 LV, low viscosity
Part I 83132405977

1

— Job

Description: RADIATEUR DE RECYCLAGE DES GAZ D'ECHAPPEMENT

Considered as a repeat visit No

Customer's own words

Solution de Mobilité - Véhicule de courtoisie Flat rate unit -	Local	0 FRU
!!! unknown BMW-Id 0064726 REMPLACER LE RADIATEUR DE RECYCLAGE DES GAZ D'ECHAPPEMENT !!! Flat rate unit 00 64 726	Local	0 FRU
exhaust cooler Part 11 71 8 596 444		0
Set of small parts Part 11 71 8 597 652		0
Anti-freeze Part 83 51 2 355 290		0

— Job

Description: CONDENSEUR DE CLIMATISEUR

Considered as a repeat visit No

Customer's own words

!!! unknown BMW-Id 0064292 CONTROLER LE CONDENSEUR DU CLIMATISEUR !!! Flat rate unit 00 64 292	Local	0 FRU
---	-------	-------

—	17/01/2018	Warranty	62713 Km	32338	Job Job: F0x F1x N47 B47 Replace air conditioning condenser
---	------------	----------	----------	-------	--

— Job

Description:

Considered as a repeat visit No

Customer's own words

Replacing the exhaust-gas recirculation cooler Flat rate unit 00 64 726	20 FRU
Defect 00 11 36 04 00	
exhaust cooler Part 11 71 8 596 444	1
Set of small parts Part 11 71 8 597 652	1

— Job: F0x F1x N47 B47 Replace air conditioning condenser


Description: F0x F1x N47 B47 Replace air conditioning condenser

Considered as a repeat visit No

Customer's own words

Check air conditioning capacitor Flat rate unit 00 64 292	9 FRU
F0x F1x N47 B47 Replace air conditioning condenser Defect 00 64 93 01 00	

—	29/09/2017	Key	57949 Km	28565	Key 0
---	------------	-----	----------	-------	-------

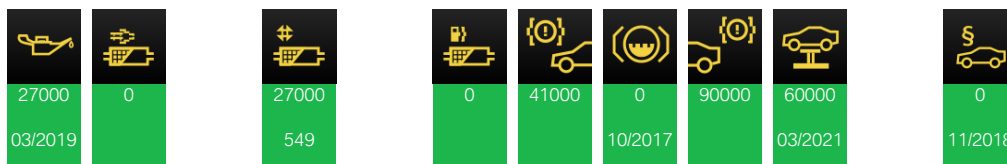

— 25/09/2017 Warranty 57887 Km 28565 Job: Air conditioning capacitor (incl. desiccant insert)

— Job: Air conditioning capacitor (incl. desiccant insert)

Description: Air conditioning capacitor (incl. desiccant insert)

Considered as a repeat visit No

Customer's own words

Check and replace air conditioning capacitor 0 FRU
Flat rate unit I 00 64 293

Air conditioning capacitor (incl. desiccant insert)
Defect I 64 53 02 48 00

Condenser, air conditioning 1
Part I 64 50 9 391 489

Gasket ring 1
Part I 64 50 8 374 959

Gasket ring 1
Part I 64 50 8 375 741

— 25/09/2017 Warranty 57887 Km 28565 Job: Air conditioning capacitor (incl. desiccant insert)

— Job: Air conditioning capacitor (incl. desiccant insert)

Description: Air conditioning capacitor (incl. desiccant insert)


Considered as a repeat visit No

Customer's own words


Removing and installing/replacing air conditioning condenser 9 FRU
Flat rate unit I 64 53 551

Air conditioning capacitor (incl. desiccant insert)
Defect I 64 53 02 48 00

— 22/09/2017 Key 57887 Km 28565 Key 0

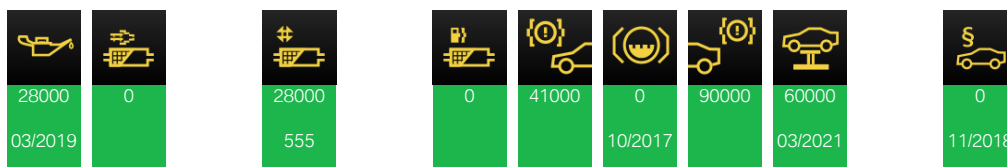

— 13/09/2017 Key 57501 Km 28565 Key 0

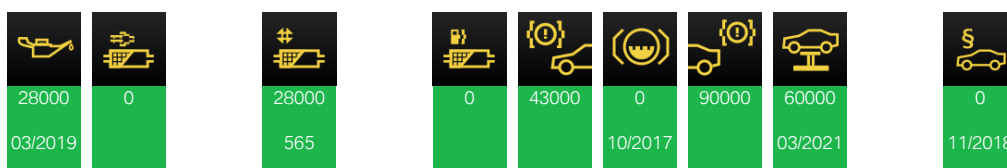

— 11/09/2015 Key 38023 Km 28565 Key 0

—	07/07/2015	Key	 23000 07/2017	 23000 688	 23000 688	 23000 688	 60000	 0 10/2017	 80000	 23000 07/2017	 0 11/2018
			30450 Km		28565		Key 0				
			 600 10/2016	 0	 600 481	 0	 60000	 0 10/2017	 70000	 32000 10/2018	 0 11/2018
—	07/07/2015	Service	30450 Km		28565 BAYERN AUTO SPORT, COUDEKERQUE BRANCHE		Automatic				
			 600 ✓	 0	 600 ✓	 60000	 10/2017	 70000	 32000	 11/2018	
			30450 Km		28565 BAYERN AUTO SPORT DUNKERQUE , COUDEKERQUE BRANCHE		Job: Service gamme standard Job: Service huile moteur Job: Service microfiltre				

— Job: Service gamme standard

Description:

Considered as a repeat visit No

Customer's own words

Service gamme standard
Package I 0000105

Service - standard scope
Flat rate unit I 00 00 105

2

— Job: Service huile moteur

Description:

Considered as a repeat visit No

Customer's own words

Service huile moteur
Package I 0000610

Engine oil service
Flat rate unit I 00 00 610

3

Set oil-filter element
Part I 11428575211

1

Motor oil SAE 0W-30 Longlife 01 FE
Part I 83210144467

5

— Job: Service microfiltre

Description:

Considered as a repeat visit No

Customer's own words

Service microfiltre
Package I 0000616

Microfilter service Flat rate unit I 00 00 616	3
Set, microfilter/carbon canister Part I 64119272642	1
Pollen-filter housing cleaner Part I 83192180509	1

20/04/2015		Key	19190 Km		28565		Key 0	
								
12000	0	12000	0	60000	0	70000	43000	0
10/2016		559			10/2017		10/2018	11/2018

29/12/2014	Repair	4321 Km	28565 BAYERN AUTO SPORT DUNKERQUE , COUDEKERQUE BRANCHE	Job
------------	--------	---------	---	-----

Job

Description: choc av

Considered as a repeat visit No

Customer's own words

!!! unknown BMW-Id 9999000 Temps de travail sans spécification/
Peinture !!!
Flat rate unit I 99 99 000

Job time without allowance for / body equipment
Flat rate unit I 51 99 000

Panel, bumper, primed, front
Part I 51 11 7 332 677

Grille, air inlet, middle
Part I 51 11 7 331 724

Grille, air inlet, open, left
Part I 51 11 7 331 727

Carrier, bumper, front bottom
Part I 51 11 7 203 078

Shock absorber front
Part I 51 11 7 331 748

Grille, front, right
Part I 51 13 7 336 478

Air duct
Part I 51 64 7 332 893