

Thank you for ordering from us!
www.checkvin.eu

Vehicle

BMW 420D A, 140KW

WBA4X31030AA80370



Development code

F32

Colour

black-sapphire metallic

Actual integration level

F020-22-11-510

Start of warranty

25 October 2017

Technical campaigns

There are no Campaigns for this vehicle.

Warranty extension/VIN-based goodwill

Status	Campaign number	Description
Open	1SACC011056	Exhaust gas recirculation cooler Bx7 Local campaign number: -

Special information

There are no Campaigns for this vehicle.

Restrictions on the warranty

There are no restrictions on the warranty.

⚠ Market-specific restrictions are not currently displayed. Please check this in WDF/WXE via S-Gate.

Live Diagnosis

 There are no service solutions for Live Diagnosis.

Service contracts

No BSI contracts

Information on faults workshop/Service Consultation

There is no information on faults.

Navigation map

Note: The installed map could not be detected.

Installed map	Enabling code (subscription)	Latest navigation map included in subscription	Latest navigation map subject to charge
-	Enabling code valid for navigation maps with release date up to 31 Dec 2099 (SWID: 01309912).	Road Map EUROPE Way 2025-2	-

Vehicle details

Vehicle type	Passenger car
Brand	BMW
Model	420D A
Body	COUPE
Vehicle identification number (last 7 digits)	AA80370
Vehicle identification number (17 digits)	WBA4X31030AA80370
Development code	F32
Steering	LL
Engine	B47O
Engine number	67409933
Exhaust re-treatment	EURO6, W, PI/CI, M, N1 I
Transmission	AUT
Transmission number	0863895ZYR
Head unit serial number	AL07FFH0211110
Drive	HECK
Integration level, works	F020-17-03-503
Production date	22 Mar 2017
Production plant	Muenchen
Delivery date	9 Nov 2017
Delivering retailer	BMW AG, München, DE
National-market version	EUR
Paint code	475
Upholstery code	HAAT
Model code	4X41
Basic type	4X31
Lead type	4X41

Optional equipment

Optional equipment ex works:

01CA Selection of COP-relevant vehicles
01CB CO2 equipment
0230 Extra package, EU-specific
0258 Tyres with runflat properties
02PE BMW LA wheel, M star spoke 400
02TB Sport automatic gearbox
02VB Tyre pressure display
0302 Alarm system
0337 M Sports package
0403 Glass roof, electrical
0420 Sun protection glazing
0423 Floor mats velours
0428 Warning triangle and first aid kit
0430 Interior/outside mirror with auto dip
0431 Interior mirror with automatic-dip
0459 Seat adjustment, electric, with memory
0465 Through-loading system
0481 Sports seat
0488 Lumbar support, driver and passenger
0493 Storage compartment package
0494 Seat heating driver/passenger
04AE Armrest front, retractable
04WF Alum. Hexagon accent blue matt
0502 Headlight cleaning system
0508 Park Distance Control (PDC)
0521 Rain sensor
0534 Automatic air conditioning
0544 Cruise control with braking function
0548 Kilometre speedo
0563 Light package
0575 Additional 12V power socket
05A1 LED Fog lights
05AC High-beam assistant
05DA Passenger airbag deactivation
0606 Navigation system Business
0610 Head-up display
0650 CD player
0676 HiFi speaker system
0698 Area-Code 2 for DVD
06AC Intelligent emergency call
06AE Teleservices
06AK Connected Drive Services
06AM Real-Time Traffic Information
06AN Concierge Services
06AP Remote Services
06NH Hands-free system with USB interface
06WA Instrument panel with extended scope
0704 M Sports suspension
0710 M Leather steering wheel
0715 M Aerodynamics package
0760 High gloss shadow line
0775 Headlining anthracite
07LF Modell M Sport
0801 German version
0851 Language version German
0879 On-board literature, German
08KA Oil service interval 24 mths / 30,000 km
08R9 Refrigerant R1234yf
08TH Road sign detection
09AA Outer skin protection
09BD Business Package
A090 90 Ah AGM battery
POLS Cloth cushion

Retrofitted optional equipment:

This vehicle has no retrofits.

Vehicle histories

Date


Type

Vehicle mileage

Retailer


Overview

— 14/05/2025 Key 211174 Km 51646 Key 0

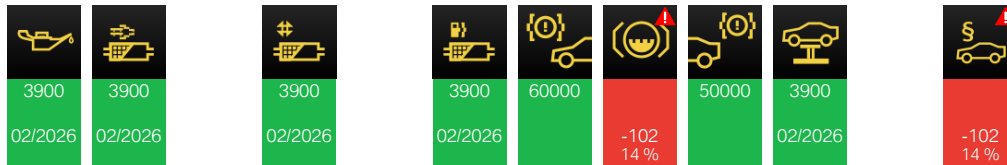


— 14/05/2025 Service 211174 Km 51646 Automatic

Autohaus
Kühnert
GmbH&Co. KG
, Plauen

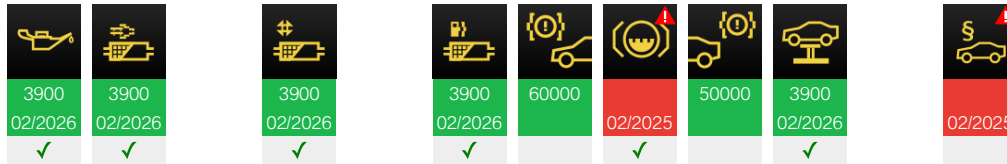

— 09/04/2025 Key 208948 Km 51646 Remote KeyRead

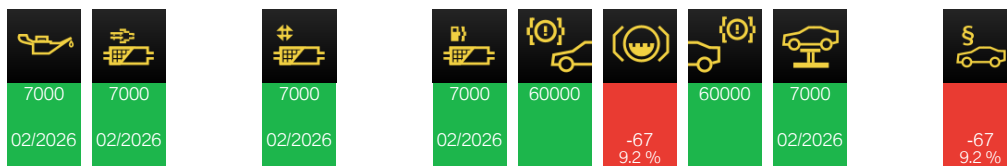

— 13/09/2024 Warranty 196204 Km 51646

Job: F1x F2x F3x G0x G1x G3x B47O B47K B47U B47T Replacing EGR cooler (high-temperature)
Job: E84 Fx Gx Bx7 Nx7 Customer notification exhaust gas recirculation cooler
Job: Fx Replace driver's airbag, part III (SDI)
Job

— Job: F1x F2x F3x G0x G1x G3x B47O B47K B47U B47T Replacing EGR cooler (high-temperature)

Description: F1x F2x F3x G0x G1x G3x B47O B47K B47U B47T Replacing EGR cooler (high-temperature)

Considered as a repeat visit No

Customer's own words

Additional work: run function test for pressure sensor system 3 FRU
Flat rate unit I 00 74 636

Additional work: enter component identification of new exhaust gas recirculation cooler in diagnostic system 1 FRU
Flat rate unit I 00 74 637

Replace exhaust gas recirculation cooler, including exhaust gas recirculation valve 23 FRU
Flat rate unit I 00 74 635

Additional work cleaning the exhaust gas recirculation pipe 6 FRU
Flat rate unit I 00 74 638

F1x F2x F3x G0x G1x G3x B47O B47K B47U B47T Replacing EGR cooler (high-temperature)
Defect I 00 11 13 07 00

Exhaust gas radiator high temperature 1
Part I 11 71 7 822 347

EGR small parts set 1
Part I 11 71 8 490 640

Pipe union 2

Part I 11 71 7 799 853

Holder	1
Part I 61 13 1 369 832	

Connection piece	1
Part I 11 65 7 803 012	

O-ring	1
Part I 11 61 8 512 681	

Acoustic cover front	1
Part I 11 14 8 490 577	

Pipe	1
Part I 13 71 7 823 517	

— Job: E84 Fx Gx Bx7 Nx7 Customer notification exhaust gas recirculation cooler

Description: E84 Fx Gx Bx7 Nx7 Customer notification exhaust gas recirculation cooler

Considered as a repeat visit No

Customer's own words

Administrative effort	1 FRU
Flat rate unit I 00 74 758	

E84 Fx Gx Bx7 Nx7 Customer notification exhaust gas recirculation cooler
Defect I 00 11 35 07 00

— Job: Fx Replace driver's airbag, part III (SDI)

Description: Fx Replace driver's airbag, part III (SDI)

Considered as a repeat visit No

Customer's own words

Replace driver's airbag	3 FRU
Flat rate unit I 00 76 920	

Fx Replace driver's airbag, part III (SDI)
Defect I 00 32 62 03 00

Airbag module, driver's side	1
Part I 32305A66F66	

— Job


Description:

Considered as a repeat visit No


Customer's own words

Defect I 85 40 00 26 SA

29/08/2024	Service	196193 Km	51646 Autohaus Kühnert, Plauen	Manual
------------	---------	-----------	---	--------

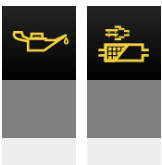

28/08/2024	Key	196193 Km	51646	Key 0
------------	-----	-----------	-------	-------

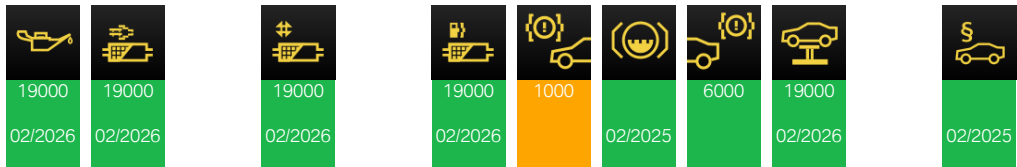

— 28/08/2024 Repair 196204 Km 51646 , Job
Job
Job
Job
Job

— Job

Description:

Considered as a repeat visit No

Customer's own words

Service - standard scope	2 FRU
Flat rate unit I 00 00 105	

— Job

Description:

Considered as a repeat visit No

Customer's own words

Service, front brakes	6 FRU
Flat rate unit I 00 00 612	

Brake cleaner acetone-free	1
Part I 83 19 2 413 695	

Brake pad wear sensor, front left	1
Part I 34 35 6 792 289	

Brake-pad paste	2
Part I 83 19 2 158 851	

Repair kit brake pads asbestos-free	1
Part I 34 11 8 855 010	

— Job

Description:

Considered as a repeat visit No

Customer's own words

Removing and installing or replacing both front brake discs	3 FRU
Flat rate unit I 34 11 613	

Inner hex bolt	2
Part I 34 21 1 161 806	

Brake disc, ventilated	2
Part I 34 11 8 848 417	

Torx screw with washer	4
Part I 34 10 6 864 424	

— Job

Description:

Considered as a repeat visit No

Customer's own words

Service, rear brakes	7 FRU
----------------------	-------

Flat rate unit | 00 00 614

Repair kit, brake pads Part I 34 21 8 855 013	1
Brake-pad sensor, rear Part I 34 35 6 792 292	1

— Job

Description:

Considered as a repeat visit No

Customer's own words

Verrechnung Gutschein TA-AG R 00000000	Local	-1 FRU
Flat rate unit 99 99 999		

— 20/08/2024 Key 195454 Km 51646 Remote KeyRead

 20000 02/2026	 20000 02/2026	 20000 02/2026	 20000 02/2026	 1500 02/2025	 6000 02/2025	 20000 02/2026	 20000 02/2025
---	---	---	---	--	--	---	---

— 24/05/2024 Key 189990 Km 51646 Remote KeyRead

 26000 02/2026	 26000 02/2026	 26000 02/2026	 26000 02/2026	 12000 02/2025	 6000 02/2025	 26000 02/2026	 26000 02/2025
---	---	---	---	---	--	---	---

— 28/02/2024 Key 184064 Km 51646 Key 0

 -1300 4.2 % 02/2025	 02/2025	 -1300 02/2025	 18000 02/2025	 6000 02/2025	 30000 02/2027	 02/2025	 02/2025
--	--	---	---	--	---	--	--

— 28/02/2024 Service 184064 Km 51646 Automatic
Autohaus
Kühnert
GmbH&Co. KG
, Plauen

 -1300 02/2025 ✓	 02/2025	 -1300 02/2025 ✓	 18000 02/2025	 6000 02/2025	 30000 02/2027	 02/2025	 02/2025
--	--	--	---	--	---	--	--

— 24/02/2023 Warranty 151771 Km 51646 Job: F1x F2x F3x B47O B47K B47U Programming control units (DDE)

— Job: F1x F2x F3x B47O B47K B47U Programming control units (DDE)

Description: F1x F2x F3x B47O B47K B47U Programming control units (DDE)

Considered as a repeat visit No

Customer's own words

Program control units Flat rate unit 00 71 907	8 FRU
---	-------

Additional work: check CCM Check Control message and coolant level	1 FRU
--	-------

F1x F2x F3x B47O B47K B47U Programming control units (DDE)
Defect I 00 13 50 03 00

— 20/02/2023 Repair 151767 Km 51646 Job
Autohaus Job
Kühnert GmbH Job
& Co. KG, Job
Plauen Job
Job
Job
Job

— Job

Description:

Considered as a repeat visit No

Customer's own words

Service - standard scope	2 FRU
Flat rate unit I 00 00 105	

battery	1
Part I 61 31 9 217 643	

— Job

Description:

Considered as a repeat visit No

Customer's own words

Vorbereitung für	Local	2 FRU
Flat rate unit I 99 00 002		

Abgasuntersuchung	Local	5 FRU
Flat rate unit I 00 00 401		

— Job

Description:

Considered as a repeat visit No

Customer's own words

Brake fluid service	4 FRU
Flat rate unit I 00 00 618	

Brake fluid DOT4 LV, low viscosity	1
Part I 83 13 2 184 843	

— Job

Description:

Considered as a repeat visit No

Customer's own words

Performing vehicle test	4 FRU
Flat rate unit I 00 00 006	

Removing and installing / replacing fanfare horn, left and right	7 FRU
Flat rate unit I 61 33 060	

Horn, low pitch	1
Part I 61 33 7 245 422	

Horn, high pitch
Part I 61 33 7 245 423

1

— Job

Description:

Considered as a repeat visit No

Customer's own words

Engine oil service
Flat rate unit I 00 00 610

3 FRU

Set oil-filter element
Part I 11 42 8 575 211

1

BMW Engine Oil LL04 0W30
Part I 83 21 2 405 950

5

— Job

Description:

Considered as a repeat visit No

Customer's own words

Microfilter service
Flat rate unit I 00 00 616

2 FRU

Microfilter/activated Carbon container
Part I 64 11 9 237 555

1

— Job

Description:

Considered as a repeat visit No

Customer's own words

Replacing both rear shock absorbers
Flat rate unit I 33 52 030

14 FRU

Auxiliary damper, rear
Part I 33 53 6 857 730

2

Hexalobular socket screw
Part I 07 11 9 907 137

6

Gasket
Part I 33 50 6 866 038

2

— Job

Description:

Considered as a repeat visit No

Customer's own words

Hauptuntersuchung TÜV
Flat rate unit I 99 99 999

Local

1 FRU

Prüf- Klebesiegel Set
Flat rate unit I 99 99 999


Local

1 FRU


— 13/02/2023 Key

151767 Km


Key 0

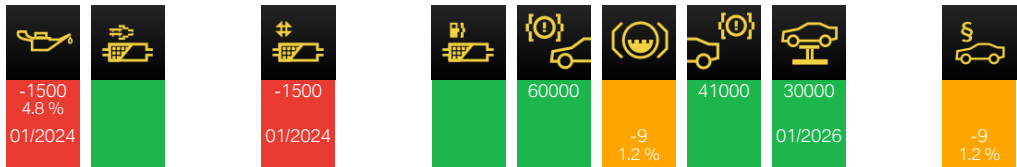

— 13/02/2023 Service 151767 Km 51646 Automatic
Autohaus
Kühnert
GmbH&Co. KG
, Plauen

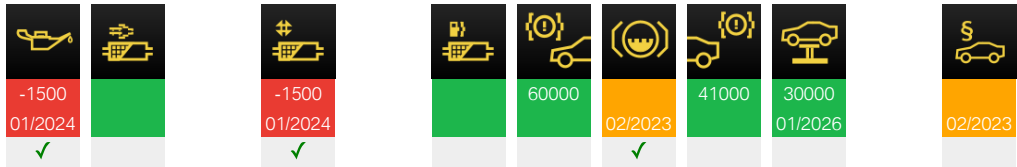

— 23/03/2022 Key 123738 Km 23429 Key 1

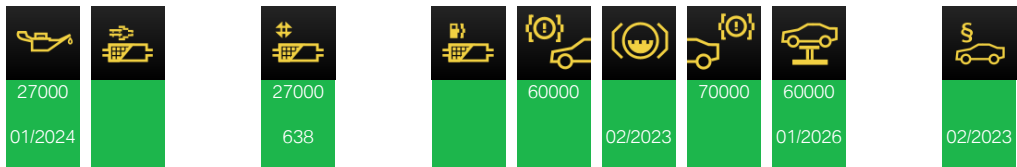

— 23/03/2022 Repair 123738 Km 23429 Job
Autohaus
Strauß GmbH,
Plauen Job

— Job

Description: Kühlmittelverlust
Considered as a repeat visit No
Customer's own words

Service consultation at vehicle with Service Ticket 0 FRU
Flat rate unit I 00 52 052

— Job

Description: Fahrzeugtest durchführen
Considered as a repeat visit No
Customer's own words

Vehicle surface wash 0 FRU
Flat rate unit I 00 11 319

— Job

Description: AGR-Kühler aus- und einbauen/ersetzen
Considered as a repeat visit No
Customer's own words

Check the cooling system for watertightness with the special tool 4 FRU
Flat rate unit I 17 00 009

Removing and installing or replacing EGR cooler 23 FRU
Flat rate unit I 11 71 600

Kühlerfrostschutz Local 4
Part I FT99 22 9 407 4

exhaust cooler 1
Part I 11 71 8 596 444

EGR-valve Part I 11 71 8 594 492	1
Gasket Steel Part I 11 61 8 571 005	1
Pipe union Part I 11 71 7 799 853	2
Torx bolt Part I 11 71 2 249 909	2
Gasket Steel Part I 11 71 8 579 364	1
Hose clamp Part I 07 12 9 952 104	2
Gasket Steel Part I 11 62 8 576 287	1
Gasket Steel Part I 11 71 8 593 580	1
Clamp Part I 11 71 8 578 144	1
O-ring Part I 07 11 9 907 868	1
Hex Bolt with washer Part I 07 14 9 390 155	1
Hexagon screw with flange Part I 51 71 6 966 566	1
Hex Bolt with washer Part I 31 10 6 870 648	14

— 23/03/2022 Warranty 123738 Km 23429 Job: EGR cooler (incl. bypass flap) / exhaust cooler

— Job: EGR cooler (incl. bypass flap) / exhaust cooler

Description: EGR cooler (incl. bypass flap) / exhaust cooler

Considered as a repeat visit No

Customer's own words

Check the cooling system for watertightness with the special tool Flat rate unit I 17 00 009	4 FRU
Removing and installing or replacing EGR cooler Flat rate unit I 11 71 600	23 FRU
EGR cooler (incl. bypass flap) / exhaust cooler Defect I 11 71 06 48 00	
exhaust cooler Part I 11 71 8 596 444	1
EGR-valve Part I 11 71 8 594 492	1
Gasket Steel Part I 11 61 8 571 005	1
Pipe union Part I 11 71 7 799 853	2
Torx bolt Part I 11 71 2 249 909	2

Gasket Steel Part I 11 71 8 579 364	1
Hose clamp Part I 07 12 9 952 104	2
Gasket Steel Part I 11 62 8 576 287	1
Gasket Steel Part I 11 71 8 593 580	1
Clamp Part I 11 71 8 578 144	1
O-ring Part I 07 11 9 907 868	1
Hex Bolt with washer Part I 07 14 9 390 155	1
Hex Bolt with washer Part I 31 10 6 870 648	14
Countersunk head screw with washer Part I 51 71 6 966 566	1

—

15/03/2022

Repair

94301 Km

28214
Autohaus
Strauß GmbH ,
Auerbach

—

31/01/2022

Repair

119245 Km

23429
Autohaus
Strauß GmbH ,
Plauen

—

26/01/2022

Key

119235 Km

23429

Key 1



—


26/01/2022

Service

119235 Km

23429
Autohaus
Strauß GmbH ,
Plauen

Automatic

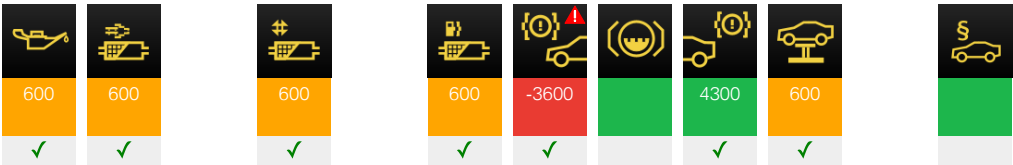

—

26/01/2022

Repair

119245 Km

23429
Autohaus
Strauß GmbH ,
Plauen

Job
Job
Job
Job
Job
Job

—

Job

Description: Standardumfang

Considered as a repeat visit No

Customer's own words

Service - standard scope Flat rate unit I 00 00 105	2 FRU
--	-------

Scheibenklar mit Frostschutz Part I FT99 22 9 407 7	Local	2
--	-------	---

Kühlerfrostschutz Part I FT99 22 9 407 4	Local	0.4
---	-------	-----

— Job

Description: Motoröl**Considered as a repeat visit** No**Customer's own words**

Engine oil service Flat rate unit I 00 00 610	3 FRU
--	-------

!!! unknown BMW-Id FTSEW550001 SEW-Gutschein Leasing GmbH !!! Local Part I FTSEW550001	1
---	---

BMW Engine Oil LL04 0W30 Part I 83 21 2 405 950	5
--	---

Set oil-filter element Part I 11 42 8 575 211	1
--	---

— Job

Description: Kraftstofffilter**Considered as a repeat visit** No**Customer's own words**

Service fuel filter Flat rate unit I 00 00 604	3 FRU
---	-------

Fuel filter cartridge Part I 13 32 7 822 497	1
---	---

— Job

Description: Luftfiltereinsatz**Considered as a repeat visit** No**Customer's own words**

Service - air filter element Flat rate unit I 00 00 602	2 FRU
--	-------

Air filter element Part I 13 71 8 511 668	1
--	---

— Job

Description: Mikrofilter (ggf. weiter Zusatzarbeit(en) beachten)**Considered as a repeat visit** No**Customer's own words**

Microfilter service Flat rate unit I 00 00 616	2 FRU
---	-------

Microfilter/activated Carbon container Part I 64 11 9 237 555	1
--	---

— Job

Description: Fahrzeug-Check

Considered as a repeat visit No

Customer's own words

Service, vehicle check 6 FRU
Flat rate unit I 00 00 624

Job

Description: Bremsscheiben vorn und hinten ersetzen

Considered as a repeat visit No

Customer's own words

Replacing front and rear brake discs 20 FRU
Flat rate unit I 34 11 230

Repair kit, brake pads asbestos-free 1
Part I 34 10 6 859 181

Brake-pad paste 2
Part I 83 19 2 158 851

Brake cleaner acetone-free 1
Part I 83 19 2 413 695

Brake pad wear sensor, front left 1
Part I 34 35 6 792 289

Brake-pad sensor, rear 1
Part I 34 35 6 792 292

Brake-pad paste 2
Part I 83 19 2 158 851

Brake cleaner acetone-free 1
Part I 83 19 2 413 695


Repair kit, brake pads asbestos-free 1
Part I 34 21 6 873 093

Brake disc, ventilated 2
Part I 34 11 8 848 417


Brake disc, ventilated 2
Part I 34 21 6 864 900

Inner hex bolt 4
Part I 34 21 1 161 806


05/01/2022 Key 117750 Km Remote KeyRead

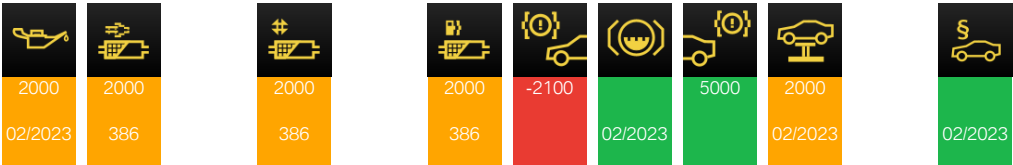

19/02/2021 Key 88788 Km Key 1

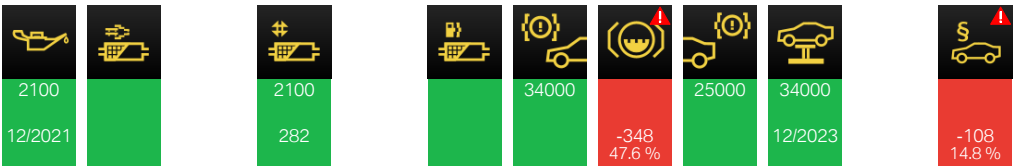

19/02/2021 Service 88788 Km 23429 Automatic
Autohaus
Strauß GmbH,
Plauen

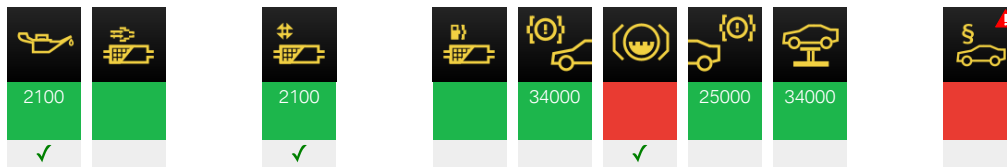

— 19/02/2021 Repair 88791 Km 23429 Job
 Autohaus
 Strauß GmbH,
 Plauen Job
 Job
 Job
 Job

— Job

Description: Standardumfang

Considered as a repeat visit No

Customer's own words

Performing vehicle test 0 FRU
 Flat rate unit I 00 00 006

— Job

Description: Motoröl

Considered as a repeat visit No

Customer's own words

Service - standard scope 2 FRU
 Flat rate unit I 00 00 105

Engine oil service 3 FRU
 Flat rate unit I 00 00 610

Dichtring Local 2
 Part I FT99 22 9 407 7

BMW Engine Oil LL04 0W30 5
 Part I 83 21 2 405 950

Set oil-filter element 1
 Part I 11 42 8 575 211

— Job

Description: Mikrofilter (ggf. weiter Zusatzarbeit(en) beachten)

Considered as a repeat visit No

Customer's own words

Microfilter service 2 FRU
 Flat rate unit I 00 00 616

Microfilter/activated Carbon container 1
 Part I 64 11 9 237 555

— Job

Description: Bremsflüssigkeit

Considered as a repeat visit No

Customer's own words

Brake fluid service 4 FRU
 Flat rate unit I 00 00 618

!!! unknown BMW-Id 99229407513 Bremsflüssigkeit !!! Local 1

— Job

Description: HU/AU Kunde / Haupt- und Abgasuntersuchung 2-jährig/Dekra**Considered as a repeat visit** No**Customer's own words**

Abgasuntersuchung 2-jährig DEKRA Flat rate unit I AU2 EXT	Local	4 FRU
Bereitstellen zur Hauptuntersuchung Flat rate unit I -	Local	1 FRU
Pre-check for roadworthiness test Flat rate unit I 00 12 600		3 FRU

— Job

Description: Frontscheibe ersetzen**Considered as a repeat visit** No**Customer's own words**

Replacing windshield Flat rate unit I 51 31 011		24 FRU
Additional job with rain/light sensor Flat rate unit I 61 35 994		3 FRU
Performing vehicle test Flat rate unit I 00 00 556		2 FRU
Calibrate KAFAS camera Flat rate unit I 66 51 526		1 FRU
Green windscreen Part I 51 31 7 285 901		1
Repair kit, window glass, cold, 1 hour Part I 83 19 2 289 285		1
Cover, windshield, top Part I 51 31 7 285 915		1
Clamp Part I 51 43 7 321 215		2
Bump stop Part I 51 31 7 288 462		11
Sound insulation f apron Part I 51 48 7 325 890		1
Drip moulding, left Part I 51 31 7 285 927		1
Drip moulding, right Part I 51 31 7 285 928		1
Replacement plate driving light sensor Part I 61 35 9 856 157		1

— Job

Description: 10011880500 (SK)- F1x F2x F3x G0x G1x G3x B47O B47**Considered as a repeat visit** No**Customer's own words**

Visual insp. of EGR cooler outlet and inlet (OK), check CC message about coolant level (OK) and note the prod. date of the installed exhaust		12 FRU
--	--	--------

gas recirc. cooler
Flat rate unit I 00 70 505

Gasket Steel
Part I 11 71 8 579 364

1

Oval head screw
Part I 35 21 7 685 343

2

19/02/2021 Warranty

88791 Km 23429

Job: F1x F2x F3x G0x G1x G3x
B47O B47T B47U B47K Check
and, if required, replace EGR cooler

Job: F1x F2x F3x G0x G1x G3x B47O B47T B47U B47K Check and, if required, replace EGR cooler

Description: F1x F2x F3x G0x G1x G3x B47O B47T B47U B47K Check and, if required, replace EGR cooler

Considered as a repeat visit No

Customer's own words

Visual insp. of EGR cooler outlet and inlet (OK), check CC message
about coolant level (OK) and note the prod. date of the installed exhaust
gas recirc. cooler
Flat rate unit I 00 70 505

12 FRU

F1x F2x F3x G0x G1x G3x B47O B47T B47U B47K Check and, if
required, replace EGR cooler
Defect I 00 11 88 05 00

Gasket Steel
Part I 11 71 8 579 364

1





Oval head screw
Part I 35 21 7 685 343

2

04/02/2021 Key

87671 Km






Remote KeyRead

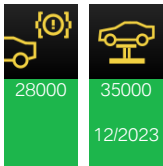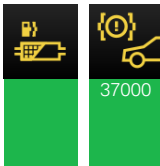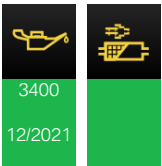

28/12/2019 Key

63974 Km 23429

Key 1

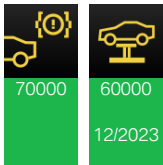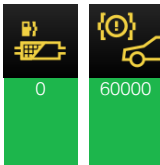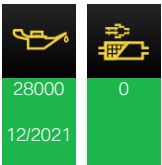

28/12/2019 Repair

63974 Km

23429
Autohaus
Strauß GmbH,
Plauen

Job
Job

Job

Description: 1000

Considered as a repeat visit No

Customer's own words

Service consultation at vehicle with Service Ticket
Flat rate unit I 00 52 052

0 FRU

Job

Description: Gutachter beauftragen / Unfallschaden lt. Gutachten beheben

Considered as a repeat visit No

Customer's own words

!!! unknown BMW-Id 0011234 Fahrzeug Verbringung !!! Flat rate unit 00 11 234	Local	12 FRU
Carry out Kinematics Diagnosis System wheel alignment with vehicle load up to design position Flat rate unit 32 00 590		16 FRU
Work before/after painting front left or right side panel Flat rate unit 51 18 619		6 FRU
Stripping and rebuilding operations for painting tail panel Flat rate unit 51 18 618		5 FRU
Removing and installing front bumper panel Flat rate unit 51 11 656		9 FRU
Removing and installing right LED headlight Flat rate unit 63 12 643		5 FRU
Removing and installing left or right front door Flat rate unit 41 51 580		3 FRU
Adjusting front left or right door Flat rate unit 41 51 504		2 FRU
Replace front left or right door Flat rate unit 41 51 501		30 FRU
Replacing right rear side panel Flat rate unit 41 35 111		169 FRU
Removing and installing/replacing support for rear bumper panel Flat rate unit 51 12 552		3 FRU
Replacing a tyre with run-flat technology Flat rate unit 36 12 506		6 FRU
Initialising tyre failure indicator Flat rate unit 36 11 500		1 FRU
Performing vehicle test Flat rate unit 00 00 556		2 FRU
Continuing vehicle test and deleting fault memory Flat rate unit 61 00 980		2 FRU
Replacing rear left frame side member Flat rate unit 41 11 731		12 FRU
Replacing tires for all wheels Flat rate unit 36 12 581		1 FRU
Job time without allowance for / cavity sealing - undercoating Flat rate unit 97 99 000		3 FRU
Cavity preservation for left or right front door Flat rate unit 97 51 501		2 FRU
Cavity preservation for side panel, rear left or right Flat rate unit 97 35 602		2 FRU
KLEINERSATZTEILE Part KLEINERSATZ	Local	1
SCHWEMM-MATERIAL Part SCHWEMM-MAT	Local	1
Hohlraumwachs Part VSM550005	Local	2
Repair kit, window glass, cold, 1 hour		2

Part I 83 19 2 289 285

Blind rivet N3 Part I 83 19 0 301 421	15
--	----

Punch rivet Part I 83 19 2 158 079	10
---------------------------------------	----

Screw Part I 83 19 0 301 639	3
---------------------------------	---

Door, front, right Part I 41 00 7 327 346	1
--	---

Right rear side panel Part I 41 00 7 344 968	1
---	---

Body adhesive K5 Part I 83 19 2 157 298	1
--	---

Punch rivet N4 Part I 83 19 2 457 307	50
--	----

Clip Natur Part I 51 41 1 973 500	25
--------------------------------------	----

Reinforcement plate, sill, right Part I 41 21 7 374 406	1
--	---

Reinforcement plate, B-pillar, right Part I 41 21 7 374 412	1
--	---

Body adhesive K5 Part I 83 19 2 158 654	1
--	---

Type plate Part I 71 21 7 263 981	1
--------------------------------------	---

Body adhesive K1 Part I 83 19 0 413 015	1
--	---

Punch rivet N4 Part I 83 19 2 457 307	12
--	----

Reinforcement plate, C-pillar, right Part I 41 21 7 374 414	1
--	---

Seam seal Part I 83 42 2 409 985	1
-------------------------------------	---

Repair kit, screw-type valve RDCi Part I 36 10 6 876 673	1
---	---

Cover pot Part I 51 17 7 270 761	1
-------------------------------------	---

Hook and loop fastener Part I 51 37 7 147 127	10
--	----

Mocket, door, right Part I 51 76 7 369 304	1
---	---

Sound insulation, door, bottom right Part I 51 41 7 391 726	1
--	---

Sound insulation, door, top right Part I 51 41 7 389 336	1
---	---

Sound insulation, door right Part I 51 48 7 345 326	1
--	---

Seal, outer right mirror triangle Part I 51 33 7 284 422	1
---	---

Joint seal, door, right	1
-------------------------	---

Part I 51 33 7 279 738

Torx-countersunk screw
Part I 07 14 7 266 068

2

Emblem
Part I 51 14 8 058 881

1

Drill bit, high-strength
Part I 83 19 2 359 263

1

Accessory-tool set
Part I 81 43 2 155 742

1

Moulded part f column B, exterior right
Part I 41 21 7 272 300

1

Instruction notice, Passenger's airbag
Part I 07 14 9 384 060

1

Air duct, side panel, primed, fr. right
Part I 51 74 7 494 356


1

— 06/12/2019 Key

60319 Km

23429

Key 1

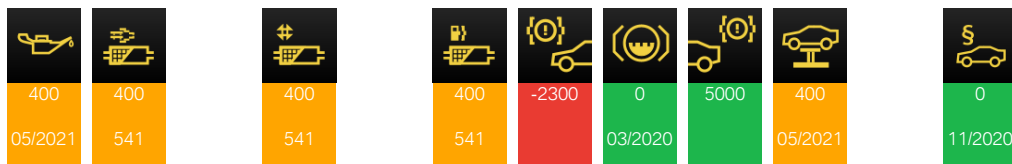


— 06/12/2019 Service

60050 Km

23429

Manual

Autohaus
Strauß GmbH,
Plauen

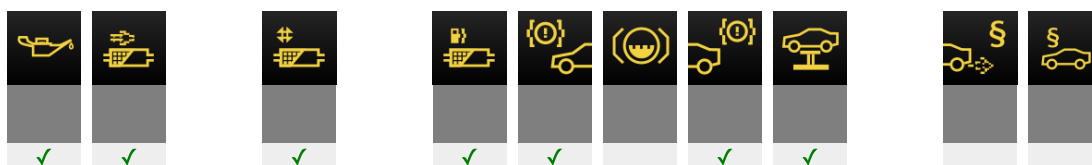

— 06/12/2019 Repair

60050 Km

23429

Job

Autohaus
Strauß GmbH,
Plauen

Job
Job
Job
Job

— Job

Description:

Considered as a repeat visit No

Customer's own words

alle Flüssigkeitsstände prüfen und ergänzen JA: NEIN:X
Flat rate unit I AW00 00 2

Local

0 FRU

Service consultation at vehicle with Service Ticket
Flat rate unit I 00 52 052

0 FRU

— Job

Description:

Considered as a repeat visit No

Customer's own words

Service - standard scope
Flat rate unit I 00 00 105

2 FRU

Engine oil service

3 FRU

Flat rate unit I 00 00 610

Service - air filter element 2 FRU
Flat rate unit I 00 00 602

Service fuel filter 3 FRU
Flat rate unit I 00 00 604

Microfilter service 2 FRU
Flat rate unit I 00 00 616

Service, vehicle check 6 FRU
Flat rate unit I 00 00 624

Set oil-filter element 1
Part I 11 42 8 575 211

Hose clamp 1
Part I 07 12 9 952 104

Fuel filter cartridge 1
Part I 13 32 8 572 522

Air filter element 1
Part I 13 71 8 511 668

Microfilter/activated Carbon container 1
Part I 64 11 9 237 555

BMW Engine Oil LL04 0W30 5
Part I 83 21 2 405 950

— Job

Description:

Considered as a repeat visit No

Customer's own words

Removing and installing or replacing both front brake discs 10 FRU
Flat rate unit I 34 11 220

Brake disc, ventilated 2
Part I 34 11 6 792 219

Inner hex bolt 2
Part I 34 21 1 161 806

Repair kit, brake pads asbestos-free 1
Part I 34 10 6 859 181

Brake pad wear sensor, front left 1
Part I 34 35 6 792 289

— Job

Description:

Considered as a repeat visit No

Customer's own words

Removing and installing or replacing brake pads of both rear disc brakes 8 FRU
Flat rate unit I 34 21 200

Repair kit, brake pads asbestos-free 1
Part I 34 21 6 873 093

Brake-pad sensor, rear 1
Part I 34 35 6 792 292

— Job

Description:

Considered as a repeat visit No

Customer's own words

alle Flüssigkeitsstände prüfen und ergänzen JA: NEIN:x Flat rate unit I AW00 00 2	Local	0 FRU
--	-------	-------

Service consultation at vehicle with Service Ticket Flat rate unit I 00 52 052		0 FRU
---	--	-------

— Job

Description: vier Felgen angefahren

Considered as a repeat visit No

Customer's own words


Job time without allowance for / wheels Flat rate unit I 36 99 000		6 FRU
---	--	-------

— 11/05/2019 Key

30014 Km

28214

Key 1

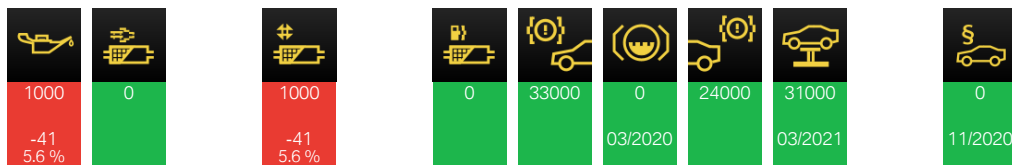


— 11/05/2019 Service

30014 Km

28214

Automatic

Autohaus
Strauß GmbH,
Auerbach

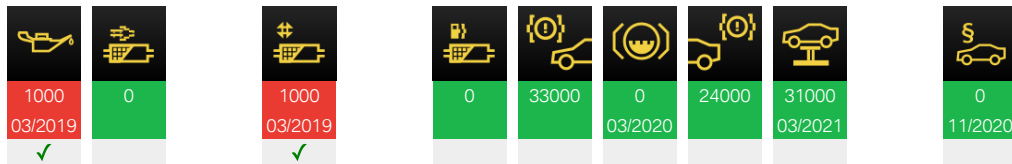

— 11/05/2019 Repair

30014 Km

28214

Job

Autohaus
Strauß GmbH,
Auerbach

Job
Job
Job
Job

— Job

Description:

Considered as a repeat visit No

Customer's own words

— Job

Description:

Considered as a repeat visit No

Customer's own words

— Job

Description:

Considered as a repeat visit No

Customer's own words

— Job

Description:

Considered as a repeat visit No

Customer's own words

Package I RAEDER_10000	Local	
Räder wechseln Flat rate unit I 36 00 001	Local	6
alle Flüssigkeitsstände prüfen und ergänzen Flat rate unit I -	Local	0
Initialising tyre failure indicator Flat rate unit I 36 11 500		1
Rädereinlagerung Part I FTR550001MB	Local	1

— Job

Description:

Considered as a repeat visit No

Customer's own words

!!! unknown BMW-Id ESTIMATE 0175/6645668 !!! Flat rate unit I -	Local	0 FRU
--	-------	-------

— 11/05/2019 Repair 30014 Km 28214 Autohaus Strauß GmbH, Auerbach Job Job Job

— Job

Description: Erreichbar unter

Considered as a repeat visit No

Customer's own words

0175/6645668 Flat rate unit I ESTIMAT	Local	0 FRU
--	-------	-------

— Job

Description: Service Mikrofilter

Considered as a repeat visit No

Customer's own words

Engine oil service Flat rate unit I 00 00 610		3 FRU
Service - standard scope Flat rate unit I 00 00 105		2 FRU
Microfilter service Flat rate unit I 00 00 616		2 FRU
BMW Engine Oil LL04 0W30 Part I 83 21 2 405 950		5
Set oil-filter element Part I 11 42 8 575 211		1

— Job

Description: Räderservice / Räderwechsel + Einlagern

Considered as a repeat visit No

Customer's own words

alle Flüssigkeitsstände prüfen und ergänzen JA: NEIN: Flat rate unit I AW00 00 2	Local	0 FRU
!!! unknown BMW-Id 3600001 Räder wechseln !!! Flat rate unit I 36 00 001	Local	6 FRU
Initialising tyre failure indicator Flat rate unit I 36 11 500		1 FRU
!!! unknown BMW-Id FTR550001MB Rädereinlagerung !!! Part I FTR550001MB	Local	1

- 28/02/2019 Repair 19355 Km 23429
Autohaus
Strauß GmbH ,
Plauen
- 19/02/2019 Repair 19333 Km 28214 Job
Autohaus
Strauß GmbH ,
Auerbach

— Job


Description:

Considered as a repeat visit No

Customer's own words

BMW trolley Part I 80 22 2 454 682	1
BMW boardcase Part I 80 22 2 454 681	1

- 15/02/2019 Key 19278 Km Key 1

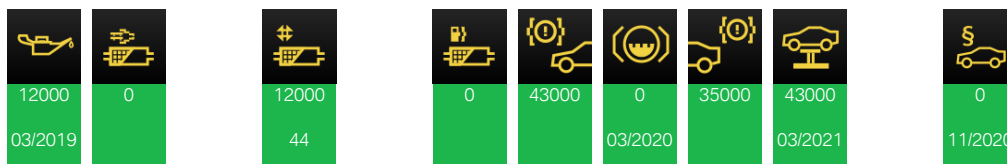

- 11/02/2019 Repair 19275 Km 23429 Job
Autohaus
Strauß GmbH ,
Plauen

— Job

Description: Ablieferungsdurchsicht

Considered as a repeat visit No

Customer's own words

!!! unknown BMW-Id 0000020 Übergabedurchsicht durch WE Stoßfänger vorn teilweise abbauen !!! Flat rate unit I 00 00 020	Local	20 FRU
---	-------	--------

FEINSTAUBPLAKETTE Part I FTF5500005	Local	1
Scheibenklar mit Frostschutz Part I FT99 22 9 407 7	Local	3
battery Part I 61 31 9 217 643		1

08/02/2019

Key

19278 Km

23429

Key 1



12000

03/2019



0



12000

51



0



43000



0

03/2020



35000



43000

03/2021



0

11/2020