

Thank you for ordering from us!
www.checkvin.eu

Vehicle

BMW X3 XDRIV A, 140KW

WBAWZ510800M16578



Development code
Colour
Actual integration level
Start of warranty

F25
alpinweiss 3
F025-22-11-510
4 January 2016

Technical campaigns

There are no Campaigns for this vehicle.

Warranty extension/VIN-based goodwill

Status	Campaign number	Description
Open	1SACC011056	Exhaust gas recirculation cooler Bx7 Local campaign number: -

Special information

There are no Campaigns for this vehicle.

Restrictions on the warranty

There are no restrictions on the warranty.

⚠ Market-specific restrictions are not currently displayed. Please check this in WDF/WXE via S-Gate.

Live Diagnosis

 There are no service solutions for Live Diagnosis.

Service contracts

No BSI contracts

Information on faults workshop/Service Consultation

There is no information on faults.

Navigation map

Note: Vehicle contains no navigation device.

Vehicle details

Vehicle type	Passenger car
Brand	BMW
Model	X3 XDRIV A
Body	GEFZG
Vehicle identification number (last 7 digits)	0M16578
Vehicle identification number (17 digits)	WBAWZ510800M16578
Development code	F25
Steering	LL
Engine	B47O
Engine number	70709355
Exhaust re-treatment	EURO6, W, PI/CI, M, N1 I
Transmission	AUT
Transmission number	1447652ZCB
Head unit serial number	No head unit could be found.
Drive	ALLR
Integration level, works	F025-15-07-503
Production date	21 Sept 2015
Production plant	SPARTANBURG
Delivery date	16 Oct 2015
Delivering retailer	Fritz Unterberger- Wolfgang Denzel, Innsbruck, AT
National-market version	EUR
Paint code	300
Upholstery code	FHAT
Model code	WZ61
Basic type	WZ51
Lead type	WZ61

Optional equipment

Optional equipment ex works:

01CA Selection of COP-relevant vehicles
01CC Auto start/stop function
01CD Brake Energy Regeneration



















Retrofitted optional equipment:

This vehicle has no retrofits.

0216 Hydro steering-servotronic
 0230 Extra package, EU-speciifc
 0249 Multifunction f steering wheel
 0258 Tyres with runflat properties
 02K8 BMW LA wheel, V spoke 307
 02TE Automatic transmission w/ shift paddles
 02VB Tyre pressure display
 02VG Performance Control
 02VL Variable sport steering
 0316 automatic trunk lid mechanism
 03AT Roof rails aluminium satinated
 0413 Luggage compartment net
 0420 Sun protection glazing
 0423 Floor mats velours
 0428 Warning triangle and first aid kit
 0465 Through-loading system
 0481 Sports seat
 0493 Storage compartment package
 0494 Seat heating driver/passenger
 04CG Interior trim strips "satin-silber" matt
 04NG Trims, dashboard, mirror-finish
 04U2 Driving Experience Control incl. ECO PRO
 0502 Headlight cleaning system
 0508 Park Distance Control (PDC)
 0521 Rain sensor
 0522 Xenon Light
 0534 Automatic air conditioning
 0544 Cruise control with braking function
 0548 Kilometre speedo
 0563 Light package
 05A1 LED Fog lights
 05DA Passenger airbag deactivation
 0663 Radio BMW Professional
 0698 Area-Code 2 for DVD
 06AC Intelligent emergency call
 06AE Teleservices
 06NH Hands-free system with USB interface
 0710 M leather steering wheel
 0851 Language version German
 0879 On-board literature, German
 08KA Oil service interval 24 mths / 30,000 km
 0925 Dummy-SALAPA
 09AA Outer skin protection
 A090 90 Ah AGM battery
 POLS Cloth cushion

Vehicle histories

	Date	Type	Vehicle mileage	Retailer	Overview
—	15/07/2024	Key	210151 Km	10621	Key 0
	 29000 06/2026  29000 06/2026  29000 06/2026  29000 06/2026  42000  09/2024  3400  29000 06/2026 <td></td>				
—	11/07/2024	Key	209888 Km	52892	Key 0
	 29000 06/2026  29000 06/2026  29000 06/2026  29000 06/2026  42000  09/2024  15000  29000 06/2026 <td></td>				
—	09/07/2024	Key	209880 Km	52892	Key 0

	 29000 06/2026	 29000 06/2026	 29000 06/2026	 29000 06/2026	 42000 09/2024	 15000 06/2026	 29000 06/2026	
—	13/06/2024	Key		207408 Km	10621	Key 0		
	 240 05/2025	 240 05/2025	 240 05/2025	 39000 09/2024	 15000 05/2027	 32000 05/2027		
—	13/06/2024	Service		207408 Km	10621 Zorn-Wolf GmbH, Imst	Manual		
	 ✓	 ✓	 ✓	 ✓	 ✓	 ✓	 ✓	 ✓
—	10/04/2024	Key		203866 Km	10621	Key 0		
	 4400 05/2025	 4400 05/2025	 4400 05/2025	 44000 09/2024	 19000 05/2027	 36000 05/2027		
—	21/03/2024	Key		202559 Km	10621	Key 0		
	 6000 05/2025	 6000 05/2025	 6000 05/2025	 45000 09/2024	 20000 05/2027	 37000 05/2027		
—	30/11/2023	Key		194474 Km	10621	Key 0		
	 15000 05/2025	 15000 05/2025	 15000 05/2025	 60000 09/2024	 27000 05/2027	 46000 05/2027		
—	30/11/2023	Warranty		194474 Km	10621	Job: F2x B47O Replace exhaust gas recirculation cooler (minimum temperature)		

— Job: F2x B47O Replace exhaust gas recirculation cooler (minimum temperature)

Description: F2x B47O Replace exhaust gas recirculation cooler (minimum temperature)

Considered as a repeat visit No

Customer's own words

Replace exhaust gas recirculation cooler, including exhaust gas recirculation valve Flat rate unit I 00 74 064	22 FRU
---	--------

Additional work: run function test for pressure sensor system Flat rate unit I 00 74 656	3 FRU
---	-------

Additional work: enter component identification of new exhaust gas recirculation cooler in diagnostic system Flat rate unit I 00 74 657	1 FRU
Additional work cleaning the exhaust gas recirculation pipe Flat rate unit I 00 74 658	2 FRU
F2x B47O Replace exhaust gas recirculation cooler (minimum temperature) Defect I 00 11 16 07 00	
Exhaust gas cooler low temperature Part I 11 71 7 822 348	1
Acoustic cover front Part I 11 14 8 490 575	1
Line, EGR cooler-changeover valve part 2 Part I 11 53 7 827 840	1
EGR small parts set Part I 11 71 8 490 640	1
Vacuum hose black Part I 11 65 8 595 650	1
Pipe union Part I 11 71 7 799 853	1
Holder Part I 61 13 1 369 832	1
Connection piece Part I 11 65 7 803 012	1
O-ring Part I 11 61 8 512 681	1

—

23/05/2023

Warranty

179318 Km

10621

Job: Fx Gx B37 B47 B57 N47 N57
Check coolant level (EGR)

—

Job: Fx Gx B37 B47 B57 N47 N57 Check coolant level (EGR)

Description:

Fx Gx B37 B47 B57 N47 N57 Check coolant level (EGR)

Considered as a repeat visit

No

Customer's own words

Flat rate unit I 00 73 827

4 FRU

Fx Gx B37 B47 B57 N47 N57 Check coolant level (EGR)

Defect I 11 71 90 08 00

—

22/05/2023

Key

179318 Km

Key 0

480

04/2024

480

04/2024

480

04/2024

480

04/2024

-210

0.4 %

09/2024

44000

480

04/2024

—

22/05/2023

Service

179318 Km

10621 Zorn-Wolf GmbH, Imst

Manual

✓

✓


✓

✓

✓

✓

— 02/03/2023 Key 173661 Km Key 0

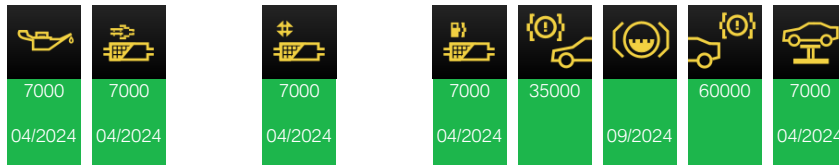

— 02/03/2023 Warranty 173678 Km 10621 Job: G0x G3x B47O Programming control units (DDE)

— Job: G0x G3x B47O Programming control units (DDE)

Description: G0x G3x B47O Programming control units (DDE)

Considered as a repeat visit No


Customer's own words

Program control units 8 FRU
Flat rate unit I 00 71 940


Additional work: check CCM Check Control message and coolant level 1 FRU
Flat rate unit I 00 73 677

G0x G3x B47O Programming control units (DDE)
Defect I 00 13 51 03 00

— 15/12/2022 Key 168435 Km Key 0

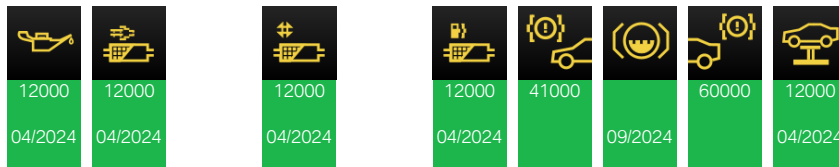


— 27/09/2022 Key 161855 Km 10621 Key 0

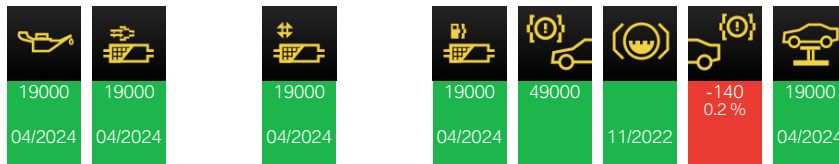

— 27/09/2022 Service 161855 Km 10621 Zorn-Wolf GmbH, Imst Manual



— 25/04/2022 Key 149802 Km 10621 Key 0

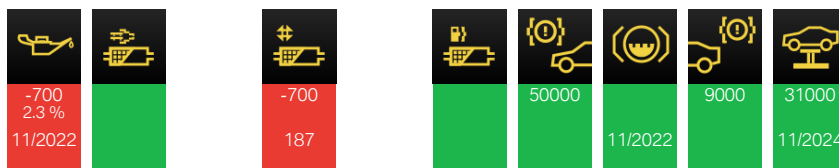

— 25/04/2022 Service 149802 Km 10621 Zorn-Wolf GmbH, Imst Manual



— 01/04/2022 Key 148453 Km 10621 Remote KeyRead



— 26/01/2022 Key 144991 Km 10621 Key 0




— 20/01/2022 Key 144694 Km Key 0




— 20/01/2022 Service 144694 Km 10621 Zorn-Wolf GmbH, Imst Manual



— 23/07/2021 Key 132991 Km Key 0

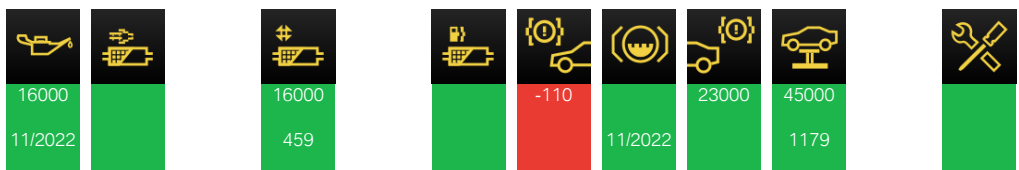

— 23/07/2021 Service 132991 Km 10621 Zorn-Wolf GmbH, Imst Manual

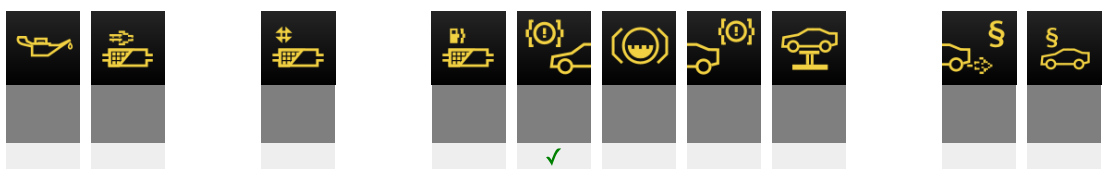

— 23/07/2021 Repair 132991 Km 10621 Zorn-Wolf GmbH, Imst Job Job Job Job Job

— Job

Description:

Considered as a repeat visit No

Customer's own words Bremsen kontrollieren und ggf. ers. lt. CBS Anzeige vorne fertig

Removing and installing or replacing both front brake discs Flat rate unit I 34 11 220	12 FRU
---	--------

Brake disc, ventilated Part I 34 10 6 879 122	2
--	---

Repair kit, brake pads asbestos-free Part I 34 10 6 859 182	1
--	---

Inner hex bolt Part I 34 21 1 161 806	2
--	---

Brake pad wear sensor, front left Part I 34 35 6 790 303	1
---	---

Clip, brake-pad sensor Part I 34 35 6 779 356	1
--	---

— Job

Description:

Considered as a repeat visit No

Customer's own words

Vehicle surface wash and interior vehicle cleaning Flat rate unit I 00 11 329	0 FRU
--	-------

— Job

Description:

Considered as a repeat visit No

Customer's own words

Removing and installing or replacing left or right rear coil spring Flat rate unit I 33 53 565	10 FRU
---	--------

Coil spring, rear Part I 33 53 6 787 202	1
---	---

Spring pad lower Part I 33 53 6 856 172	1
--	---

Spring pad upper Part I 31 33 6 798 834	1
--	---

Hexagon nut with collar Part I 33 32 6 794 873	1
---	---

Hexagon screw with flange Part I 07 11 9 906 495	1
---	---

Auxiliary damper, rear Part I 33 53 6 856 829	1
--	---

— Job

Description:

Considered as a repeat visit No

Customer's own words

!!! unknown BMW-Id MECH30 Ankaufstest !!! Flat rate unit I -	Local	12 FRU
---	-------	--------

— Job

Description:

Considered as a repeat visit No

Customer's own words

!!! unknown BMW-Id ENT Recycling Abgabe !!!
Part I ENT

Local

1

!!! unknown BMW-Id KM Klein- und Verbrauchsmaterial !!!
Part I KM






Local

1

— 10/05/2021 Key

129381 Km

Key 0

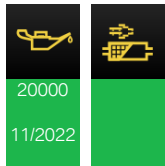

— 10/05/2021 Repair

129381 Km

10621 Zorn-
Wolf GmbH,
Imst

Job

— Job

Description:

Considered as a repeat visit No

Customer's own words Schaden vorne links, Front und Rad / Reifen vorne rechts HP (Kunde schickt Daten per Mail)

!!! unknown BMW-Id SP30 Elektr.Fahrwerksvermessung (ohne
Einstellen vor Reparatur) Rad vorne rechts ab-/anbauen Reifen/Felge
vorne rechts de-/mo !!!
Flat rate unit I -

Local

24 FRU

!!! unknown BMW-Id L Fahrzeug ab-/aufrüsten Vorderwand, Aufnahme
Scheinwerfer links und Ultraschallwandler vorne links aus-/einbauen.
Seitenw !!!
Flat rate unit I -

Local

0 FRU

!!! unknown BMW-Id L Lackierungsarbeiten 3,9 Stunden * Seitenwand
vorne links * Verkldg. Stoßstange vorne !!!
Flat rate unit I -

Local

0 FRU

!!! unknown BMW-Id LM Lackmaterial !!!
Flat rate unit I -

Local

0 FRU

!!! unknown BMW-Id 4444 245/50R18 Nokian Powerproof 100Y TL (RT)Local
Energieeff:C Nassgrip:A dB:71 !!!
Part I 4444

Local

1

!!! unknown BMW-Id KM Klein- und Verbrauchsmaterial
Hohlraum-/Unterbodenschutz !!!
Part I KM

Local

1

!!! unknown BMW-Id ENT Recycling Abgabe !!!
Part I ENT

Local

1

!!! unknown BMW-Id NBK Nebenkostenpauschale !!!
Part I NBK

Local

1

Holder
Part I 51 11 7 276 426

1

Ultrasonic sensor black
Part I 66 20 9 270 491

1

Set, cover, primed
Part I 51 11 7 338 568

1

Finisher, side panel, front left
Part I 51 11 7 338 569

1

Bracket, left
Part I 51 75 7 213 677

1

Panel, bumper, primed, front Part I 51 11 7 389 897	1
Cladding, bumper, front Part I 51 11 7 389 895	1
Bracket, left Part I 51 11 7 308 081	1
Bracket, right Part I 51 11 7 308 082	1
Bi-xenon headlight, left Part I 63 11 7 401 131	1
Left support Part I 51 64 7 210 499	1
Side panel, front left Part I 41 35 7 267 323	1
Cover, wheel arch, front left Part I 51 77 7 210 081	1
Expanding rivet, black Part I 07 14 7 293 278	18
Cover,wheel arch,frontsection,front left Part I 51 71 7 213 641	1
Compensating element Part I 63 12 7 280 779	3
Countersunk screw Part I 07 11 9 907 286	3
Holder, side panel/headlight, left Part I 41 35 7 267 327	1
Holder, side panel, front bottom left Part I 41 35 7 267 325	1
Headlight driver module, xenon lights Part I 63 11 7 421 578	1
Oval-head screw with washer Part I 07 14 7 263 759	1

03/02/2021	Key	123608 Km					Key 0	
 25000 11/2022 	 25000 629		 33000	 11/2022	 34000	 60000 1349		
03/02/2021	Service	123608 Km					10621 Zorn-Wolf GmbH, Imst	Manual
 							 ✓  ✓	
03/02/2021	Repair	123608 Km					10621 Zorn-Wolf GmbH, Imst	Job Job
Job								

Description:

Considered as a repeat visit No

Customer's own words

!!! unknown BMW-Id 57AD §57a Überprüfung durchführen !!! Flat rate unit I -	Local	12 FRU
!!! unknown BMW-Id PLAKETTE 57a Plakette !!! Part I PLAKETTE	Local	1

— Job

Description:

Considered as a repeat visit No

Customer's own words

Vehicle surface wash and interior vehicle cleaning Flat rate unit I 00 11 329	0 FRU
--	-------

— 02/11/2020 Key

119088 Km

10621

Key 0

 900 08/2021	 900 270	 900 270	 900 270	 38000	 11/2020	 40000	 900 08/2021	 900 270
---	---	---	---	--	--	--	--	---

— 02/11/2020 Repair

119088 Km

10621 Zorn-
Wolf GmbH ,
Imst

Job
Job
Job
Job

— Job

Description:

Considered as a repeat visit No

Customer's own words

!!! unknown BMW-Id WINTER30M Winterräder wuchten und montieren Sommerräder mitgeben !!! Flat rate unit I -	Local	1 FRU
--	-------	-------

— Job

Description:

Considered as a repeat visit No

Customer's own words

— Job

Description:

Considered as a repeat visit No

Customer's own words ersetzen - wurde erst vor kurzem ersetzt? lt. Kunde

Finisher, side panel, front left Part I 51 11 7 338 569	0
Fuel filter cartridge Part I 13 32 8 584 874	1
Finisher, side panel, front right Part I 51 11 7 338 570	1

— Job

Description:**Considered as a repeat visit** No**Customer's own words** Service fällig, mit Kunde besprechen Kosten?

Service - standard scope Flat rate unit I 00 00 105	2 FRU
--	-------

Engine oil service Flat rate unit I 00 00 610	3 FRU
--	-------

Microfilter service Flat rate unit I 00 00 616	1 FRU
---	-------

Additional job, service - recirculating air filter Flat rate unit I 00 00 617	1 FRU
--	-------

Service, vehicle check Flat rate unit I 00 00 624	6 FRU
--	-------

Service - air filter element Flat rate unit I 00 00 602	1 FRU
--	-------

Service fuel filter Flat rate unit I 00 00 604	5 FRU
---	-------

Brake fluid service Flat rate unit I 00 00 618	4 FRU
---	-------

!!! unknown BMW-Id ÖL 2 BMW Group LL04 5W-30 83212405675 !!! Local Part I ÖL 2	5
---	---

Set oil-filter element Part I 11 42 8 575 211	1
--	---

Fuel filter cartridge Part I 13 32 8 584 874	1
---	---

Air filter element Part I 13 71 8 570 043	1
--	---

Microfilter/activated Carbon container Part I 64 31 9 312 318	1
--	---

Set, microfilter, recirculated air Part I 64 11 9 237 159	1
--	---

Brake fluid DOT4 LV, low viscosity Part I 83 13 2 405 978	0.25
--	------

Windshield washer antifreeze Part I 83125A1A166	2
--	---

Hose clamp Part I 16 12 1 180 240	1
--------------------------------------	---

—	02/11/2020	Repair	119088 Km	10621 Zorn-Wolf GmbH, Imst	Job
---	------------	--------	-----------	----------------------------	-----

— Job

Description:**Considered as a repeat visit** No**Customer's own words** KEIN Generalischaden lt. Vers.Makler MBM Diana Tel: 05262/222 33

!!! unknown BMW-Id L Fahrzeug ab-/aufrüsten Stoßstange hinten, Aufnahme Stoßstange hinten, Halter Stoßstange hinten li., Sichtschutzrollo und !!! Flat rate unit I -	Local	0 FRU
---	-------	-------

!!! unknown BMW-Id L Lackierungsarbeiten 4,4 Stunden * Verklgd. Stoßfänger hinten * Gepäckraumboden links * Schließblech I Boden hinten !!! Flat rate unit I -	Local	0 FRU
!!! unknown BMW-Id LM Lackmaterial !!! Flat rate unit I -	Local	0 FRU
!!! unknown BMW-Id KM Klein- und Verbrauchsmaterial Hohlraum-/Unterbodenschutz !!! Part I KM	Local	1
!!! unknown BMW-Id ENT Recycling Abgabe !!! Part I ENT	Local	1
!!! unknown BMW-Id NBK Nebenkostenpauschale !!! Part I NBK	Local	1
Panel, bumper, primed, rear Part I 51 12 7 392 992		1
Cladding, bumper, rear Part I 51 12 7 338 792		1
Ultrasonic sensor black Part I 66 20 9 270 495		1
Finisher, side panel, front left Part I 51 11 7 338 569		0
Mount, bumper rear left Part I 51 12 7 338 763		1
Mounting, bumper, middle rear left Part I 51 12 7 338 757		1
Expanding rivet, black Part I 51 77 7 171 004		20
Expanding rivet, black Part I 07 14 7 293 278		10

—	04/03/2020	Key	104568 Km	10621	Key 0				
	 16000 08/2021	 16000 508	 16000 508	 16000 508	 60000	 11/2020	 -210	 16000 08/2021	 16000 508
—	04/03/2020	Service	104568 Km	10621 Zorn-Wolf GmbH , Imst	Manual				
	  	    	 						
—	04/03/2020	Repair	104568 Km	10621 Zorn-Wolf GmbH , Imst	Job Job Job				

— Job

Description:

Considered as a repeat visit No

Customer's own words kontrollieren und ggf. ers. BK hinten fertig lt. Anzeige

Removing and installing or replacing brake pads of both rear disc brakes 9 FRU
Flat rate unit I 34 21 200

Repair kit, brake pads asbestos-free 1
Part I 34 21 6 796 741

Brake-pad sensor, rear 1
Part I 34 35 6 790 304

Brake-pad paste 2
Part I 83 19 2 158 851

Cable clip 1
Part I 34 35 6 767 984

— Job

Description:

Considered as a repeat visit No

Customer's own words

Optimising water drain 3 FRU
Flat rate unit I 00 68 553

Cover 1
Part I 61 12 6 825 706

— Job

Description:

Considered as a repeat visit No

Customer's own words

!!! unknown BMW-Id ENT Recycling Abgabe !!! Local 1
Part I ENT

!!! unknown BMW-Id KM Klein- und Verbrauchsmaterial !!! Local 1
Part I KM

— 04/03/2020 Warranty 104568 Km 10621 Job: F25 F26 Optimise water drain

— Job: F25 F26 Optimise water drain

Description: F25 F26 Optimise water drain

Considered as a repeat visit No







Customer's own words

Optimising water drain 3 FRU
Flat rate unit I 00 68 553


F25 F26 Optimise water drain
Defect I 00 64 06 02 00

Cover 1
Part I 61 12 6 825 706

— 14/08/2019 Key 89917 Km 10621 Key 0



— 14/08/2019 Service 89917 Km 10621 Zorn-Wolf GmbH, Imst Manual

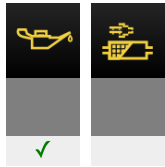

— 14/08/2019 Warranty

89917 Km

10621

Job: Engine oil service
Job: Service - standard scope
Job: Washer fluid service
Job: Service - micro filter/activated carbon filter

— Job: Engine oil service

Description: Engine oil service

Considered as a repeat visit No

Customer's own words

Engine oil service Flat rate unit I 00 00 610	3 FRU
--	-------

Engine oil service Defect I 87 00 02 00 00

Set oil-filter element Part I 11 42 8 575 211	1
--	---

— Job: Service - standard scope

Description: Service - standard scope

Considered as a repeat visit No

Customer's own words

Service - standard scope Flat rate unit I 00 00 105	2 FRU
--	-------

Service - standard scope Defect I 87 00 06 00 00

— Job: Washer fluid service

Description: Washer fluid service

Considered as a repeat visit No

Customer's own words

Washer fluid service Defect I 87 00 09 00 00

— Job: Service - micro filter/activated carbon filter

Description: Service - micro filter/activated carbon filter

Considered as a repeat visit No

Customer's own words

Microfilter service Flat rate unit I 00 00 616	1 FRU
---	-------

Additional job, service - recirculating air filter Flat rate unit I 00 00 617	1 FRU
--	-------

Service - micro filter/activated carbon filter Defect I 87 64 01 00 00

Microfilter/activated Carbon container Part I 64 31 9 312 318	1
--	---

Set, microfilter, recirculated air	1
------------------------------------	---

— 13/08/2019 Repair 89917 Km 10621 Zorn-Wolf GmbH, Imst Job
Job
Job
Job

— Job

Description:

Considered as a repeat visit No

Customer's own words

!!! unknown BMW-Id 0011002 Fahrzeugüberprüfung !!! Flat rate unit I 00 11 002	Local	2 FRU
--	-------	-------

— Job

Description:

Considered as a repeat visit No

Customer's own words

Service - standard scope Flat rate unit I 00 00 105		2 FRU
--	--	-------

Engine oil service Flat rate unit I 00 00 610		3 FRU
--	--	-------

Microfilter service Flat rate unit I 00 00 616		1 FRU
---	--	-------

Additional job, service - recirculating air filter Flat rate unit I 00 00 617		1 FRU
--	--	-------

!!! unknown BMW-Id ÖL 2 BMW Group LL04 5W-30 83212405675 !!! Part I ÖL 2	Local	5
---	-------	---

Set oil-filter element Part I 11 42 8 575 211		1
--	--	---

Microfilter/activated Carbon container Part I 64 31 9 312 318		1
--	--	---

Set, microfilter, recirculated air Part I 64 11 9 237 159		1
--	--	---

Window cleaner, concentrate Part I 83 12 2 298 203		1
---	--	---

— Job

Description:

Considered as a repeat visit No

Customer's own words Bremsen kontrollieren und BK vorne ggf. ers., falls mehr zu machen, Kunde vorher anrufen wegen Kosten

Removing and installing or replacing brake pads of both front disc brakes Flat rate unit I 34 11 505		7 FRU
---	--	-------

Repair kit, brake pads asbestos-free Part I 34 10 6 859 182		1
--	--	---

Brake pad wear sensor, front left Part I 34 35 6 790 303		1
---	--	---

Brake-pad paste Part I 83 19 2 158 851		1
---	--	---

— Job

Description:

Considered as a repeat visit No

Customer's own words

!!! unknown BMW-Id ENT Recycling Abgabe !!!
Part I ENT

Local

1

!!! unknown BMW-Id KM Klein- und Verbrauchsmaterial !!!
Part I KM

Local









1

— 07/02/2019 Key

76329 Km

10621

Key 0



— 07/02/2019 Repair

76329 Km

10621 Zorn-
Wolf GmbH,
Imst

Job
Job

— Job

Description:

Considered as a repeat visit No

Customer's own words

!!! unknown BMW-Id 0011002 Fahrzeugüberprüfung !!!
Flat rate unit I 00 11 002

Local

2 FRU

— Job

Description:

Considered as a repeat visit No

Customer's own words Laura anrufen wenn fertig!

!!! unknown BMW-Id 57AD §57a Überprüfung durchführen !!!
Flat rate unit I -

Local

12 FRU

!!! unknown BMW-Id PLAKETTE 57a Plakette !!!
Part I PLAKETTE









Local

1

— 12/11/2018 Key

71488 Km

Key 0








— 12/11/2018 Service

71488 Km

10621 Zorn-
Wolf GmbH,
Imst

Automatic



— 12/11/2018 Repair

71488 Km

10621 Zorn-
Wolf GmbH,

Job
Job

— Job

Description:**Considered as a repeat visit** No**Customer's own words**

!!! unknown BMW-Id 0011002 Fahrzeugüberprüfung !!! Flat rate unit I 00 11 002	Local	2 FRU
--	-------	-------

— Job

Description:**Considered as a repeat visit** No**Customer's own words**

Service - standard scope Flat rate unit I 00 00 105		2 FRU
--	--	-------

Brake fluid service Flat rate unit I 00 00 618		4 FRU
---	--	-------

Brake fluid DOT4 LV, low viscosity Part I 83 13 2 405 978		0.17
--	--	------

— Job

Description:**Considered as a repeat visit** No**Customer's own words**

Replace exhaust gas recirculation cooler and clean exhaust gas recirculation pipe Flat rate unit I 00 66 769		24 FRU
--	--	--------

exhaust cooler Part I 11 71 8 477 660		1
--	--	---

EGR small parts set Part I 11 71 8 490 222		1
---	--	---

Pipe union Part I 11 71 7 799 853		1
--------------------------------------	--	---

—	12/11/2018	Warranty	71488 Km	10621	Job: F10 F11 F25 F26 F31 F34 F36 B47O Replacing exhaust-gas recirculation cooler
---	------------	----------	----------	-------	--

— Job: F10 F11 F25 F26 F31 F34 F36 B47O Replacing exhaust-gas recirculation cooler

Description: F10 F11 F25 F26 F31 F34 F36 B47O Replacing exhaust-gas recirculation cooler**Considered as a repeat visit** No**Customer's own words**

Replace exhaust gas recirculation cooler and clean exhaust gas recirculation pipe Flat rate unit I 00 66 769		24 FRU
--	--	--------

F10 F11 F25 F26 F31 F34 F36 B47O Replacing exhaust-gas recirculation cooler Defect I 00 11 83 04 00		
---	--	--

exhaust cooler Part I 11 71 8 477 660		1
--	--	---

EGR small parts set		1
---------------------	--	---

Pipe union
Part I 11 71 7 799 853

1

- 12/11/2018 Warranty 71488 Km 10621 Job: Service - standard scope
Job: Service - brake fluid

— Job: Service - standard scope

Description: Service - standard scope

Considered as a repeat visit No

Customer's own words

Service - standard scope
Flat rate unit I 00 00 105

2 FRU

Service - standard scope
Defect I 87 00 06 00 00

— Job: Service - brake fluid

Description: Service - brake fluid

Considered as a repeat visit No

Customer's own words

Brake fluid service
Flat rate unit I 00 00 618

4 FRU

Service - brake fluid
Defect I 87 34 00 00 00

- 23/05/2018 Key 60526 Km 10682 Key 0

									
-700	-700	-700	-700	60000	0	40000	-700		0
05/2019	373	373	373		09/2018		05/2019		

- 23/05/2018 Service 60526 Km 10682 Fritz Unterberger-Wolfgang Denzel GesmbH&Co KG, Innsbruck Automatic

								
-700	-700	-700	-700	60000		40000	-700	
✓	✓	✓	✓		09/2018			✓

- 23/05/2018 Warranty 60526 Km 10682 Job: Engine oil service
Job: Service - vehicle check
Job: Service - standard scope
Job: Washer fluid service
Job: Service - air cleaner
Job: Service - fuel filter
Job: Service - micro filter/activated carbon filter

— Job: Engine oil service

Description: Engine oil service

Considered as a repeat visit No

Customer's own words

Engine oil service Flat rate unit I 00 00 610	3 FRU
--	-------

Engine oil service Defect I 87 00 02 00 00

Set oil-filter element Part I 11 42 8 575 211	1
--	---

— Job: Service - vehicle check

Description: Service - vehicle check

Considered as a repeat visit No

Customer's own words

Service, vehicle check Flat rate unit I 00 00 624	6 FRU
--	-------

Service - vehicle check Defect I 87 00 05 00 00
--

— Job: Service - standard scope

Description: Service - standard scope

Considered as a repeat visit No

Customer's own words

Service - standard scope Flat rate unit I 00 00 105	2 FRU
--	-------

Service - standard scope Defect I 87 00 06 00 00

— Job: Washer fluid service

Description: Washer fluid service

Considered as a repeat visit No

Customer's own words

Washer fluid service Defect I 87 00 09 00 00

— Job: Service - air cleaner

Description: Service - air cleaner

Considered as a repeat visit No

Customer's own words

Service - air filter element Flat rate unit I 00 00 602	1 FRU
--	-------

Service - air cleaner Defect I 87 13 01 00 00
--

Air filter element Part I 13 71 8 570 043	1
--	---

— Job: Service - fuel filter

Description: Service - fuel filter

Considered as a repeat visit No

Customer's own words

Service fuel filter Flat rate unit I 00 00 604	5 FRU
---	-------

Service - fuel filter Defect I 87 13 02 00 00
--

Fuel filter cartridge Part I 13 32 8 584 874	1
---	---

Hose clamp Part I 07 12 9 952 104	2
--------------------------------------	---

— Job: Service - micro filter/activated carbon filter

Description: Service - micro filter/activated carbon filter

Considered as a repeat visit No


Customer's own words

Microfilter service Flat rate unit I 00 00 616	1 FRU
---	-------


Service - micro filter/activated carbon filter Defect I 87 64 01 00 00

Microfilter/activated Carbon container Part I 64 31 9 312 318	1
--	---


12/12/2017 Service	49737 Km	10682 Fritz Unterberger- Wolfgang Denzel GesmbH&Co KG, Innsbruck	Automatic
--------------------	----------	---	-----------

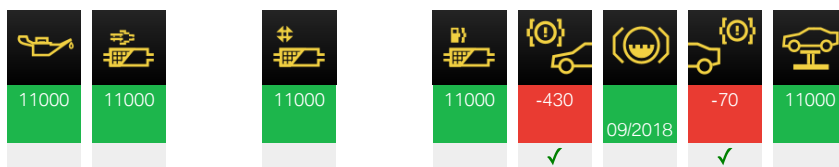


11/12/2017 Key	49737 Km	10682	Key 0
----------------	----------	-------	-------

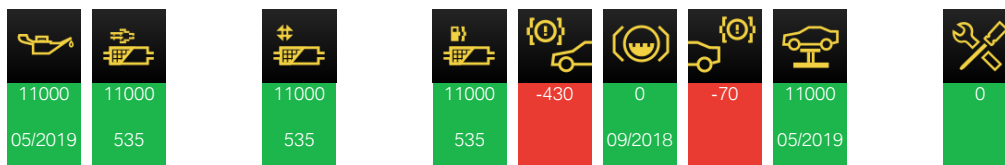

05/12/2017 Key	49380 Km	10682	Key 0
----------------	----------	-------	-------

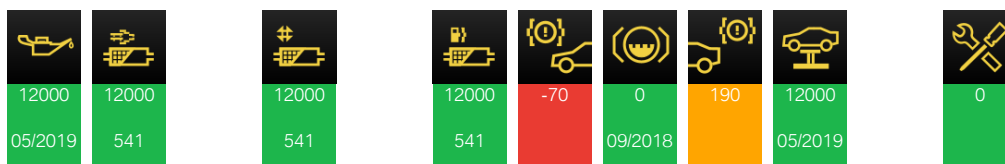

20/06/2017 Key	33434 Km	10682	Key 0
----------------	----------	-------	-------

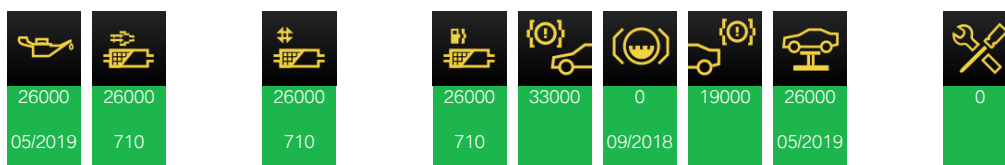

20/06/2017 Warranty	33434 Km	10682	Job: F1x F2x F3x F4x B47 Replacing the exhaust-gas recirculation valve
---------------------	----------	-------	--

— Job: F1x F2x F3x F4x B47 Replacing the exhaust-gas recirculation valve

Description: F1x F2x F3x F4x B47 Replacing the exhaust-gas recirculation valve

Considered as a repeat visit No

Customer's own words

Replace exhaust-gas recirculation valve	7 FRU
Flat rate unit I 00 64 525	

F1x F2x F3x F4x B47 Replacing the exhaust-gas recirculation valve
Defect I 00 11 15 04 00

Gasket Steel	1
Part I 11 71 8 579 364	

Oval head screw	2
Part I 35 21 7 685 343	

Hose clamp	2
Part I 07 12 9 952 104	


EGR-valve	1
Part I 11 71 8 594 492	

— 05/05/2017 Key

29954 Km

10682

Key 0

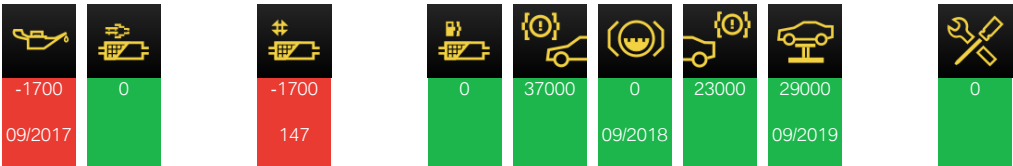


— 05/05/2017 Service

29954 Km

10682 Fritz
Unterberger-
Wolfgang
Denzel
GesmbH&Co
KG, Innsbruck

Automatic

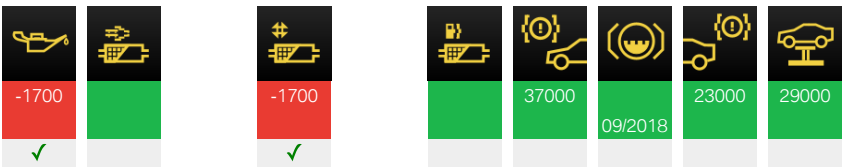

— 05/05/2017 Warranty

29954 Km

10682

Job: Engine oil service
Job: Service - standard scope
Job: Washer fluid service
Job: Service - micro filter/activated
carbon filter

— Job: Engine oil service

Description: Engine oil service

Considered as a repeat visit No

Customer's own words

Engine oil service	3 FRU
Flat rate unit I 00 00 610	

Engine oil service
Defect I 87 00 02 00 00

Set oil-filter element	1
Part I 11 42 8 575 211	

— Job: Service - standard scope

Description: Service - standard scope

Considered as a repeat visit No

Customer's own words

Service - standard scope	2 FRU
Flat rate unit I 00 00 105	

Service - standard scope
Defect I 87 00 06 00 00

— Job: Washer fluid service

Description: Washer fluid service

Considered as a repeat visit No

Customer's own words

Washer fluid service
Defect I 87 00 09 00 00

— Job: Service - micro filter/activated carbon filter

Description: Service - micro filter/activated carbon filter

Considered as a repeat visit No


Customer's own words

Microfilter service	1 FRU
Flat rate unit I 00 00 616	

Service - micro filter/activated carbon filter
Defect I 87 64 01 00 00

Microfilter/activated Carbon container	1
Part I 64 31 9 312 318	

— 20/10/2016 Key 16760 Km 10682 Key 0

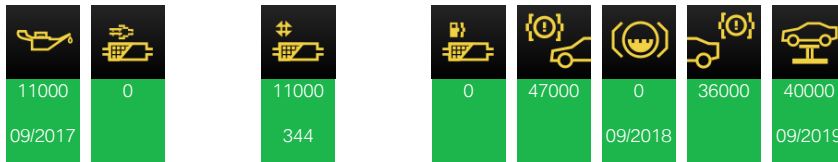

— 09/06/2016 Warranty 9558 Km 10682 Job: F25 F26 Reworking the ISOFIX bracket

— Job: F25 F26 Reworking the ISOFIX bracket

Description: F25 F26 Reworking the ISOFIX bracket

Considered as a repeat visit No

Customer's own words

Reworking the Isofix bracket	19 FRU
Flat rate unit I 00 64 054	

F25 F26 Reworking the ISOFIX bracket
Defect I 00 41 76 01 00

Reinforcement for holder of Isofix	4
Part I 41 00 2 697 433	

Set felt strip adhesive	4
Part I 52 20 2 697 913	

— 11/04/2016 Key 6923 Km 10682 Key 0

