

Vehicle

BMW 318d, 110kW

WBA8H71080K659593



Development code	F31
Color	glacier-silber metallic
Actual integration level	F020-22-07-530
Start of warranty	November 26, 2015

▼ Technical Campaigns

There are no campaigns available.

▼ Special information

There are no campaigns available.

▼ Live Diagnosis

⚠ An error has occurred. Please try again later.

▼ Service contracts

No BSI contracts available

You can find additional service contract information and selection options in the DCSNet warranty vehicle enquiry.

▼ Information on faults, workshop/Service Consultation

No information on faults is available.

▼ Navigation map

AM__AZ0020: An error occurred when retrieving the central data. Please try again later.

▼ Vehicle details

Vehicle type	Passenger car
Brand	BMW
Model	318d

Body	TOUR
Vehicle identification number (last 7 characters)	K659593
Vehicle identification number (17 characters)	WBA8H71080K659593
Development code	F31
Steering	LL
Engine	B47U
Engine number	55489446
Exhaust re-treatment	EURO6;W;PI/Ci; M, N1 I
Transmission	AUT
Transmission number	0211257ZQB
Head unit serial number	HB2140F7680091
Drive	HECK
Integration level	F020-15-11-502
Production date	Nov 20, 2015
Production works	Muenchen
Delivery date	Jan 13, 2016
Delivering Retailers	No information
National-market version	EUR
Paint code	A83
Upholstery code	CBAT
Model code	8H81
Base type	8H71
Lead type	8H81

▼ Optional equipment

Optional equipment fitted at the factory:

01CA Selection of COP relevant vehicles
 01CB CO2 package
 0205 Automatic transmission
 0216 Hydro steering-servotronic
 0230 EU-specific additional contents
 0258 Tire with run-flat functionality
 02L3 BMW LA wheel, V Spoke 395
 02VB Tire pressure display
 0302 Alarm system
 0320 Deleted, model lettering
 0322 Comfort access
 03AA Roof railing black
 0423 Floor mats, velours
 0428 Warning triangle and first aid kit
 0430 Interior/outside mirror with auto dip

Retrofitted optional equipment:

This vehicle has no retrofits.

Page	Dealer	Overview
0 km	OSS- 60160515 Tucholke Auto Partner GmbH, Oldenburg	Manual
	  	  
		
5 km		Key 0

									
27000	27000	27000	27000	15000		14000	60000		
06/2025	06/2025	06/2025	06/2025		06/2025		06/2027		12/2024

—	06/05/2023	Service	158541 km	OSS-60160515 Tucholke Auto Partner, Oldenburg	Manual
---	------------	---------	-----------	---	--------

										
✓	✓	✓	✓		✓		✓			

—	05/25/2023	Key	158077 km	Key 0
---	------------	-----	-----------	-------

									
-2000 6.5 % -85 11.6 %		-2000 -85 11.6 %		19000		-85 11.6 %	18000	29000	
								03/2025	12/2024

—	08/11/2022	Key	145994 km	01592	Key 0
---	------------	-----	-----------	-------	-------

									
11000		11000		26000		24000	42000		
03/2023		03/2023			03/2023		03/2025		10/2022

—	10/09/2020	Key	117517 km	02428	Key 0
---	------------	-----	-----------	-------	-------

									
6000	6000	6000	6000	43000	0	39000	6000		
10/2021	387	387	387		02/2021		10/2021		10/2020

—	10/09/2020	Repair	117517 km	02428 Bobrink & Co. GmbH , Bremen	Job Job Job Job
---	------------	--------	-----------	--------------------------------------	--------------------------

—	Job
---	-----

Description:
Is interpreted as a repeat visit: No
Customer's own words:

Package I MM0103

Local

Service consultation at the vehicle with customer without service ticket

0

Flat rate unit I 00 52 053

—	Job
---	-----

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Package I MM01HU	Local	
§ Abgasuntersuchung Flat rate unit I -	Local	8
Fremdleistung: HU-Abnahme Flat rate unit I -	Local	1
!!! unknown BMW-Id 99990000101 AU-Siegel !!! Part I 99990000101	Local	1

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Package I MM01WRAKTION	Local	
Winter Komfortcheck Flat rate unit I -	Local	5

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

!!! unknown BMW-Id ESTIMATE 0170-6329891 !!! Flat rate unit I -	Local	0 FRU
--	-------	-------

— 01/21/2020 Key 99971 km 02428 Key 0

 24000 10/2021	 24000 649	 24000 649	 24000 649	 60000	 0 02/2021	 48000	 24000 10/2021	 0 10/2020
---	---	---	---	--	---	--	--	---

— 01/21/2020 Repair 99971 km 02428 Bobrink & Co. GmbH , Bremen Job Job Job: Replace left and right wiper blade Job

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

APAS TC-1-0011400500 Flat rate unit I -	Local	15 FRU
--	-------	--------

!!! unknown BMW-Id ESTIMATE F1x F2x F3x F4x G0x G1x G3x B47 Local 0 FRU
AGR-Kühler prüfen ggf. ersetzen !!!
Flat rate unit I -

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Package I MM0103

Local

Service consultation at the vehicle with customer without service
ticket
Flat rate unit I 00 52 053

0

— Job: Replace left and right wiper blade

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Replace left and right wiper blade
Package I 6161541

Replace left and right wiper blade
Flat rate unit I 61 61 541

1

Set of wiper blades
Part I 61612241375

1

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

!!! unknown BMW-Id ESTIMATE 0170-6329891 !!!
Flat rate unit I -








Local

0 FRU

— 02/12/2019 Key

67939 km

Key 0












— 02/12/2019 Service

67939 km

02428 Bobrink
& Co. GmbH,
Bremen

Automatic



— 02/12/2019 Repair

67939 km

02428 Bobrink
& Co. GmbH ,

Job
Job

	Bremen	Job
		Job
		Job

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Package I MM0103 Local

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Package I 0000105

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Package I 0000618

Brake fluid DOT4 LV, low viscosity 1
Part I 83132184843

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Package I MM020000015 Local

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

—	02/12/2019	Repair	67939 km	02428 Bobrink & Co. GmbH , Bremen	Job Job Job Job
---	------------	--------	----------	---	--------------------------

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Service consultation at the vehicle with customer without service ticket 0 FRU

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Standard scope of service Flat rate unit I 00 00 105	2 FRU
---	-------

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Brake fluid service Flat rate unit I 00 00 618	4 FRU
Brake fluid DOT4 LV, low viscosity Part I 83 13 2 184 843	1

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Maschinenaussenwäsche und Fahrzeug Fußraum aussaugen im Wert von Flat rate unit I 00 00 015	Local	1 FRU
--	-------	-------

10/16/2018	Repair	1 km	00088 Niederlassung Bremen BMW AG, Bremen	Job
------------	--------	------	--	-----

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Überprüfung nach § 29 STVZO Part I 0012159	Local	1
Vorführung gem. Anl. VIIIb zu §29 StVZO Part I 12345	Local	1

09/07/2018	Key	60888 km	Key 0
------------	-----	----------	-------



28000
06/2020



0



28000
662



0



80000



0
11/2018



70000



60000
06/2022



0
12/2018

—	09/07/2018	Repair	60888 km	00088 Niederlassung Bremen BMW AG, Bremen	Job Job Job Job Job Job
---	------------	--------	----------	--	--

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Schadenfotos erstellen Flat rate unit I AZ51 02 6	Local	1 FRU
Radhaus HAL instandsetzen Flat rate unit I AZ41 99 0	Local	10 FRU
Batterie abklemmen Flat rate unit I AZ41 99 0	Local	1 FRU
Gepäckraumboden HL lackieren Flat rate unit I AZ41 99 0	Local	2 FRU
Carry out Kinematics Diagnosis System wheel alignment with vehicle load up to design position Flat rate unit I 32 00 590		16 FRU
Stripping and equipping the straightening bench Flat rate unit I 41 00 800		32 FRU
Stripping and refitting work for painting the rear left or right doors Flat rate unit I 51 18 850		3 FRU
Replacing the rear quarter panel, left and tail panel Flat rate unit I 41 35 251		197 FRU
Replace rear bumper panel Flat rate unit I 51 12 657		1 FRU
Additional work with Park Distance Control Flat rate unit I 66 20 602		5 FRU
Replacing left trunk base Flat rate unit I 41 12 653		21 FRU
Performing vehicle test Flat rate unit I 00 00 556		2 FRU
Cavity sealant for rear quarter panel, left or right and tail panel Flat rate unit I 97 35 752		5 FRU
Cavity sealant for complete rear left or right wheel well Flat rate unit I 97 14 512		2 FRU
Painting bumper cover, rear Flat rate unit I 99 69 529		16 FRU
Painting the tail panel Flat rate unit I 99 34 511		4 FRU
Painting the rear quarter panel, left or right Flat rate unit I 99 36 529		45 FRU

Painting the rear door, left or right Flat rate unit I 99 52 538		7 FRU
Painting wheel well, rear left or right Flat rate unit I 99 80 559		6 FRU
Adjusting the rear axle and front axle Flat rate unit I 32 00 630		11 FRU
Fahrzeugreinigung nach Reparatur Part I 0000154	Local	1
Lackmaterial Part I 99 99 9 999 990	Local	388
Screw Part I 83 19 0 301 639		20
Punch rivet N4 Part I 83 19 2 457 307		60
Punch rivet Part I 83 19 2 158 079		15
Left rear side panel Part I 41 00 7 298 179		1
Cavity protection wax remover Part I 83 12 0 390 086		1
Body adhesive K5 Part I 83 19 2 158 654		2
Plastic capnut with washer Part I 51 16 1 943 122		10
Plastic capnut with washer Part I 07 14 7 169 847		10
Positioning aid T-bolt Part I 41 21 2 460 145		1
T-welding stud Part I 41 31 8 412 638		15
Reinforcement plate, C-pillar, left Part I 41 21 7 298 193		1
Reinforcement plate, D-pillar, left Part I 41 21 7 298 197		1
Reinforcement plate, rocker panel, left Part I 41 21 7 298 207		1
Reinforcement plate, universal Part I 41 21 7 275 563		1
Rear light in the side panel, left Part I 63 21 7 372 209		1
Rear ventilation Part I 64 22 9 176 945		2
Side window, rear left Part I 51 37 7 259 713		1

Hook&loop fastener Part I 51 37 7 147 127	10
seal, rear left side window Part I 51 37 7 336 791	1
Trunk floor left Part I 41 00 7 297 907	1
Cover, wheel housing, rear left Part I 51 71 7 260 293	1
Repair flat rate, window, cold, 1 hr. Part I 83 19 2 289 285	1
Carrier, bumper rear Part I 51 12 7 256 927	1
Washer-gasket Part I 51 12 7 240 917	2
Hex nut Part I 07 14 7 266 441	4
Bumper trim panel, primed, rear Part I 51 12 7 384 615	1
Adhesive set K6 Part I 83 19 2 317 925	1
Kit, mount for PDC/PMA sensor, rear Part I 51 12 7 445 160	1
Cover, towing eye, primed, rear Part I 51 12 7 428 436	1
Trim strip, black Part I 51 12 7 384 571	1
Reinforcement for bumper, rear lower Part I 51 12 7 256 921	1
Guide, center rear Part I 51 12 7 260 462	1
Guide for bumper, side, left Part I 51 12 7 384 479	1
Guide for bumper, side, right Part I 51 12 7 384 480	1
Underbody panelling, rear left Part I 51 75 7 258 047	1
Reflector, rear left Part I 63 14 7 400 207	1
Reflector, rear right Part I 63 14 7 400 208	1
Ultrasonic sensor, Glacier Silver Part I 66 20 9 261 580	2
Decoupling ring PDC torque converter Part I 66 20 6 923 000	2
Tail trim	1

Blind rivet N3 Part I 83 19 0 301 421	60
Body adhesive K5 Part I 83 19 2 157 298	2
Seam sealer Part I 83 42 2 409 985	3
Cleaner R1 Part I 83 19 2 211 217	3
Drill bit, heavy-duty Part I 83 19 2 359 263	1
Two-component metal filler strengthened Part I 83 19 2 288 329	2
Support Part I 51 24 7 349 307	3
Bracket, audio amplifier Part I 65 15 9 235 506	1
Set felt strip self-adhesive Part I 51 45 2 353 024	1
Hex bolt Part I 07 11 9 904 269	1
Body nut Part I 61 13 1 372 033	2
Felt strip, self-adhesive Part I 54 34 7 248 700	1
Emblem adhered rear Part I 51 12 8 062 191	1
Duct cover, outer, door, rear left Part I 51 35 7 258 291	1
Clamp Part I 51 13 7 157 096	3
Clamp Part I 51 33 7 309 097	1
Securing pin Part I 07 14 7 296 886	20
Expanding nut Part I 07 14 9 248 255	10
Wheel center cap with chrome ring Part I 36 13 6 783 536	1
Snap-lock coupling Part I 07 14 7 306 640	2
Lower tail lid trim panel Part I 51 49 7 274 776	1
Clamp Part I 07 14 7 654 321	4

Clip Natur 15
Part I 51 49 7 054 228

Sheet metal screw 2
Part I 07 11 9 907 237

Plug-in nut 2
Part I 46 63 7 651 465

Expanding nut 3
Part I 07 14 6 974 274

Fillister head screw with collar 3
Part I 07 14 7 316 550

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Fahrzeugüberprüfung im Rahmen der Annahm Local 0 FRU
Flat rate unit I 00 52 054

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:








— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

— 08/28/2018 Key 58946 km 00088 Key 0



30000
06/2020

0

30000
672

0

80000

0
11/2018

70000

60000
06/2022

0
12/2018

— 08/28/2018 Repair 58946 km 00088 Job
Niederlassung Job

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Fahrzeugüberprüfung im Rahmen der Annahm	Local	0 FRU
Flat rate unit I 00 52 054		

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words: O.Ton Kunde : Fzg hat keine Leistung / MIL leuchtet - Fahrzeug fährt,nicht schneller als 110 KM/H.,Funktionstest AGR Ventil durchgeführt. Die Sollwerte wurden icht,erreicht AGR Ventil ers und FZG ansc
hliessend auf aktuellen Datenstand,programmieren. Es ist ein AGR Ventil mit Index 02 verbaut.,

Carrying out vehicle test	4 FRU
Flat rate unit I 00 00 006	

Replacing the exhaust-gas recirculation valve	7 FRU
Flat rate unit I 11 71 501	

Program/encode control unit(s), includes deleting the fault memory	4 FRU
Flat rate unit I 61 00 730	

EGR-valve	1
Part I 11 71 8 513 132	

Gasket Steel	1
Part I 11 71 8 579 364	

Oval head screw	2
Part I 35 21 7 685 343	

Hose clamp	2
Part I 07 12 9 952 104	

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

kostenlose Fahrzeugoberwäsche	Local	1
Part I 0011319		

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words: Telefonnummern Hänler / Servicemobil im Fahrzeug ändern,

Telefonnummern Hänler / Servicemobil im	Local	2 FRU
Flat rate unit I AZSD001		

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Üstra/BSAG Fahrkarten
Part I 0099180

Local









1

— 07/31/2018 Key

57876 km

00088

Key 0



— 07/31/2018 Repair

57876 km

00088

Niederlassung
Bremen BMW
AG, Bremen

Job

Job

Job

Job

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Fahrzeugüberprüfung im Rahmen der Annahm
Flat rate unit I 00 52 054

Local

0 FRU

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words: O.Ton Kunde : Motorkontrolle leuchtet und das Fzg nimmt kein Gas an,erreicht keine volle Leistung,# Testmodul AGR-Ventil wurde abgearbeitet die Sollwerte wurden nicht,erreicht dass AGR-Ventil muss er setzt werden. Das Fahrzeug wird im,anschluss wie auch im Testmodul beschrieben Programmiert (siehe auch,Vorgangsprotokoll oder Screenshot im Anhang)/ Teile und AW's sind,bereits aufgebucht,

Performing test module, programming control units and replacing
exhaust-gas recirculation valve
Flat rate unit I 00 64 942

16 FRU

Ersatzfahrzeug (24 Stunden)
Part I 0000160

Local

1

Oval head screw
Part I 35 21 7 685 343

2

Gasket Steel
Part I 11 71 8 579 364

1

Holder
Part I 61 13 1 369 832

1

Hose clamp
Part I 07 12 9 952 104

2

EGR-valve
Part I 11 71 8 594 492

1

Anti-freeze
Part I 83 19 2 218 347

1

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

kostenlose Fahrzeugoberwäsche
Part I 0011319

Local

1

— Job

Description:

Is interpreted as a repeat visit: No










Customer's own words:

— 11/21/2017 Key

45071 km

00088

Key 0



— 11/21/2017 Repair

45071 km

00088
Niederlassung
Bremen BMW
AG, Bremen

Job
Job
Job

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Fahrzeugüberprüfung im Rahmen der Annahm
Flat rate unit I 00 52 054

Local

0 FRU

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words: WR eingelagert, SR ins Fzg. legen,

Rädersatz komplett ummontieren
Flat rate unit I AZ80 00 1

Local

6 FRU

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:


—	05/08/2017	Repair	24970 km	00088 Niederlassung Bremen BMW AG, Bremen	Job
---	------------	--------	----------	--	-----

—	Job
---	-----

Description:
Is interpreted as a repeat visit: No
Customer's own words:

Einlagerungsgebühr Saison-Radsatz Part I 0099444	Local	1
---	-------	---

—	04/27/2017	Service	24970 km	00088 Niederlassung Bremen, Bremen	Manual
---	------------	---------	----------	---	--------

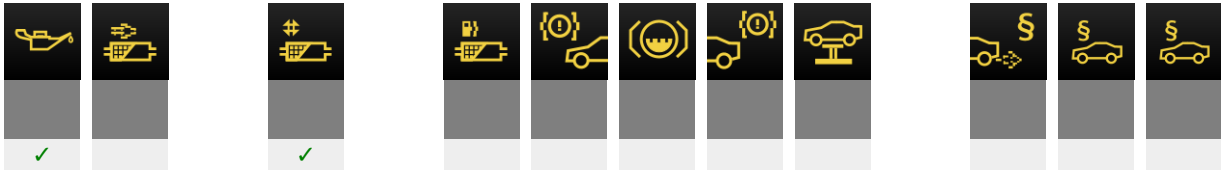

—	04/25/2017	Repair	24970 km	00088 Niederlassung Bremen BMW AG, Bremen	Job Job Job Job Job
---	------------	--------	----------	--	---------------------------------

—	Job
---	-----

Description:
Is interpreted as a repeat visit: No
Customer's own words:

—	Job
---	-----

Description:
Is interpreted as a repeat visit: No
Customer's own words:

Premium Selection Gebrauchte Automobile Flat rate unit I AZ00 03 6	Local	18 FRU
---	-------	--------

Warnweste gelb Part I 99 99 9 920 471	Local	1
--	-------	---

BMW key ring 'Square' Part I 80 56 0 443 278		1
---	--	---

—	Job
---	-----

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Service - microfilter Flat rate unit I 00 00 616	2 FRU
Microfilter/activated Carbon container Part I 64 11 9 237 555	1

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Motorölservice - zusätzliche AW Flat rate unit I IM00 25 0	Local	2 FRU
Engine oil service Flat rate unit I 00 00 610		3 FRU
Set oil-filter element Part I 11 42 8 575 211		1
BMW Engine Oil LL04 0W30 Part I 83 21 2 405 950		5

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Probefahrt (Mechaniker, interne Verrech) Flat rate unit I AZ00 80 2	Local	3 FRU
--	-------	-------

— 04/03/2017 Key 24970 km 00088 Key 1

 3300 11/2017	 0	 3300 241	 0	 60000	 0 11/2018	 60000	 32000 11/2019	 0 12/2018
--	--	--	--	--	---	--	--	---

— 04/03/2017 Repair 24970 km 00088 Job
Niederlassung Job
Bremen BMW
AG, Bremen

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Auffbereitung Gebrauchte Automobile Arwe Part I 0099366	Local	1
--	-------	---

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:Fremdleistungen Fa. Bollwinkel
Part I 0000154

Local









1

— 10/11/2016 Key

9254 km

00088

Key 1



— 10/11/2016 Repair

9253 km

00088
Niederlassung
Bremen BMW
AG, BremenJob
Job
Job

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:RDCi wheel & tire, winter, steel
Part I 36 11 2 448 002

4

Wheel cover
Part I 36 13 6 791 806

4

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words: Winterräder montieren Sommerräder ins Lager !!,Detaching and attaching the front and rear wheels
Flat rate unit I 36 10 360

6 FRU

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:Auslieferungsdurchsicht
Flat rate unit I AZ00 03 3

Local

3 FRU

— 09/28/2016 Repair

9253 km

00088
Niederlassung
Bremen BMW
AG, Bremen

Job

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Auffbereitung Gebrauchte Automobile Arwe
Part I 0099366

Local

1

—	09/27/2016	Key	9253 km	00088	Key 0
---	------------	-----	---------	-------	-------

								
20000	0	20000	0	60000	0	60000	49000	0
11/2017		428			11/2018		11/2019	12/2018