

Thank you for ordering from us!

www.checkvin.eu

Vehicle

BMW 320D XDR A, 140KW

WBA8J11050K847392



Development code F31
Colour imperial-blau brillant metallic
Actual integration level F020-23-03-500
Start of warranty 9 November 2016

Delivery stop



Technical Campaigns are available.

Technical campaigns

Status	Campaign number	Description	Reservation
Open	10032550300	Check the driver's airbag, replace if necessary (conversion SDI)  Delivery stop Local campaign number: -	

Warranty extension/VIN-based goodwill

Status	Campaign number	Description
Open	1SACC011056	Exhaust gas recirculation cooler Bx7 Local campaign number: -

Special information

There are no Campaigns for this vehicle.

Restrictions on the warranty

There are no restrictions on the warranty.

⚠ Market-specific restrictions are not currently displayed. Please check this in WDF/WXE via S-Gate.

Live Diagnosis

 There are no service solutions for Live Diagnosis.

Service contracts

No BSI contracts

Information on faults workshop/Service Consultation

There is no information on faults.

Navigation map

Note: The installed map cannot be clearly identified. Presumably one of the following maps is present in the vehicle.

Installed map	Enabling code (subscription)	Latest navigation map included in subscription	Latest navigation map subject to charge
Road Map EUROPE EVO 2016-2 (As of: 7 Jul 2023)	Enabling code valid for navigation maps with release date up to 31 Dec 2099 (SWID: 01200FFF).	Road Map EUROPE EVO 2024-2	-
Road Map EUROPE EVO 2016-2 (As of: 7 Jul 2023)	-	-	-

Vehicle details

Vehicle type	Passenger car
Brand	BMW
Model	320D XDR A
Body	TOUR
Vehicle identification number (last 7 digits)	K847392
Vehicle identification number (17 digits)	WBA8J11050K847392
Development code	F31
Steering	LL
Engine	B47O
Engine number	59949736
Exhaust re-treatment	EURO6, W, PI/CI, M, N1 I
Transmission	AUT
Transmission number	0136330WDR
Head unit serial number	HB2241G7983445
Drive	ALLR
Integration level, works	F020-16-07-506
Production date	7 Sept 2016
Production plant	Muenchen
Delivery date	7 Sept 2016
Delivering retailer	BMW ITALIA RETAIL SRL - Flotte, ROMA, IT
National-market version	EUR
Paint code	A89

Upholstery code	LCDY
Model code	8J21
Basic type	8J11
Lead type	8J21

Optional equipment

Optional equipment ex works:

01CA Selection of COP-relevant vehicles
 0205 Automatic transmission
 0216 Hydro steering-servotronic
 0230 EU-specific additional contents
 0255 Sports leather steering wheel
 0258 Tyres with runflat properties
 02H2 BMW LA wheel, multi spoke 416
 02PA Locking wheel bolt
 02VB Tyre pressure display
 0302 Alarm system
 0322 Comfort access system
 03AG Reversing camera
 0423 Floor mats velours
 0430 Interior/outside mirror with auto dip
 0431 Interior mirror with automatic-dip
 0493 Storage compartment package
 04AE Armrest front, retractable
 04FU Fine wood Fineline anthracite/acc.strip
 0508 Park Distance Control (PDC)
 0521 Rain sensor
 0534 Automatic air conditioning
 0548 Kilometre speedo
 0552 Adaptive LED headlight
 0563 Light package
 05A1 LED Fog lights
 05AC High-beam assistant
 05DC Rear-seat headrests, folding
 05DF Active cruise control+stop&go function
 0609 Navigation system Professional
 0654 DAB tuner
 0698 Area-Code 2 for DVD
 06AC Intelligent emergency call
 06AE Teleservices
 06AK Connected Drive Services
 06AM Real-Time Traffic Information
 06AN Concierge Services
 06AP Remote Services
 06NH Hands-free system with USB interface
 06UH Traffic Information
 06WA Instrument panel with extended scope
 07LE Modell Luxury Line
 07S2 Luxury Line
 07S9 Connected Drive Services Paket
 0845 Acoustic fasten seat belt reminder
 0855 Language version, Italian
 0884 On-board literature Italian
 08KA Oil service interval 24 mths / 30,000 km
 08R9 Refrigerant R1234yf
 0962 Deleted, licence plate support front
 09AA Outer skin protection
 A090 90 Ah AGM battery
 LEDE Leather equipment

Retrofitted optional equipment:

This vehicle has no retrofits.

Vehicle histories

Date	Type	Vehicle mileage	Retailer	Overview
------	------	-----------------	----------	----------

- 08/08/2024 Service 246400 Km OSS-60115877 Manual
AUTORIPARAZIONI
POZZOBON S.R.L.,
ERACLEA VE
- 07/11/2023 Service 224825 Km OSS-60115877 Manual
AUTORIPARAZIONI
POZZOBON S.R.L.,
ERACLEA VE
- 07/07/2023 Warranty 209434 Km 51807 Job: F1x F2x F3x G0x G1x G3x
B47O B47K B47U B47T Replacing
EGR cooler (high-temperature)

— Job: F1x F2x F3x G0x G1x G3x B47O B47K B47U B47T Replacing EGR cooler (high-temperature)

Description: F1x F2x F3x G0x G1x G3x B47O B47K B47U B47T Replacing EGR cooler (high-temperature)

Considered as a repeat visit No

Customer's own words

Vehicle was already finished with another repair or technical campaign
Flat rate unit I 00 74 654

1 FRU

F1x F2x F3x G0x G1x G3x B47O B47K B47U B47T Replacing EGR
cooler (high-temperature)
Defect I 00 11 15 07 00

- 07/07/2023 Warranty 209434 Km 51807 Job: G0x G3x B47O Programming
control units (DDE)

— Job: G0x G3x B47O Programming control units (DDE)

Description: G0x G3x B47O Programming control units (DDE)

Considered as a repeat visit No

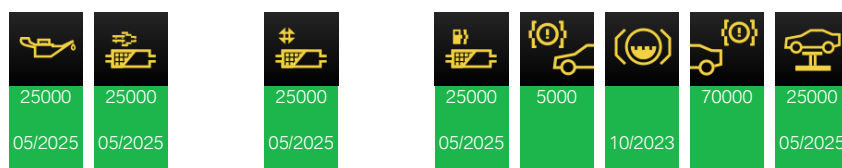
Customer's own words

Program control units
Flat rate unit I 00 71 374

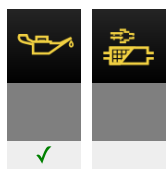
9 FRU

G0x G3x B47O Programming control units (DDE)
Defect I 00 13 51 03 00

- 06/07/2023 Key 209434 Km Key 1



- 05/05/2023 Service 203866 Km OSS-60115877 Manual
AUTORIPARAZIONI
POZZOBON DI
POZZOBON

ALBERTO, TORRE
DI MOSTO

— 09/09/2022 Service

178020 Km

OSS-60115877
AUTORIPARAZIONI
POZZOBON DI
POZZOBON
ALBERTO, TORRE
DI MOSTO

Manual

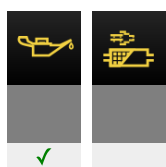


— 09/02/2022 Service

150546 Km

OSS-60115877
AUTORIPARAZIONI
POZZOBON DI
POZZOBON
ALBERTO, TORRE
DI MOSTO

Manual



— 10/12/2021 Warranty

139366 Km

47203

Job: F1x F2x F3x F4x G0x G1x G3x
B47 Check and if required replace
exhaust-gas recirculation cooler

— Job: F1x F2x F3x F4x G0x G1x G3x B47 Check and if required replace exhaust-gas recirculation cooler

Description: F1x F2x F3x F4x G0x G1x G3x B47 Check and if required replace exhaust-gas recirculation cooler**Considered as a repeat visit** No**Customer's own words**Replace exhaust gas recirculation cooler using the pressure sensor
system test and note production date of both exhaust gas recirculation
coolers

30 FRU

Flat rate unit I 00 70 020

F1x F2x F3x F4x G0x G1x G3x B47 Check and if required replace
exhaust-gas recirculation cooler
Defect I 00 11 40 05 00Set of small parts
Part I 11 71 8 597 652

1

Pipe union
Part I 11 71 7 799 853

2





































exhaust cooler
Part I 11 71 8 596 444

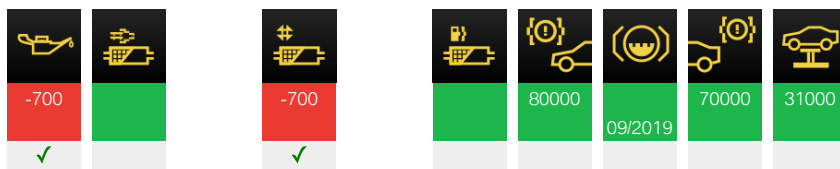
1

— 09/12/2021 Key

139366 Km

Key 1

 14000 09/2023	 	 14000 622	 	 60000	 10/2023	 48000	 45000 1342	
—	06/09/2021	Service		121426 Km	OSS-60115877	Manual		
					AUTORIPARAZIONI POZZOBON DI POZZOBON ALBERTO, TORRE DI MOSTO			
 ✓	 ✓	 ✓	 ✓	 	 	 ✓	 ✓	
—	14/10/2019	Key		75208 Km	30500	Key 1		
 25000 06/2021	 	 25000 587	 	 1200	 -43 5.9 %	 28000	 60000 06/2023	
—	14/10/2019	Service		75208 Km	30500	Automatic		
					AUTOCROCETTA SPA, MONCALIERI			
 25000 05/2021	 	 25000 05/2021	 	 1200	 09/2019	 28000	 60000 05/2023	
—	24/06/2019	Key		68602 Km	30500	Key 1		
 -5000 02/2020	 -5000 217	 -5000 217	 -5000 217	 60000	 09/2019	 34000	 -5000 02/2020	
—	24/06/2019	Service		68602 Km	30500	Automatic		
					AUTOCROCETTA SPA, MONCALIERI			
 -5000 01/2020	 -5000 01/2020	 -5000 01/2020	 -5000 01/2020	 60000	 08/2019	 34000	 -5000 01/2020	
—	21/02/2018	Key		31760 Km	30500	Key 1		
 -700 09/2018	 0	 -700 221	 0	 80000	 09/2019	 70000	 31000 09/2020	
—	21/02/2018	Service		31760 Km	30500	Automatic		
					AUTOCROCETTA			



— 21/02/2018 Warranty

31760 Km

30500

Job: F1x F2x F3x B47
programming control units and if
necessary, replacing the EGR valve

— Job: F1x F2x F3x B47 programming control units and if necessary, replacing the EGR valve

Description: F1x F2x F3x B47 programming control units and if necessary, replacing the EGR valve

Considered as a repeat visit No

Customer's own words

Carrying out the ABL and programming the control units
Flat rate unit I 00 64 246

10 FRU

F1x F2x F3x B47 programming control units and if necessary, replacing
the EGR valve
Defect I 00 11 45 04 00