



BMW 4er 418d Gran Coupé Luxury Line




Stock number:	RP83794
Build year:	2016
First registration:	09/2016
Odometer reading:	178,542 km
Fuel type:	Diesel
Horsepower:	110 kW / 150 HP
Cylinder capacity:	1,995 ccm
Gear box:	Automatic
Inspection expires:	05/2025
Body type:	Coupé
Total number of owners:	2
Keys:	2
Prior damage / Accident according to previous owner	No
Country of origin:	BE
Country of last registration:	BE
Environmental class:	EURO 6b
COC papers:	Yes
Seats:	5
Color:	Black (Original)
Upholstery:	Leather (Original)
Door count:	4

Car location

-



0:00 / 0:13

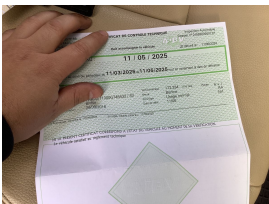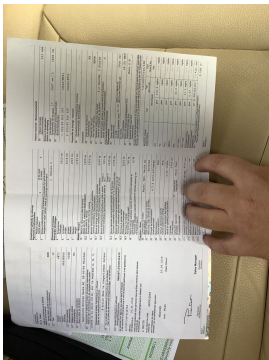



MAIN CAR DETAILS

CAR EQUIPMENT

Some content has been automatically translated.

 Xenon lights	Bi-Xenon headlights
 Heated seats	Front seat heating
 Park Distance Control	Front and Rear
 Power steering	Power steering Servotronic
 Hands-free system	Voice processor system Bluetooth hands-free system with advanced smartphone integration
 Navigation System	Integrated
 Airbag	Disconnectable passenger airbag Driver side airbag / passenger side airbag Rear Cranial Airbag System Front head airbag system Front side airbag
 AC System	Automatic
 DPF / FAP	Particulate filter
 Power windows	Electric windows front + rear
 ESP	Dynamic Stability Control (DSC)
 Immobilizer	Immobilizer
 On-board computer	On-board computer External temperature indicator Gear shift indicator
 Theft alarm system / security alarm	Alarm system



Entertainment system

In navigation system



ABS

Anti-lock Braking System (ABS)

CAR SERVICE DETAILS

Service book details:	Available
Service appointment:	All
Last service on:	06/21/2024
Last service Mileage:	172,202 km
Drive belt change on:	-
Drive belt change Mileage:	-


Car service images 2 images available



TECHNICAL INSPECTION

Date of latest technical inspection:	06/11/2024
Mileage at latest technical inspection:	172,334 km

Technical inspection images 1 image

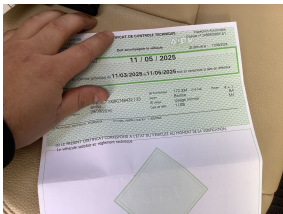

TEST DRIVE INFORMATION

TEST DRIVE LOCATION: ON PUBLIC STREET < 80KM/H (LOWER SPEED)

NO SPECIFIC FINDINGS

CAR DATA ACCORDING TO IDENTIFICATION NUMBER (VIN)

Some content has been automatically translated.

-  Automatic headlight range control
-  Upholstery: Dakota Leather
-  Color monitor (8.8 inches)
-  AUX-IN connection (AUX-IN)
-  Storage package
-  Exhaust system (1-pipe system) with mask
-  Exhaust system (dual pipes) with chrome trim
-  Automatic front and rear seat belts
-  Regenerative braking
-  Check Control System

OTHER NOTES

100kw



PAINT THICKNESS NEW

Hood	140 µm
Roof	137 µm
Front fender left	134 µm
Front fender right	134 µm
Rear fender left	143 µm
Rear fender right	123 µm
Front door left	123 µm
Front door right	135 µm
Rear door left	190 µm
Rear door right	134 µm
Tailgate (Boot lid)	132 µm


CAR DAMAGE

DAMAGE AREAS

Sub-area images are merely displayed for orientation purposes and the damage summary reports the area's condition in detail. Please note that we take photos of all significant damages. Minor damage will be displayed below in the table without a corresponding image.

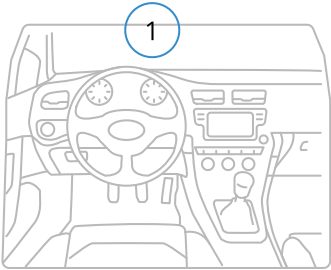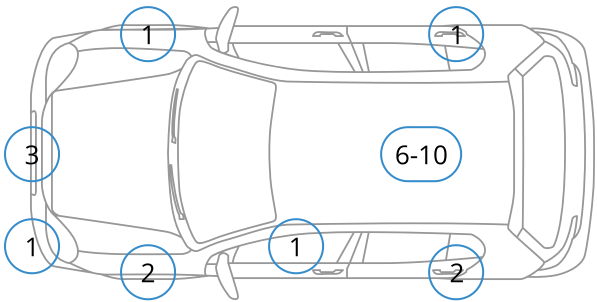

1/9

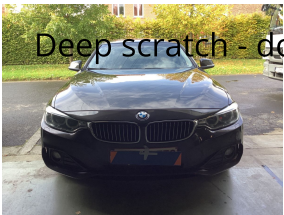

2/9

No damage specific images



3/9



4/9



5/9



6/9



Professional repaint

7/9

No damage specific images



Deep scratch

8/9



9/9

Damage and severity

FRONT LEFT FENDER

1 SCRATCH

Length: ≥50mm & <100mm Surface scratch


DAMAGE SUMMARY

The results of this car's evaluation are summarised in the DAMAGE SUMMARY table and visualised in the DAMAGE AREAS section below.

Damage / Part	Severity
6-10 Roof (6-10)	Width: ≥20mm & <50mm , Paint damage
1 REPAINT Rear left door (1)	Thickness: ≥125µm & <250µm , Professional repaint
1 SCRATCH Front left fender (1)	Length: ≥50mm & <100mm , Surface scratch
6 SCRATCHES Rear left rim (2) Front left rim (2) Front right rim (1) Rear right rim (1)	Length: ≥25mm , Deep scratch
3 SCRATCHES Front bumper (3)	Length: <20mm , Deep scratch - down to primer
1 WORN OUT Driver seat (1)	

MAIN WHEELS DETAILS [i](#)

This section visualises the state of the car's tires, brake pad and disc condition. In the case that any rim-related damages are found on this car they will be displayed in the car damages section.

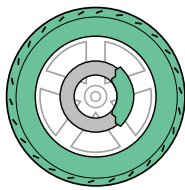

FRONT LEFT - (1/4)

Tire type

Summer

DOT

1119

Profile depth (mm)

4

Tire condition

No issues found

Rim type

Aluminium

Brake type

Disc brake

Brake pad thickness

≥ 3mm

Brake disc condition

Not measurable