



BMW 4er 420d Gran Coupé M Sport

Stock number:	GR62136
Build year:	2015
First registration:	08/2015
Odometer reading:	232,394 km
Fuel type:	Diesel
Horsepower:	140 kW / 190 HP
Cylinder capacity:	1,995 ccm
Gear box:	Automatic
Inspection expires:	09/2025
Body type:	Coupé
Total number of owners:	9 (Including car dealers)
Keys:	2
Prior damage / Accident according to previous owner	Yes
Repair Cost	Unknown
Country of origin:	SE
Country of last registration:	SE
Environmental class:	EURO 6
COC papers:	No
Seats:	5
Color:	Silver (Original)
Upholstery:	Alcantara (Original)
Door count:	4
CO2 Emissions:	114g/km





Car location

-



0:00 / 0:12

[illegible][illegible]

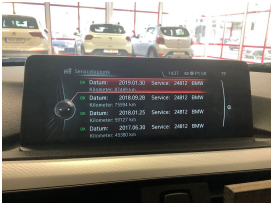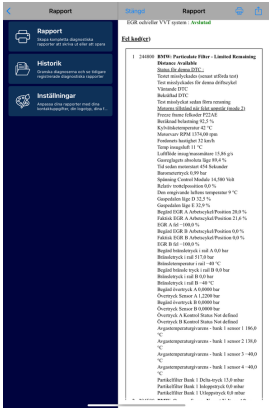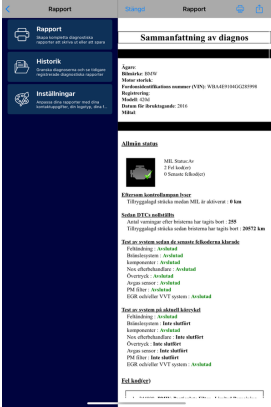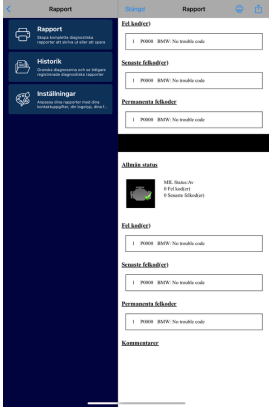

MAIN CAR DETAILS

CAR HIGHLIGHTS / ADDITIONAL PHOTOS



Windshield



Windshield



General



General

General



General



General



CAR EQUIPMENT

Some content has been automatically translated.

 Xenon lights	Bi-Xenon headlights
 Heated seats	Front seat heating
 Park Distance Control	Park-Distance-Control (PDC) front and rear
 Power steering	Power steering Servotronic
 Hands-free system	Voice processor system Bluetooth hands-free system with advanced smartphone integration
 Sport undercarriage	Sport suspension (M-Technic)
 Sport seats	Sports seats in front
 Navigation System	Professional audio-navigation system
 Airbag	Disconnectable passenger airbag Driver side airbag / passenger side airbag Rear Cranial Airbag System Front head airbag system Front side airbag
 AC System	Automatic dual-zone air conditioning with automatic air circulation control
 DPF / FAP	Particulate filter
 Power windows	Electric windows front + rear
 ESP	Dynamic Stability Control (DSC)
 Immobilizer	Immobilizer
 On-board computer	On-board computer External temperature indicator

Gear shift indicator



Entertainment system

BMW Professional audio system (Radio / DVD player compatible with MP3)

Instrument cluster (extended scope)



ABS

Anti-lock Braking System (ABS)

CAR SERVICE DETAILS

Service book details:

Digital service book

Service appointment:

Some

Last service on:

01/30/2019

Last service Mileage:

87,469 km

Drive belt change on:

-

Drive belt change Mileage:

-

Car service images 2 images available



TEST DRIVE INFORMATION

TEST DRIVE LOCATION: ON PUBLIC STREET < 80KM/H (LOWER SPEED)

NO SPECIFIC FINDINGS

CAR DATA ACCORDING TO IDENTIFICATION NUMBER (VIN)

Some content has been automatically translated.

-  Automatic headlight range control
-  Color monitor (8.8 inches)
-  AUX-IN connection (AUX-IN)
-  Storage package
-  Exhaust system (dual pipes) with chrome trim
-  Automatic front and rear seat belts
-  Exterior finish: Shadow-Line high gloss
-  Regenerative braking
-  Check Control System
-  Roof body color

OTHER NOTES

Car available for export - docs will be sent after proof of export incl. VIN is provided (CMR/customs doc/registration in new country).

it looks like there is some water inside the taillight on the left side (water drops inside)


PAINT THICKNESS NEW

Hood	410 µm
Roof	147 µm
Front fender left	193 µm
Front fender right	197 µm
Rear fender left	239 µm
Rear fender right	160 µm
Front door left	360 µm
Front door right	275 µm
Rear door left	328 µm
Rear door right	276 µm
Tailgate (Boot lid)	139 µm

CAR DAMAGE

DAMAGE AREAS

Sub-area images are merely displayed for orientation purposes and the damage summary reports the area's condition in detail. Please note that we take photos of all significant damages. Minor damage will be displayed below in the table without a corresponding image.

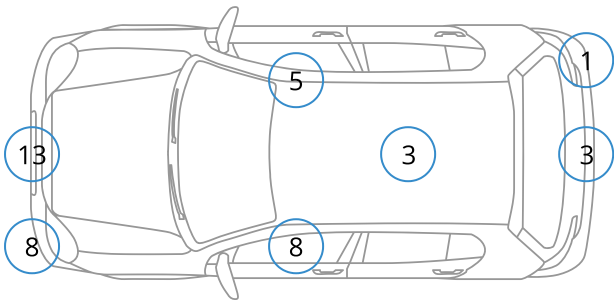

1/9



2/9



3/9



4/9



5/9



6/9

No damage specific images



7/9



Paint damage

8/9



Grinding Parts

9/9

Damage and severity

FRONT LEFT FENDER

2 STONE CHIPS

Width: ≤3mm Paint damage

5 STONE CHIPS

Width: ≤3mm No paint damage

0

LEFT SIDE SKIRTS

1 SCRATCH

Length: <20mm Surface scratch

0

DAMAGE SUMMARY


The results of this car's evaluation are summarised in the DAMAGE SUMMARY table and visualised in the DAMAGE AREAS section below.

Damage / Part	Severity
1 BODY GAP Left d pillar (1)	Grinding Parts
1 CRACK Rear left light (1)	
3 DENTS Rear left door (3)	Width: <5mm , No paint damage
1 FADED Rear right door (1)	Diameter: ≥100mm
1 FADED Hood (1)	Diameter: <100mm

5 REPAINT Hood (1) Front left door (1) Rear left door (1) Rear right door (1) Front right door (1)	Thickness: ≥250µm & <500µm , Professional repaint
2 SCRATCHES Windscreen (2)	Length: ≥100mm , Light scratch
1 SCRATCH Windscreen (1)	Length: ≥20mm & <50mm , Light scratch
1 SCRATCH Right mirror housing (1)	Length: ≥20mm & <50mm , Deep scratch - down to primer
1 SCRATCH Rear right fender (1)	Length: ≥20mm & <50mm , Surface scratch
8 SCRATCHES Front bumper (2) Front left door handle (1) Rear left door (1) Left side skirts (1) Rear bumper (2) Right mirror housing (1)	Length: <20mm , Surface scratch
5 STONE CHIPS Front left fender (5)	Width: ≤3mm , No paint damage
11 STONE CHIPS Front bumper (3) Hood (3) Front left fender (2) Roof (3)	Width: ≤3mm , Paint damage

MAIN WHEELS DETAILS

This section visualises the state of the car's tires, brake pad and disc condition. In the case that any rim-related damages are found on this car they will be displayed in the car damages section.

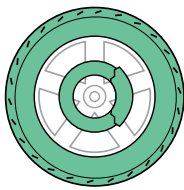

FRONT LEFT - (1/4)

Tire type

Summer

DOT

4621

Profile depth (mm)

6

Tire condition

No issues found 

Rim type

Aluminium

Brake type

Disc brake

Brake pad thickness

≥ 3mm 

Brake disc condition

No issues found 

SECONDARY WHEELS DETAILS

FRONT LEFT - (1/4)

Tire type

Summer

DOT

4415

Profile depth (mm)

6

Tire condition

No issues found 

Rim type

Aluminium