

Thank you for ordering from us!

www.checkvin.eu

Vehicle

BMW 418D A, 105KW

WBA4D51030D423369



Development code
Colour
Actual integration level
Start of warranty

F36
mineral-grau metallic
F020-22-11-510
29 April 2015

Technical campaigns

There are no Campaigns for this vehicle.

Warranty extension/VIN-based goodwill

Status	Campaign number	Description
Open	1SACC211056	Exhaust gas recirculation cooler Nx7 Local campaign number: -

Special information

There are no Campaigns for this vehicle.

Restrictions on the warranty

There are no restrictions on the warranty.

⚠ Market-specific restrictions are not currently displayed. Please check this in WDF/WXE via S-Gate.

Live Diagnosis

 There are no service solutions for Live Diagnosis.

Service contracts

No BSI contracts

Information on faults workshop/Service Consultation

There is no information on faults.

Navigation map

Installed map	Enabling code (subscription)	Latest navigation map included in subscription	Latest navigation map subject to charge
Road Map EUROPE Next 2014-2 (As of: 8 Jul 2024)	Enabling code valid for navigation maps with release date up to 31 Dec 2025 (SWID: 00A9008F).	Road Map EUROPE WEST Next 2025	-

Vehicle details

Vehicle type	Passenger car
Brand	BMW
Model	418D A
Body	COUPE
Vehicle identification number (last 7 digits)	D423369
Vehicle identification number (17 digits)	WBA4D51030D423369
Development code	F36
Steering	LL
Engine	N47T
Engine number	77188950
Exhaust re-treatment	EURO6, T, CI, M, N1 I
Transmission	AUT
Transmission number	1130417ZX5
Head unit serial number	HB2068L8329854
Drive	HECK
Integration level, works	F020-14-07-502
Production date	11 Jul 2014
Production plant	Dingolfing
Delivery date	15 Jul 2014
Delivering retailer	Alphabet España Fl. Man., S.A., Madrid, ES
National-market version	EUR
Paint code	B39
Upholstery code	HAAT
Model code	4D61
Basic type	4D51
Lead type	4D61

Optional equipment

Optional equipment ex works:

- 01CA Selection of COP-relevant vehicles
- 0205 Automatic transmission
- 0230 Extra package, EU-speciifc
- 0258 Tyres with runflat properties
- 02PA Locking wheel bolt
- 02PE BMW LA wheel, M star spoke 400
- 02VB Tyre pressure display
- 0316 automatic trunk lid mechanism
- 0337 M Sports package
- 0423 Floor mats velours
- 0441 Smoker package
- 0481 Sports seat
- 0493 Storage compartment package
- 04AD Interior trim strips, brushed aluminium
- 04AE Armrest front, retractable
- 04DL Accent strips, black, high-polish
- 0502 Headlight cleaning system
- 0521 Rain sensor
- 0522 Xenon Light
- 0534 Automatic air conditioning
- 0544 Cruise control with brake function
- 0548 Kilometre speedo
- 0575 Additional 12V sockets
- 05DA Passenger airbag deactivation
- 0609 Navigation system Professional
- 0610 Head-up display
- 0698 Area-Code 2 for DVD
- 06AC Intelligent emergency call
- 06AE Teleservices
- 06NS Comfort telephony w/ enhanced Smartphone
- 06WA Instrument panel with extended scope
- 0704 M Sports suspension
- 0710 M leather steering wheel
- 0715 M Aerodynamics package
- 0760 High gloss shadow line
- 0775 Headlining anthracite
- 0856 Language version, Spanish
- 0883 On-board literature, Spanish
- 08KA Oil service interval 24 mths / 30,000 km
- 08S3 Automatic locking during starting
- 08TH Road sign detection
- A090 90 Ah AGM battery
- POLS Cloth cushion

Retrofitted optional equipment:

This vehicle has no retrofits.

Vehicle histories

	Date	Type	Vehicle mileage	Retailer	Overview
—	08/07/2024	Key	237491 Km	06662	Key 0
					
	12000	12000	12000	12000	80000
	07/2025	07/2025	07/2025	07/2025	07/2027
—	08/07/2024	Warranty	237491 Km	06662	Job: E84 Fx Gx Bx7 Nx7 Customer notification exhaust gas recirculation cooler Job: E84 F0x F1x F2x F3x N47T Replacing exhaust-gas recirculation cooler (high-temperature) Job: Fx Replace driver's airbag (SDI)
—	Job: E84 Fx Gx Bx7 Nx7 Customer notification exhaust gas recirculation cooler				
	Description: E84 Fx Gx Bx7 Nx7 Customer notification exhaust gas recirculation cooler				

Considered as a repeat visit No

Customer's own words

Administrative effort Flat rate unit I 00 74 758	1 FRU
---	-------

E84 Fx Gx Bx7 Nx7 Customer notification exhaust gas recirculation cooler
Defect I 00 11 35 07 00

— Job: E84 F0x F1x F2x F3x N47T Replacing exhaust-gas recirculation cooler (high-temperature)

Description: E84 F0x F1x F2x F3x N47T Replacing exhaust-gas recirculation cooler (high-temperature)

Considered as a repeat visit No

Customer's own words

Replace exhaust gas recirculation cooler, including exhaust gas recirculation valve Flat rate unit I 00 73 512	0 FRU
---	-------

Additional work: run function test for pressure sensor system Flat rate unit I 00 73 513	0 FRU
---	-------

Additional work: enter component identification of new exhaust gas recirculation cooler in diagnostic system Flat rate unit I 00 73 514	0 FRU
--	-------

Additional work cleaning the exhaust gas recirculation pipe Flat rate unit I 00 73 515	2 FRU
---	-------

E84 F0x F1x F2x F3x N47T Replacing exhaust-gas recirculation cooler (high-temperature)
Defect I 00 11 62 06 00

Exhaust gas radiator high temperature Part I 11 71 7 822 350	1
---	---

EGR small parts set Part I 11 71 8 490 640	1
---	---

Holder Part I 61 13 1 369 832	1
----------------------------------	---

O-ring Part I 11 61 8 512 681	1
----------------------------------	---

Pipe union Part I 11 71 7 799 853	2
--------------------------------------	---

Acoustic cover front Part I 11 14 8 490 568	1
--	---

— Job: Fx Replace driver's airbag (SDI)

Description: Fx Replace driver's airbag (SDI)

Considered as a repeat visit No

Customer's own words

Replace driver's airbag Flat rate unit I 00 73 781	0 FRU
---	-------

Fx Replace driver's airbag (SDI)
Defect I 00 32 39 03 00

Airbag module, driver's side Part I 32305A66F66	1
--	---

— 06/02/2023 Key

219095 Km

Key 0



— 23/01/2023 Warranty

218560 Km

32314

Job: E84 F0x F1x F2x F3x N47T
 Replacing exhaust-gas recirculation
 cooler (high-temperature)
 Job: Fx Replace driver's airbag
 (SDI)

— Job: E84 F0x F1x F2x F3x N47T Replacing exhaust-gas recirculation cooler (high-temperature)

Description: E84 F0x F1x F2x F3x N47T Replacing exhaust-gas recirculation cooler (high-temperature)**Considered as a repeat visit** No**Customer's own words**

Replace exhaust gas recirculation cooler, including exhaust gas
 recirculation valve 0 FRU
 Flat rate unit I 00 73 512

Additional work: run function test for pressure sensor system 0 FRU
 Flat rate unit I 00 73 513

Additional work: enter component identification of new exhaust gas
 recirculation cooler in diagnostic system 0 FRU
 Flat rate unit I 00 73 514

E84 F0x F1x F2x F3x N47T Replacing exhaust-gas recirculation cooler
 (high-temperature)
 Defect I 00 11 62 06 00

Acoustic cover front 1
 Part I 11 14 8 490 568

Vacuum hose black 1
 Part I 11 65 8 595 650

Pipe union 2
 Part I 11 71 7 799 853

Exhaust gas radiator high temperature 1
 Part I 11 71 7 822 350

EGR small parts set 1
 Part I 11 71 8 490 640

Holder 1
 Part I 61 13 1 369 832

— Job: Fx Replace driver's airbag (SDI)

Description: Fx Replace driver's airbag (SDI)**Considered as a repeat visit** No**Customer's own words**

Replace driver's airbag 0 FRU
 Flat rate unit I 00 73 781

Fx Replace driver's airbag (SDI)
 Defect I 00 32 39 03 00

Airbag module, driver's side 1
 Part I 32 30 8 092 791

— 18/10/2022 Key

218560 Km

32314

Key 0



— 29/04/2021 Warranty 189101 Km 32314 Job: Exx Fxx Gxx Check exhaust-gas recirculation cooler and replace if needed

— Job: Exx Fxx Gxx Check exhaust-gas recirculation cooler and replace if needed

Description: Exx Fxx Gxx Check exhaust-gas recirculation cooler and replace if needed

Considered as a repeat visit No

Customer's own words

Vis. insp. of ex. gas rec. cooler cooler out. side; rep. ex. gas rec. cooler; clean mix. tube/ex. gas rec. pipe; func. check of press. sensor sys. 30 FRU
Flat rate unit I 00 67 067

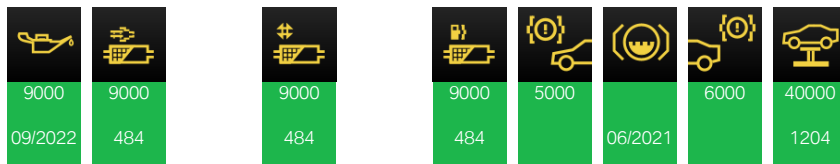
Exx Fxx Gxx Check exhaust-gas recirculation cooler and replace if needed
Defect I 00 11 97 04 00

Pipe union 2
Part I 11 71 7 799 853


exhaust cooler 1
Part I 11 71 8 476 993

EGR small parts set 1
Part I 11 71 8 479 905


— 27/04/2021 Key 189100 Km Key 0




— 26/10/2015 Key 9141 Km 10309 Key 0

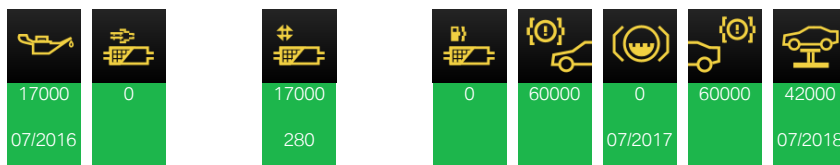




















































— 19/10/2015 Key 9141 Km 10309 Key 0





















































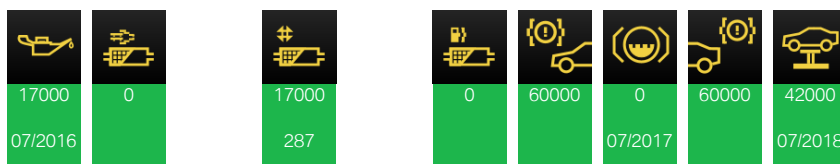


— 08/10/2015 Key 8894 Km 10309 Key 0

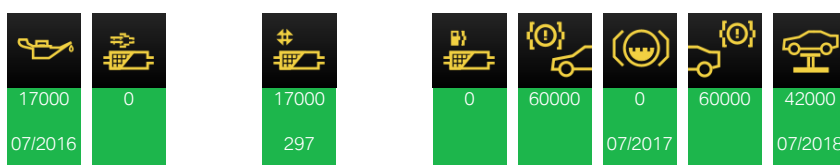

— 05/10/2015 Key 8655 Km 10309 Key 0

 17000 07/2016	 0	 17000 303	 0	 60000	 0 07/2017	 60000	 42000 07/2018
— 30/09/2015 Key		8649 Km		10309	Key 0		
 17000 07/2016	 0	 17000 304	 0	 60000	 0 07/2017	 60000	 42000 07/2018
— 29/09/2015 Key		8575 Km		10309	Key 0		
 18000 07/2016	 0	 18000 305	 0	 60000	 0 07/2017	 60000	 43000 07/2018
— 28/09/2015 Key		8560 Km		10309	Key 0		
 18000 07/2016	 0	 18000 306	 0	 60000	 0 07/2017	 60000	 43000 07/2018
— 26/09/2015 Key		8553 Km		10309	Key 0		
 18000 07/2016	 0	 18000 309	 0	 60000	 0 07/2017	 60000	 43000 07/2018
— 25/09/2015 Key		8530 Km		10309	Key 0		
 18000 07/2016	 0	 18000 310	 0	 60000	 0 07/2017	 60000	 43000 07/2018
— 24/09/2015 Key		8528 Km		10309	Key 0		
 18000 07/2016	 0	 18000 310	 0	 60000	 0 07/2017	 60000	 43000 07/2018
— 23/09/2015 Key		8371 Km		10309	Key 0		
 18000 07/2016	 0	 18000 312	 0	 60000	 0 07/2017	 60000	 43000 07/2018
— 17/09/2015 Key		8371 Km		10309	Key 0		

								
18000	0	18000	0	60000	0	60000	43000	
07/2016		317			07/2017			07/2018
—	16/09/2015	Key		8128 Km	10309		Key 0	
								
18000	0	18000	0	60000	0	60000	43000	
07/2016		319			07/2017			07/2018
—	15/09/2015	Key		8102 Km	10309		Key 1	
								
18000	0	18000	0	60000	0	60000	43000	
07/2016		346			07/2017			07/2018
—	19/08/2015	Key		8100 Km	10309		Key 1	
								
18000	0	18000	0	60000	0	60000	43000	
07/2016		347			07/2017			07/2018
—	07/08/2015	Key		7129 Km	10309		Key 1	
								
20000	0	20000	0	60000	0	60000	47000	
07/2016		358			07/2017			07/2018
—	28/07/2015	Key		7085 Km	10309		Key 1	
								
21000	0	21000	0	60000	0	60000	47000	
07/2016		368			07/2017			07/2018
—	27/07/2015	Key		7072 Km	10309		Key 1	
								
21000	0	21000	0	60000	0	60000	47000	
07/2016		377			07/2017			07/2018
—	13/07/2015	Key		6799 Km	10309		Key 1	
								
22000	0	22000	0	60000	0	60000	50000	
07/2016		383			07/2017			07/2018
—	10/07/2015	Key		6799 Km	10309		Key 1	

 22000 07/2016  0  22000 386  0  60000  0 07/2017  60000  50000 07/2018	—	08/07/2015	Key	6639 Km	10309	Key 1
 22000 07/2016  0  22000 389  0  60000  0 07/2017  60000  60000 07/2018	—	13/06/2015	Key	1583 Km	10309	Key 1
 27000 07/2016  0  27000 414  0  50000  0 07/2017  50000  60000 07/2018	—	08/06/2015	Key	955 Km	10309	Key 1
 28000 07/2016  0  28000 419  0  50000  0 07/2017  50000  60000 07/2018	—	02/06/2015	Key	14 Km	10309	Key 1

