



BMW 3er 320d Sport Line




Stock number:	<i>FN82636</i>
Build year:	2015
First registration:	11/2015
Odometer reading:	189,653 km
Fuel type:	Diesel
Horsepower:	140 kW / 190 HP
Cylinder capacity:	1,995 ccm
Gear box:	Automatic
Inspection expires:	11/2026
Body type:	Combi
Total number of owners:	2
Keys:	2
Prior damage / Accident according to previous owner	Yes
Country of origin:	DE
Country of last registration:	-
Environmental class:	EURO 6
COC papers:	Yes
Seats:	5
Color:	Gray (Original)
Upholstery:	Cloth (Original)
Door count:	5
CO2 Emissions:	114g/km

Car location

-



0:00 / 0:16

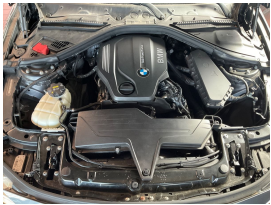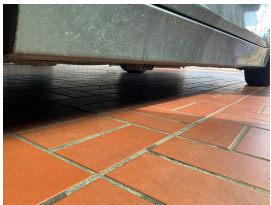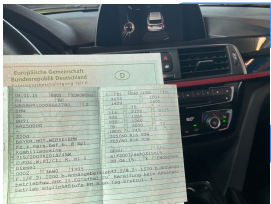





MAIN CAR DETAILS

CAR HIGHLIGHTS / ADDITIONAL PHOTOS



General



General



General

OTHER NOTES

Some content has been automatically translated. [Show original](#)

Rear seat not visible

- Vehicle dirty

TEST DRIVE INFORMATION

TEST DRIVE LOCATION: ON PUBLIC STREET < 80KM/H (LOWER SPEED)

NO SPECIFIC FINDINGS

VEHICLE CONDITION

 1 area with sign of previous accident

 Repair status: Repaired

 Repaired by: Unknown


 Repair cost: Unknown

 Repair document not available

 6 damaged areas

 1 repainted panel

Exterior

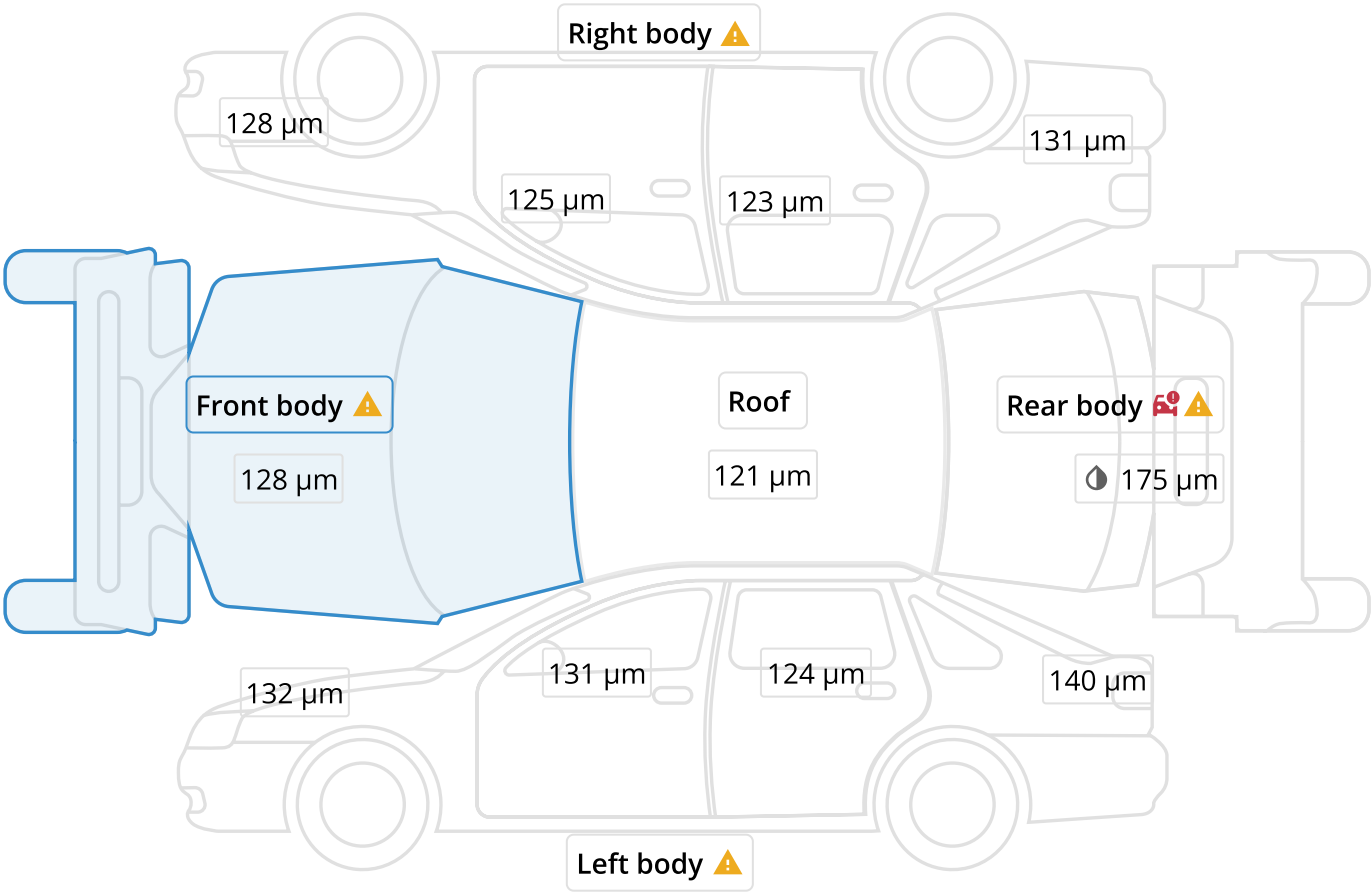



Interior



Wheels



Underbody



Engine and drive system





⚠ Damages

Panel	Damage	Severity	Description	Quantity	
<u>Hood</u>	Scratch	Length: ≥50mm & <100mm	Deep scratch - down to primer	4	 1
<u>Front bumper</u>	Scratch	Length: ≥100mm	Deep scratch - down to primer	6-10	 2
<u>Hood</u>	Stone chip	Width: ≤3mm	Paint damage	6-10	 1

DAMAGE SUMMARY

The results of this car's evaluation are summarised in the DAMAGE SUMMARY table and visualised in the DAMAGE AREAS section below.

Damage / Part	Severity
1 DENT Rear bumper (1)	Width: ≥50mm , Paint damage
1 DENT Rear left fender (1)	Width: ≥20mm & <50mm , No paint damage
5 DENTS Front left door (5)	Width: ≥5mm & <20mm , No paint damage
1 DENT Front left door (1)	Width: ≥5mm & <20mm , Paint damage
1 FRACTURE Rear bumper (1)	Length: ≥50mm & <100mm, Width: <5mm
1 REPAINT Tailgate (1)	Thickness: ≥125µm & <250µm , Professional repaint
10-14 Front bumper (6-10) Rear left door (3) Right side skirts (1)	Length: ≥100mm , Deep scratch - down to primer
1 SCRATCH Front right door (1)	Length: ≥100mm , Surface scratch
5 SCRATCHES Hood (4) Front left door (1)	Length: ≥50mm & <100mm , Deep scratch - down to primer
12-20 Secondary wheel third rim (6-10) Secondary wheel fourth rim (6-10)	Length: ≥25mm , Deep scratch
8 SCRATCHES Rear bumper (5) Rear right fender (1) Front right door (2)	Length: ≥20mm & <50mm , Deep scratch - down to primer
5 SCRATCHES Left mirror glass (5)	Length: ≥20mm & <50mm , Deep scratch
3 SCRATCHES Rear left fender (3)	Length: <20mm , Deep scratch - down to primer
6-10 Hood (6-10)	Width: ≤3mm , Paint damage
3 DIRTY Driver seat (1) Other seats (1) Passenger seat (1)	
3 SCRATCHES Steering Wheel (1) Load compartment cover (1) Load compartment cover (1)	Length: ≥100mm
2 SCRATCHES	Length: ≥50mm & <100mm

Front door interior left (1) Front door interior right (1)

CAR EQUIPMENT

Some content has been automatically translated.

 Heated seats	Front seat heating
 Park Distance Control	Park-Distance-Control (PDC) front and rear
 Power steering	Power steering Servotronic
 Hands-free system	Bluetooth hands-free system with USB audio interface
 Sport seats	Sports seats in front
 Navigation System	Business audio and navigation system
 Airbag	Disconnectable passenger airbag Driver side airbag / passenger side airbag Rear Cranial Airbag System Front head airbag system Side airbag rear Front side airbag
 AC System	Automatic dual-zone air conditioning with automatic air circulation control
 DPF / FAP	Particulate filter
 ESP	Dynamic Stability Control (DSC)
 Immobilizer	Immobilizer
 On-board computer	External temperature indicator On-board computer
 Entertainment system	BMW Professional audio system (Radio/CD player MP3 compatible) Instrument cluster (extended scope)
 ABS	Anti-lock Braking System (ABS)

CAR SERVICE DETAILS

Service book details:	Digital service book
Service appointment:	Some
Last service on:	04/12/2019
Last service Mileage:	94,248 km
Drive belt change on:	-
Drive belt change Mileage:	-

Car service images 1 image



CAR DATA ACCORDING TO IDENTIFICATION NUMBER (VIN)

Some content has been automatically translated.

- ☒ Color monitor (6.5 """)
- ☒ AUX-IN connection (AUX-IN)
- ☒ Storage package
- ☒ Ambient lighting
- ☒ Chrome exhaust tip, black
- ☒ Check Control System
- ☒ Dynamic brake lights
- ☒ Entry sills with aluminum insert
- ☒ Remote unlocking tailgate
- ☒ Velour floor mats

