

Thank you for ordering from us!
www.checkvin.eu

Vehicle

BMW 320D XDR A, 140KW

WBA8J11040K851319



Development code F31
Colour alpinweiss 3
Actual integration level F020-22-07-530
Start of warranty 16 March 2017

Delivery stop



Technical Campaigns are available.

Technical campaigns

Status	Campaign number	Description	Reservation
Open	10032620300	Replacing driver's airbag part III (SDI)  Delivery stop Local campaign number: -	

Warranty extension/VIN-based goodwill

Status	Campaign number	Description
Open	1SACC011056	Exhaust gas recirculation cooler Bx7 Local campaign number: -

Special information

There are no Campaigns for this vehicle.

Restrictions on the warranty

There are no restrictions on the warranty.

⚠ Market-specific restrictions are not currently displayed. Please check this in WDF/WXE via S-Gate.

Live Diagnosis

 There are no service solutions for Live Diagnosis.

Service contracts

No BSI contracts

Information on faults workshop/Service Consultation

There is no information on faults.

Navigation map

Note: The installed map cannot be clearly identified. Presumably one of the following maps is present in the vehicle.

Installed map	Enabling code (subscription)	Latest navigation map included in subscription	Latest navigation map subject to charge
Road Map EUROPE EVO 2020-2 (As of: 3 Jun 2024)	-	-	-
Road Map EUROPE EVO 2020-2 (As of: 3 Jun 2024)	Enabling code valid for navigation maps with release date up to 31 Dec 2099 (SWID: 01200FFF).	Road Map EUROPE EVO 2025-1	-

Vehicle details

Vehicle type	Passenger car
Brand	BMW
Model	320D XDR A
Body	TOUR
Vehicle identification number (last 7 digits)	K851319
Vehicle identification number (17 digits)	WBA8J11040K851319
Development code	F31
Steering	LL
Engine	B47O
Engine number	62449903
Exhaust re-treatment	EURO6, W, PI/CI, M, N1 I
Transmission	AUT
Transmission number	0146222WDR
Head unit serial number	HB2241H8117571
Drive	ALLR
Integration level, works	F020-16-11-502
Production date	20 Feb 2017
Production plant	Muenchen
Delivery date	20 Feb 2017
Delivering retailer	Procar Automobile, Köln, DE
National-market version	EUR
Paint code	300
Upholstery code	CCL1

Model code	8J21
Basic type	8J11
Lead type	8J21

Optional equipment

Optional equipment ex works:

01CA Selection of COP-relevant vehicles
0205 Automatic transmission
0230 Extra package, EU-speciifc
0258 Tyres with runflat properties
02A6 BMW LA wheel, double spoke 392
02VB Tyre pressure display
02VL Variable sport steering
0302 Alarm system
0322 Comfort access system
03AA Roof railing black
03AC Trailer coupling
0420 Sun protection glazing
0423 Floor mats velours
0428 Warning triangle and first aid kit
0430 Interior/outside mirror with auto dip
0431 Interior mirror with automatic-dip
0481 Sports seat
0488 Lumbar support, driver and passenger
0493 Storage compartment package
0494 Seat heating driver/passenger
04AE Armrest front, retractable
04LU black high-gloss accent chrm. Perlglanz
0508 Park Distance Control (PDC)
0521 Rain sensor
0534 Automatic air conditioning
0548 Kilometre speedo
0563 Light package
0575 Additional 12V sockets
05A1 LED Fog lights
05A2 LED headlight
05DA Passenger airbag deactivation
05DC Rear-seat headrests, folding
05DF Active cruise control+stop&go function
0609 Navigation system Professional
0654 DAB tuner
0676 HiFi speaker system
0698 Area-Code 2 for DVD
06AC Intelligent emergency call
06AE Teleservices
06AK Connected Drive Services
06AM Real-Time Traffic Information
06AN Concierge Services
06AP Remote Services
06NW Telephony with wireless charging
06WA Instrument panel with extended scope
06WD WLAN Hotspot
0710 M Leather steering wheel
07AC Sport Line
07LD Modell Sport Line
0801 German version
0851 Language version German
0879 On-board literature, German
08KA Oil service interval 24 mths / 30,000 km
08R9 Refrigerant R1234yf
09BM Navigation package Connected Drive
A090 90 Ah AGM battery
POLS Cloth cushion

Retrofitted optional equipment:

This vehicle has no retrofits.

Vehicle histories

	Date	Type	Vehicle mileage			Retailer	Overview
—	03/06/2024	Key	221239 Km			05741	Key 0
							
	21000	21000	21000	21000	46000	45000	21000
	12/2025	12/2025	12/2025	12/2025		02/2026	12/2025
—	03/06/2024	Repair	221239 Km			05741 , Wavre	Job Job Job

— Job

Description:

Considered as a repeat visit No

Customer's own words

Replace exhaust gas recirculation cooler, including exhaust gas recirculation valve Flat rate unit I 00 74 062	25 FRU
Exhaust gas radiator high temperature Part I 11 71 7 822 347	1
Gasket Steel Part I 11 61 8 571 005	1
Gasket Steel Part I 11 62 8 576 287	1
Connection piece Part I 11 65 7 803 012	1
Pipe union Part I 11 71 7 799 853	2
Acoustic cover front Part I 11 14 8 490 577	1
Vacuum hose Part I 11 65 8 595 650	1
Isa screw with bush Part I 07 14 9 886 429	3
Torx bolt Part I 11 71 2 249 909	2
Location véhicule Part I LOC	Local 1

— Job

Description:

Considered as a repeat visit No

Customer's own words

— Job

Description:

Considered as a repeat visit No

Customer's own words

— 03/06/2024 Warranty 221239 Km 05741 Job: F1x F2x F3x G0x G1x G3x B47O B47K B47U B47T Replacing EGR cooler (high-temperature)

— Job: F1x F2x F3x G0x G1x G3x B47O B47K B47U B47T Replacing EGR cooler (high-temperature)

Description: F1x F2x F3x G0x G1x G3x B47O B47K B47U B47T Replacing EGR cooler (high-temperature)

Considered as a repeat visit No

Customer's own words

Replace exhaust gas recirculation cooler, including exhaust gas recirculation valve Flat rate unit I 00 74 062	25 FRU
F1x F2x F3x G0x G1x G3x B47O B47K B47U B47T Replacing EGR cooler (high-temperature) Defect I 00 11 15 07 00	
Exhaust gas radiator high temperature Part I 11 71 7 822 347	1
Gasket Steel Part I 11 61 8 571 005	1
Gasket Steel Part I 11 62 8 576 287	1
Connection piece Part I 11 65 7 803 012	1
Pipe union Part I 11 71 7 799 853	2
Acoustic cover front Part I 11 14 8 490 577	1
Vacuum hose black Part I 11 65 8 595 650	1
Isa screw with bush Part I 07 14 9 886 429	3
Torx bolt Part I 11 71 2 249 909	2

— 10/11/2023 Key 207393 Km 05741 Key 0





















































— 06/02/2023 Key 191326 Km Key 0





















— 27/12/2022 Key 186649 Km Key 0



—	27/12/2022	Key	186648 Km					Key 0	
									
	22000 10/2024		22000 10/2024		-10 0 % 02/2024	10000	60000 10/2026		
—	27/12/2022	Service	186648 Km					05741 Louyet Wavre , Wavre	Automatic
									
	22000		22000		-10 ✓	10000	60000		
—	14/12/2022	Key	185572 Km					05741	Remote KeyRead
									
	23000 10/2024		23000 10/2024		600 02/2024	10000	60000 10/2026		
—	07/10/2022	Key	177401 Km					05741	Key 0
									
	-3100 10 % 08/2023	-3100 08/2023	-3100 08/2023		-3100 08/2023	49000 02/2024	38000	-3100 5 % 08/2023	
—	07/10/2022	Service	177401 Km					05741 Louyet Wavre , Wavre	Automatic
									
	-3100 07/2023 ✓	-3100 07/2023 ✓	-3100 07/2023 ✓		-3100 07/2023 ✓	49000 01/2024	38000	-3100 07/2023 ✓	
—	28/02/2022	Key	153987 Km					05655	Key 0
									
	18000 08/2023	18000 513	18000 513		18000 513	60000 693	44000	18000 08/2023	
—	21/02/2022	Key	153493 Km					05655	Key 0
									
	18000 08/2023	18000 520	18000 520		18000 520	60000 03/2022	44000	18000 08/2023	
—	21/02/2022	Service	153493 Km					05655 Louyet Sint-Pieters- Leeuw , St. Pieters Leeuw	Automatic
									
	18000 07/2023	18000 07/2023	18000 07/2023		18000 07/2023	60000 03/2022 ✓	44000	18000 07/2023	

—	14/02/2022	Key	153204 Km	05655	Key 0				
									
19000	19000	19000	19000	60000		44000	19000		
08/2023	527	527	527		03/2022		08/2023		03/2022
—	12/10/2021	Key	148309 Km		Key 0				
									
26000	26000	26000	26000	60000		49000	26000		
08/2023	649	649	649		03/2022		08/2023		03/2022
—	17/08/2021	Key	144739 Km		Key 0				
									
29000	29000	29000	29000	70000		60000	29000		
08/2023	704	704	704		03/2022		08/2023		03/2022
—	13/08/2021	Key	143320 Km		Key 0				
									
2900		2900		70000		70000	34000		
03/2022		198			03/2022		918		03/2022
—	13/08/2021	Service	143320 Km	05655 Louyet Sint-Pieters-Leeuw , St. Pieters Leeuw	Automatic				
									
2900		2900		70000		70000	34000		
02/2022	✓	02/2022			02/2022		02/2024		02/2022
—	09/08/2021	Key	143257 Km		Key 0				
									
2900		2900		70000		70000	34000		
03/2022		202			03/2022		922		03/2022
—	04/09/2020	Key	120318 Km	05655	Key 0				
									
27000		27000		60000		70000	60000		
03/2022		537			03/2022		1257		03/2022
—	01/09/2020	Key	120214 Km		Key 0				
									
27000		27000		60000		70000	60000		
03/2022		540			03/2022		1260		03/2022
—	19/08/2020	Key	119723 Km	05655	Key 0				

 28000 03/2022	 28000 553	 28000 553	 60000 03/2022	 60000 03/2022	 70000 03/2022	 60000 1273	 60000 1273	 03/2022
—	12/08/2020	Key	119354 Km	05655	Key 1			
 29000 03/2022	 29000 559	 29000 559	 60000 03/2022	 60000 03/2022	 70000 03/2022	 60000 1279	 60000 1279	 03/2022
—	28/07/2020	Key	118493 Km	26636	Key 0			
 30000 03/2022	 0 611	 30000 611	 0 60000 03/2022	 0 60000 03/2022	 70000 03/2022	 60000 1342	 60000 1342	 0 03/2022
—	28/04/2020	Warranty	118490 Km	26636	Job: Seal between mounting bracket and engine oil pan Job: Rear final drive housing			

— Job: Seal between mounting bracket and engine oil pan

Description: Seal between mounting bracket and engine oil pan

Considered as a repeat visit No

Customer's own words

Replacing right O-ring for front final drive Flat rate unit 31 51 560	43 FRU
--	--------

Seal between mounting bracket and engine oil pan Defect 31 50 11 48 00	
---	--

Shaft seal with lock ring Part 31 50 8 743 675	1
---	---

O-ring Part 31 51 1 213 527	2
----------------------------------	---

Torx screw Part 31 10 6 793 894	2
--------------------------------------	---

Torx screw Part 31 10 6 793 893	2
--------------------------------------	---

Hexagon screw with flange Part 07 11 9 907 452	2
---	---

Screw plug with O-ring Part 33 11 7 525 064	2
--	---

— Job: Rear final drive housing

Description: Rear final drive housing

Considered as a repeat visit No

Customer's own words

Performing vehicle test Flat rate unit 00 00 006	4 FRU
---	-------

Replacing the radial shaft seal for the output shaft on the left or right rear axle differential Flat rate unit 33 10 523	20 FRU
--	--------

1

— Job

Description:

Considered as a repeat visit No

Customer's own words

Service - standard scope	2 FRU
Flat rate unit I 00 00 105	

— Job

Description:

Considered as a repeat visit No

Customer's own words

Microfilter service	2 FRU
Flat rate unit I 00 00 616	

Microfilter/activated Carbon container	1
Part I 64 11 9 237 555	

— Job

Description:

Considered as a repeat visit No

Customer's own words O-Ton Mechaniker;Luftdruck leicht abgesenkt normaler Verlust korrigiert,,

Service, vehicle check	6 FRU
Flat rate unit I 00 00 624	

— Job

Description:

Considered as a repeat visit No

Customer's own words

Service - air filter element	2 FRU
Flat rate unit I 00 00 602	

Air filter element	1
Part I 13 71 8 511 668	

— Job

Description:

Considered as a repeat visit No

Customer's own words

Überprüfung nach § 29 STVZO	Local	1
Part I 0012159		

— Job

Description:

Considered as a repeat visit No

Customer's own words

Service fuel filter	3 FRU
Flat rate unit I 00 00 604	

Fuel filter cartridge	1
Part I 13 32 8 572 522	

— Job

Description:

Considered as a repeat visit No

Customer's own words Bitte Fotos anfertigen und Maße notieren.,

Service, rear brakes	7 FRU
Flat rate unit I 00 00 614	

Repair kit, brake pads asbestos-free	1
Part I 34 21 6 873 093	

Brake-pad sensor, rear	1
Part I 34 35 6 792 292	

— Job

Description:

Considered as a repeat visit No

Customer's own words

Brake fluid service	4 FRU
Flat rate unit I 00 00 618	

Brake fluid DOT4 LV, low viscosity	1
Part I 83 13 2 184 843	

— Job

Description:

Considered as a repeat visit No

Customer's own words

Engine oil service	3 FRU
Flat rate unit I 00 00 610	

Set oil-filter element	1
Part I 11 42 8 575 211	

BMW Engine Oil LL04 0W30	5
Part I 83 21 2 405 950	

— Job

Description:

Considered as a repeat visit No

Customer's own words

Fotoservice Bremse hinten	Local	2 FRU
Flat rate unit I AZ41 00 0		

— Job

Description:

Considered as a repeat visit No

Customer's own words

— Job

Description:

Considered as a repeat visit No

Customer's own words

Fahrzeugüberprüfung im Rahmen der Annahm
Flat rate unit I 00 52 054

Local

0 FRU

— Job

Description:

Considered as a repeat visit No

Customer's own words

kostenlose Fahrzeugoberwäsche
Part I 0011319

Local

1

— Job

Description:

Considered as a repeat visit No

Customer's own words

Ersatzfahrzeug (24 Stunden) Mietzeitraum
Part I 0000160

Local

1

— Job

Description:

Considered as a repeat visit No

Customer's own words

— Job

Description:

Considered as a repeat visit No

Customer's own words

Motorölservice - zusätzliche AW
Flat rate unit I IM00 25 0

Local

2 FRU

Zusatz zum Fahrzeugcheck / Inspektion
Flat rate unit I AZ10 00 1

Local

2 FRU

— Job

Description:

Considered as a repeat visit No

Customer's own words

— 06/03/2020 Warranty

117812 Km

02832

Job: Engine oil service
Job: Service - vehicle check
Job: Service - standard scope
Job: Service - air cleaner
Job: Service - fuel filter
Job: Service - brake fluid
Job: Service - rear brakes
Job: Service - micro filter/activated
carbon filter
Job: Service - legally required
vehicle inspection/exhaust emission
inspection

— Job: Engine oil service

Description: Engine oil service

Considered as a repeat visit No

Customer's own words

Engine oil service Flat rate unit I 00 00 610	3 FRU
Engine oil service Defect I 87 00 02 00 00	
Set oil-filter element Part I 11 42 8 575 211	1
— Job: Service - vehicle check	
Description: Service - vehicle check	
Considered as a repeat visit No	
Customer's own words	
Service, vehicle check Flat rate unit I 00 00 624	6 FRU
Service - vehicle check Defect I 87 00 05 00 00	
— Job: Service - standard scope	
Description: Service - standard scope	
Considered as a repeat visit No	
Customer's own words	
Service - standard scope Flat rate unit I 00 00 105	2 FRU
Service - standard scope Defect I 87 00 06 00 00	
— Job: Service - air cleaner	
Description: Service - air cleaner	
Considered as a repeat visit No	
Customer's own words	
Service - air filter element Flat rate unit I 00 00 602	2 FRU
Service - air cleaner Defect I 87 13 01 00 00	
Air filter element Part I 13 71 8 511 668	1
— Job: Service - fuel filter	
Description: Service - fuel filter	
Considered as a repeat visit No	
Customer's own words	
Service fuel filter Flat rate unit I 00 00 604	3 FRU
Service - fuel filter Defect I 87 13 02 00 00	
Fuel filter cartridge Part I 13 32 8 572 522	1
— Job: Service - brake fluid	
Description: Service - brake fluid	

Considered as a repeat visit No

Customer's own words

Brake fluid service 4 FRU
Flat rate unit I 00 00 618

Service - brake fluid
Defect I 87 34 00 00 00

— Job: Service - rear brakes

Description: Service - rear brakes

Considered as a repeat visit No

Customer's own words

Service, rear brakes 7 FRU
Flat rate unit I 00 00 614

Service - rear brakes
Defect I 87 34 21 01 00

Repair kit, brake pads asbestos-free 1
Part I 34 21 6 873 093

Brake-pad sensor, rear 1
Part I 34 35 6 792 292

— Job: Service - micro filter/activated carbon filter

Description: Service - micro filter/activated carbon filter

Considered as a repeat visit No

Customer's own words

Microfilter service 2 FRU
Flat rate unit I 00 00 616

Service - micro filter/activated carbon filter
Defect I 87 64 01 00 00

Microfilter/activated Carbon container 1
Part I 64 11 9 237 555

— Job: Service - legally required vehicle inspection/exhaust emission inspection

Description: Service - legally required vehicle inspection/exhaust emission inspection

Considered as a repeat visit No

Customer's own words










Service - legally required vehicle inspection/exhaust emission inspection
Defect I 87 99 01 00 00

— 18/12/2019 Key

112464 Km

02832

Key 0

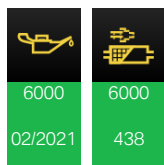

— 18/12/2019 Repair

112471 Km

02832
Niederlassung
Dortmund
BMW AG,
Dortmund

Job
Job
Job

— Job

Description:**Considered as a repeat visit** No

Customer's own words Motorstör Lampe leuchtet zeitweise auf Fzg. stottert Kein Antrieb, weiterfahrt möglich. TA AGR Kühler wurde letzte Woche bei BMW Kaltenbach, in Remscheid durchgeführt. Problem ist kurz danach, aufgetreten
 .O-TON. bitte prüfen dann RS., BEFUND:; Beanstandung konnte nachvollzogen werden Motor stottert zeitweise und, hat keine Leistung., Im FS sind diverse Einträge vom AGR-Ventil vorhanden (zu weit offen, klemmt
 ..), Beim vergleichen der SOLL / IST Daten des AGR-Ventils konnte, festgestellt werden dass das Ventil zeitweise klemmt (bei 50%) und auch, nicht weiter wie die 50% öffnet., lt. Testmodul muss das AGR-Ven
 til ern. werden., nach der Rep. wurden nochmals die SOLL / IST Daten verglichen -> ohne, Befund / i.O., Fz. bitte neu bewerten, Steck- u. Schlauchverbindungen geprüft i.O., - AGR-Kühler auf undichtigkeiten
 geprüft, - Testmodule abgearbeitet, - SOLL / IST Daten verglichen (AGR-Ventil), - anschließend wurden nochmals die SOLL / IST werte des AGR- Ventils, verglichen,

Performing vehicle test	4 FRU
Flat rate unit I 00 00 006	

Job time without allowance for / engine electrics	10 FRU
Flat rate unit I 12 99 000	

Replace EGR electrovalve	9 FRU
Flat rate unit I 11 74 555	

Ersatzfahrzeug (24 Stunden) Mietzeitraum	Local	1
Part I 0000160		

EGR-valve	1
Part I 11 71 9 886 715	

Gasket Steel	1
Part I 11 71 8 579 364	

Hose clamp	2
Part I 16 12 1 176 918	

Anti-freeze	2
Part I 83 19 2 211 358	

— Job

Description:**Considered as a repeat visit** No**Customer's own words**

— Job

Description:**Considered as a repeat visit** No**Customer's own words**

Serviceberatung am Fahrzeug Nach Diagnos	Local	1
Part I 52050		

— Job

Description:**Considered as a repeat visit** No**Customer's own words**

kostenlose Fahrzeugoberwäsche	Local	1
Part I 0011319		

— 18/12/2019 Warranty 112471 Km 02832 Job: Exhaust gas recirculation valve (EGR)

— Job: Exhaust gas recirculation valve (EGR)

Description: Exhaust gas recirculation valve (EGR)

Considered as a repeat visit No

Customer's own words

Performing vehicle test Flat rate unit 00 00 006	4 FRU
Job time without allowance for / engine electrics Flat rate unit 12 99 000	10 FRU
Replace EGR electrovalve Flat rate unit 11 74 555	9 FRU
Exhaust gas recirculation valve (EGR) Defect 11 71 01 83 00	
EGR-valve Part 11 71 9 886 715	1
Gasket Steel Part 11 71 8 579 364	1
Hose clamp Part 16 12 1 176 918	2

— 10/12/2019 Warranty 112163 Km 23309 Job: F1x F2x F3x F4x G0x G1x G3x B47 Check and if required replace exhaust-gas recirculation cooler

— Job: F1x F2x F3x F4x G0x G1x G3x B47 Check and if required replace exhaust-gas recirculation cooler

Description: F1x F2x F3x F4x G0x G1x G3x B47 Check and if required replace exhaust-gas recirculation cooler

Considered as a repeat visit No

Customer's own words

Check label/ replace exhaust-gas recirculation cooler and remount exhaust-gas recirculation valve; clean exhaust-gas recirculation pipe Flat rate unit 00 68 741	29 FRU
Performing additional work for pressure sensor function Flat rate unit 00 68 742	3 FRU
F1x F2x F3x F4x G0x G1x G3x B47 Check and if required replace exhaust-gas recirculation cooler Defect 00 11 40 05 00	
exhaust cooler Part 11 71 8 596 444	1
Set of small parts Part 11 71 8 597 652	1
Pipe union Part 11 71 7 799 853	2
O-ring Part 11 61 8 512 681	1
Hex Bolt with washer Part 07 11 9 905 750	1
Oval head screw Part 35 21 7 685 343	2

— 10/12/2019 Warranty 112163 Km 23309 Job: Service - standard scope
Job: Service - front brakes

— Job: Service - standard scope

Description: Service - standard scope

Considered as a repeat visit No

Customer's own words

Service - standard scope Flat rate unit I 00 00 105	2 FRU
--	-------

Service - standard scope Defect I 87 00 06 00 00

— Job: Service - front brakes

Description: Service - front brakes

Considered as a repeat visit No

Customer's own words

Service, front brakes Flat rate unit I 00 00 612	6 FRU
---	-------

Removing and installing or replacing both front brake discs Flat rate unit I 34 11 613	3 FRU
---	-------

Service - front brakes Defect I 87 34 11 01 00

Brake disc, ventilated Part I 34 11 6 792 219	2
--	---


Inner hex bolt Part I 34 21 1 161 806	2
--	---

Torx screw with washer Part I 34 10 6 864 424	4
--	---

Repair kit, brake pads asbestos-free Part I 34 10 6 859 181	1
--	---


Brake pad wear sensor, front left Part I 34 35 6 792 289	1
---	---

— 09/12/2019 Key 112095 Km 23309 Key 0

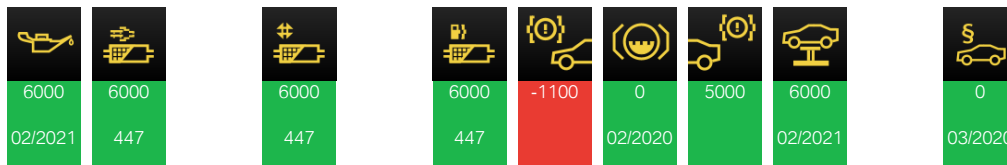

— 09/12/2019 Service 112095 Km 23309 Automatic

Autohaus
Kaltenbach
GmbH&Co. KG
, Remscheid

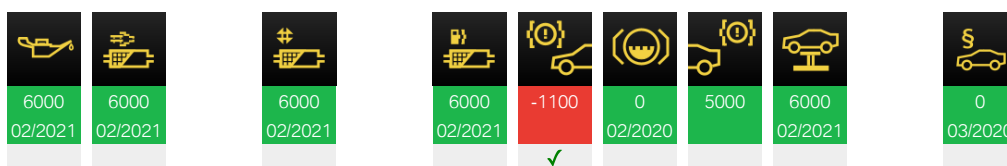

— 09/12/2019 Repair 112095 Km 23309 Job
Autohaus Job: Service - standard scope
Kaltenbach Job: Service, front brakes

— Job

Description:

Considered as a repeat visit No

Customer's own words

APAS TC-1-0011400500 Flat rate unit -	Local	15 FRU
!!! unknown BMW-Id ESTIMATE F1x F2x F3x F4x G0x G1x G3x B47 AGR-Kühler prüfen ggf. ersetzen !!! Flat rate unit -	Local	0 FRU

— Job: Service - standard scope

Description:

Considered as a repeat visit No

Customer's own words

Service - standard scope Package 0000105		
Service - standard scope Flat rate unit 00 00 105		2

— Job: Service, front brakes

Description:

Considered as a repeat visit No

Customer's own words

Service, front brakes Package 0000612		
Service, front brakes Flat rate unit 00 00 612		6
Repair kit, brake pads asbestos-free Part 34106859181		1
Brake pad wear sensor, front left Part 34356792289		1
Brake-pad paste Part 83192158851		2
Brake cleaner acetone-free Part 83192413695		1

— Job

Description:

Considered as a repeat visit No

Customer's own words

!!! unknown BMW-Id ESTIMATE !!! Flat rate unit -	Local	0 FRU
!!! unknown BMW-Id ESTIMATE !!! Flat rate unit -	Local	0 FRU

— Job

Description:

Considered as a repeat visit No

Customer's own words

!!! unknown BMW-Id ESTIMATE Bremsbelag 3.0 vorne links !!! Flat rate unit I -	Local	0 FRU
--	-------	-------

!!! unknown BMW-Id ESTIMATE Bremsbelag 3.0 vorne rechts !!! Flat rate unit I -	Local	0 FRU
---	-------	-------

—	09/12/2019	Repair	112163 Km	23309 Autohaus Kaltenbach GmbH & Co. KG, Remscheid	Job Job
---	------------	--------	-----------	---	------------

— Job

Description:

Considered as a repeat visit No

Customer's own words

Service - standard scope Flat rate unit I 00 00 105	2 FRU
--	-------

— Job

Description:

Considered as a repeat visit No

Customer's own words

Service, front brakes Flat rate unit I 00 00 612	6 FRU
---	-------

Removing and installing or replacing both front brake discs Flat rate unit I 34 11 613	3 FRU
---	-------

Brake disc, ventilated Part I 34 11 6 792 219	2
--	---


Inner hex bolt Part I 34 21 1 161 806	2
--	---

Torx screw with washer Part I 34 10 6 864 424	4
--	---

Repair kit, brake pads asbestos-free Part I 34 10 6 859 181	1
--	---

Brake pad wear sensor, front left Part I 34 35 6 792 289	1
---	---

—	11/02/2019	Key	90378 Km	01818	Key 0
---	------------	-----	----------	-------	-------

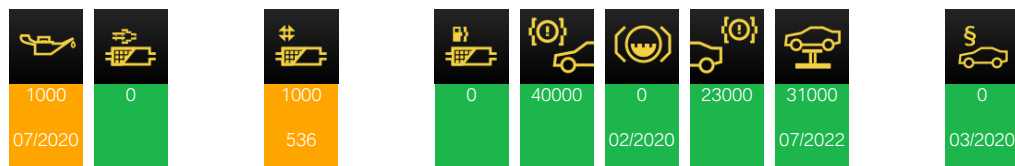

—	11/02/2019	Service	90378 Km	01818 Autohaus Kruft GmbH, Oberhausen	Automatic
---	------------	---------	----------	--	-----------

 1000 07/2020 ✓	 0	 1000 07/2020 ✓	 0	 40000	 0 02/2020	 23000	 31000 07/2022	 0 03/2020
--	---	--	---	---	--	---	---	--

— 11/02/2019 Repair 90378 Km 01818 Job
Autohaus Kruft
GmbH,
Oberhausen Job
Job
Job

— Job

Description:

Considered as a repeat visit No

Customer's own words

Package I MM019999100

Local

— Job

Description:

Considered as a repeat visit No

Customer's own words

Package I 0000610

!!! unknown BMW-Id FT83210398509 Motoröl SAE 5W30
Longlife-04 !!!
Part I FT83210398509

Local

5

Set oil-filter element
Part I 11428575211

1

— Job

Description:

Considered as a repeat visit No

Customer's own words

Package I 0000105

— Job

Description:

Considered as a repeat visit No

Customer's own words

Package I 0000616

!!! unknown BMW-Id FT64119237555 Mikrofilter !!!
Part I FT64119237555

Local

1

— Job

Description:

Considered as a repeat visit No

Customer's own words

Package I MM010099470

Local

— 11/02/2019 Repair 90378 Km 01818 Job
Autohaus Kruft

— Job

Description:**Considered as a repeat visit** No**Customer's own words**

Engine oil service Flat rate unit I 00 00 610	3 FRU
--	-------

Service - standard scope Flat rate unit I 00 00 105	2 FRU
--	-------

Microfilter service Flat rate unit I 00 00 616	2 FRU
---	-------

Motoröl SAE 5W30 Longlife-04 Part I FT83 21 0 398 5	Local	5
--	-------	---

Set oil-filter element Part I 11 42 8 575 211	1
--	---

Microfilter/activated Carbon container Part I 64 11 9 237 555	1
--	---

—	11/02/2019	Warranty	90378 Km	01818	Job: Engine oil service Job: Service - standard scope Job: Service - micro filter/activated carbon filter
---	------------	----------	----------	-------	---

— Job: Engine oil service

Description: Engine oil service**Considered as a repeat visit** No**Customer's own words**

Engine oil service Flat rate unit I 00 00 610	3 FRU
--	-------

Engine oil service Defect I 87 00 02 00 00

Set oil-filter element Part I 11 42 8 575 211	1
--	---

— Job: Service - standard scope

Description: Service - standard scope**Considered as a repeat visit** No**Customer's own words**

Service - standard scope Flat rate unit I 00 00 105	2 FRU
--	-------

Service - standard scope Defect I 87 00 06 00 00

— Job: Service - micro filter/activated carbon filter

Description: Service - micro filter/activated carbon filter**Considered as a repeat visit** No**Customer's own words**

Microfilter service
Flat rate unit | 00 00 616

2 FRU

Service - micro filter/activated carbon filter
Defect | 87 64 01 00 00


Microfilter/activated Carbon container
Part | 64 11 9 237 555

1

— 31/01/2019 Key

88931 Km


Key 0

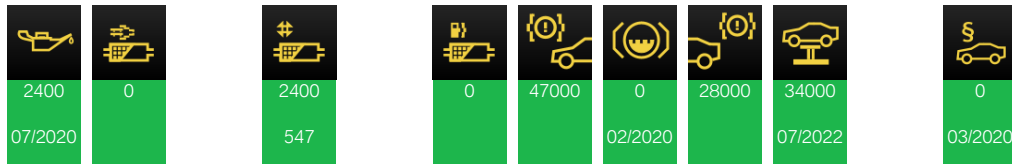

— 23/01/2019 Key

88291 Km

Key 0

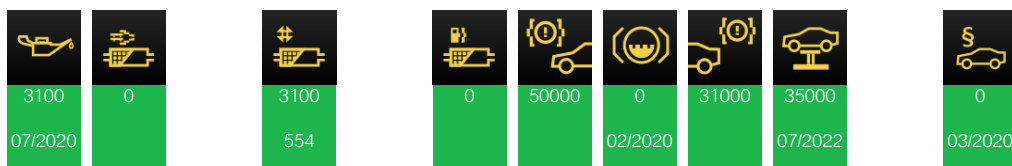


— 02/07/2018 Service

60358 Km

32913
Overdreef
GmbH ,
Duisburg

Automatic

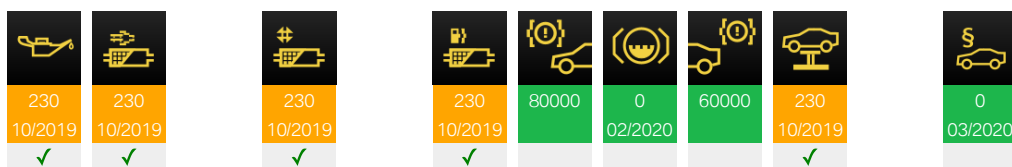

— 02/07/2018 Repair

60358 Km

32913
Overdreef
GmbH ,
Duisburg

Job
Job
Job
Job
Job
Job
Job
Job
Job
Job

— Job

Description:

Considered as a repeat visit No

Customer's own words

Vehicle surface wash
Flat rate unit | 00 11 319

0 FRU

— Job

Description:

Considered as a repeat visit No

Customer's own words

— Job

Description:

Considered as a repeat visit No

Customer's own words

— Job

Description:

Considered as a repeat visit No

Customer's own words

— Job

Description:

Considered as a repeat visit No

Customer's own words

— Job

Description:

Considered as a repeat visit No

Customer's own words

— Job

Description:

Considered as a repeat visit No

Customer's own words

— Job

Description:

Considered as a repeat visit No

Customer's own words

— Job

Description:

Considered as a repeat visit No

Customer's own words

— Job

Description:

Considered as a repeat visit No

Customer's own words

—	02/07/2018	Repair	60360 Km	32913	Job
				Overdreef	Job
				GmbH ,	Job
				Duisburg	Job
					Job
					Job
					Job
					Job

— Job

Description:

Considered as a repeat visit No

Customer's own words

Flat rate unit I 00 00 105

— Job

Description:

Considered as a repeat visit No

Customer's own words

Microfilter service	2 FRU
Flat rate unit I 00 00 616	

Microfilter/activated Carbon container	1
Part I 64 11 9 237 555	

— Job

Description:

Considered as a repeat visit No

Customer's own words

Service, vehicle check	6 FRU
Flat rate unit I 00 00 624	

— Job

Description:

Considered as a repeat visit No

Customer's own words

Service - air filter element	2 FRU
Flat rate unit I 00 00 602	

Air filter element	1
Part I 13 71 8 511 668	

— Job

Description:

Considered as a repeat visit No

Customer's own words

Service fuel filter	3 FRU
Flat rate unit I 00 00 604	

Fuel filter cartridge	1
Part I 13 32 8 572 522	

— Job

Description:

Considered as a repeat visit No

Customer's own words

Engine oil service	3 FRU
Flat rate unit I 00 00 610	

MOTORÖEL	Local	5
Part I FT99 21 0 398 5		

Set oil-filter element	1
Part I 11 42 8 575 211	

— Job

Description:

Considered as a repeat visit No

Customer's own words

Replace left and right wiper blade Flat rate unit I 61 61 541	1 FRU
--	-------

Set of wiper blades Part I 61 61 2 241 375	1
---	---

— Job

Description:

Considered as a repeat visit No

Customer's own words

Replacing the wiper blade for the rear wiper Flat rate unit I 61 62 520	1 FRU
--	-------

Wiper blade Part I 61 62 7 356 763	1
---------------------------------------	---

—	02/07/2018	Warranty	60360 Km	32913	Job: Service - standard scope Job: Service - micro filter/activated carbon filter Job: Service - vehicle check Job: Service - air cleaner Job: Service - fuel filter Job: Engine oil service Job: Service - front wiper blade Job: Service - rear wiper blade
---	------------	----------	----------	-------	--

— Job: Service - standard scope

Description: Service - standard scope

Considered as a repeat visit No

Customer's own words

Service - standard scope Flat rate unit I 00 00 105	2 FRU
--	-------

Service - standard scope Defect I 87 00 06 00 00

— Job: Service - micro filter/activated carbon filter

Description: Service - micro filter/activated carbon filter

Considered as a repeat visit No

Customer's own words

Microfilter service Flat rate unit I 00 00 616	2 FRU
---	-------

Service - micro filter/activated carbon filter Defect I 87 64 01 00 00

Microfilter/activated Carbon container Part I 64 11 9 237 555	1
--	---

— Job: Service - vehicle check

Description: Service - vehicle check

Considered as a repeat visit No

Customer's own words

Service, vehicle check Flat rate unit I 00 00 624	6 FRU
--	-------

Service - vehicle check
Defect I 87 00 05 00 00

— Job: Service - air cleaner

Description: Service - air cleaner

Considered as a repeat visit No

Customer's own words

Service - air filter element Flat rate unit I 00 00 602	2 FRU
--	-------

Service - air cleaner
Defect I 87 13 01 00 00

Air filter element Part I 13 71 8 511 668	1
--	---

— Job: Service - fuel filter

Description: Service - fuel filter

Considered as a repeat visit No

Customer's own words

Service fuel filter Flat rate unit I 00 00 604	3 FRU
---	-------

Service - fuel filter
Defect I 87 13 02 00 00

Fuel filter cartridge Part I 13 32 8 572 522	1
---	---

— Job: Engine oil service

Description: Engine oil service

Considered as a repeat visit No

Customer's own words

Engine oil service Flat rate unit I 00 00 610	3 FRU
--	-------

Engine oil service
Defect I 87 00 02 00 00

Set oil-filter element Part I 11 42 8 575 211	1
--	---

— Job: Service - front wiper blade

Description: Service - front wiper blade

Considered as a repeat visit No

Customer's own words

Replace left and right wiper blade Flat rate unit I 61 61 541	1 FRU
--	-------

Service - front wiper blade
Defect I 87 61 61 00 00

Set of wiper blades Part I 61 61 2 241 375	1
---	---

— Job: Service - rear wiper blade

Description: Service - rear wiper blade

Considered as a repeat visit No

Customer's own words

Replacing the wiper blade for the rear wiper
Flat rate unit I 61 62 520

1 FRU

Service - rear wiper blade
Defect I 87 61 62 00 00

Wiper blade
Part I 61 62 7 356 763






1

— 10/10/2017 Key

29628 Km

32913

Key 0

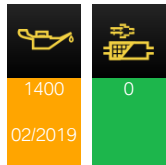


— 10/10/2017 Service

29628 Km

32913

Manual

Overdreef
GmbH,
Duisburg

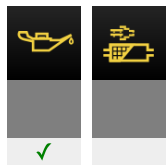

— 10/10/2017 Repair

29631 Km

32913

Job

Overdreef
GmbH ,
Duisburg

Job
Job
Job

— Job

Description:

Considered as a repeat visit No

Customer's own words

Service - standard scope
Flat rate unit I 00 00 105

2 FRU

— Job

Description:

Considered as a repeat visit No

Customer's own words

Engine oil service
Flat rate unit I 00 00 610

3 FRU

MOTORÖEL
Part I FT99 21 0 398 5

Local

5

Set oil-filter element
Part I 11 42 8 575 211

1

— Job

Description:

Considered as a repeat visit No

Customer's own words

Microfilter service
Flat rate unit I 00 00 616

2 FRU

Microfilter/activated Carbon container
Part I 64 11 9 237 555

1

— 10/10/2017 Warranty 29631 Km 32913 Job: Service - standard scope
Job: Engine oil service
Job: Service - micro filter/activated carbon filter

— Job: Service - standard scope

Description: Service - standard scope

Considered as a repeat visit No

Customer's own words

Service - standard scope 2 FRU
Flat rate unit I 00 00 105

Service - standard scope
Defect I 87 00 06 00 00

— Job: Engine oil service

Description: Engine oil service

Considered as a repeat visit No

Customer's own words

Engine oil service 3 FRU
Flat rate unit I 00 00 610

Engine oil service
Defect I 87 00 02 00 00

Set oil-filter element 1
Part I 11 42 8 575 211

— Job: Service - micro filter/activated carbon filter

Description: Service - micro filter/activated carbon filter

Considered as a repeat visit No


Customer's own words

Microfilter service 2 FRU
Flat rate unit I 00 00 616

Service - micro filter/activated carbon filter
Defect I 87 64 01 00 00

Microfilter/activated Carbon container 1
Part I 64 11 9 237 555

— 26/06/2017 Key 15380 Km 26558 Key 1

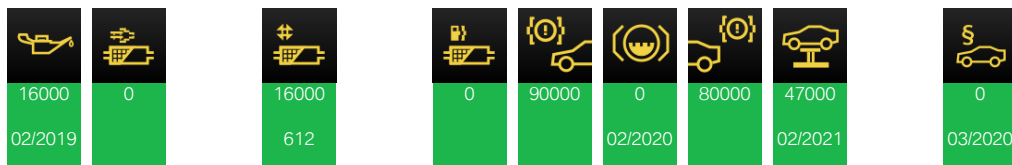

— 16/03/2017 Service 1 Km 01119 Procar Automobile, Köln Manual

