

Thank you for ordering from us!
www.checkvin.eu

Vehicle

BMW 320D XDR A, 140KW

WBA8J11040K630805



Development code F31
Colour black-sapphire metallic
Actual integration level F020-23-07-530
Start of warranty 26 April 2016

Delivery stop



Technical Campaigns are available.

Technical campaigns

Status	Campaign number	Description	Reservation
Open	10032550300	Check the driver's airbag, replace if necessary (conversion SDI)  Delivery stop Local campaign number: -	

Warranty extension/VIN-based goodwill

Status	Campaign number	Description
Open	1SACC011056	Exhaust gas recirculation cooler Bx7 Local campaign number: -

Special information

There are no Campaigns for this vehicle.

Restrictions on the warranty

There are no restrictions on the warranty.

⚠ Market-specific restrictions are not currently displayed. Please check this in WDF/WXE via S-Gate.

Live Diagnosis

 There are no service solutions for Live Diagnosis.

Service contracts

No BSI contracts

Information on faults workshop/Service Consultation

There is no information on faults.

Navigation map

Note: The installed map cannot be clearly identified. Presumably one of the following maps is present in the vehicle.

Installed map	Enabling code (subscription)	Latest navigation map included in subscription	Latest navigation map subject to charge
Road Map EUROPE EVO 2016-1 (As of: 11 Jan 2024)	-	-	-
Road Map EUROPE EVO 2016-1 (As of: 11 Jan 2024)	Enabling code valid for navigation maps with release date up to 31 Dec 2099 (SWID: 00F10FFF).	Road Map EUROPE EVO 2025-1	-

Vehicle details

Vehicle type	Passenger car
Brand	BMW
Model	320D XDR A
Body	TOUR
Vehicle identification number (last 7 digits)	K630805
Vehicle identification number (17 digits)	WBA8J11040K630805
Development code	F31
Steering	LL
Engine	B47O
Engine number	56189590
Exhaust re-treatment	EURO6, W, PI/CI, M, N1 I
Transmission	AUT
Transmission number	0093443ZN5
Head unit serial number	HB2140G7814703
Drive	ALLR
Integration level, works	F020-16-03-503
Production date	14 Apr 2016
Production plant	Muenchen
Delivery date	15 Apr 2016
Delivering retailer	Gregoir Sint-Martens-Latem, St. Martens Latem, BE
National-market version	EUR
Paint code	475

Upholstery code	ZAWT
Model code	8J21
Basic type	8J11
Lead type	8J21

Optional equipment

Optional equipment ex works: 01CA Selection of COP-relevant vehicles 0205 Automatic transmission 0216 Hydro steering-servotronic 0230 EU-specific additional contents 0255 Sports leather steering wheel 02FH BMW LA wheel, V-spoke 390 02PA Locking wheel bolt 02VB Tyre pressure display 0302 Alarm system 03AC Trailer coupling 03AT Roof rails aluminium satinated 0420 Sun protection glazing 0423 Floor mats velours 0431 Interior mirror with automatic-dip 0488 Lumbar support, driver and passenger 0493 Storage compartment package 0494 Seat heating driver/passenger 04AE Armrest front, retractable 04CG Interior trim strips "satin-silber" matt 0508 Park Distance Control (PDC) 0521 Rain sensor 0534 Automatic air conditioning 0544 Cruise control with brake function 0548 Kilometre speedo 0563 Lights package 05A1 LED Fog lights 05A2 LED headlight 05AC High-beam assistant 05DC Rear-seat headrests, folding 0609 Navigation system Professional 0676 HiFi speaker system 0698 Area-Code 2 for DVD 06AC Intelligent emergency call 06AE Teleservices 06NH Hands-free system with USB interface 06WA Instrument panel with extended scope 0775 Headlining anthracite 0778 Door sill finishers with BMW Individual designation 07LC Modell Advantage 0868 Language version Dutch 0886 On-board literature, Dutch 08KA Oil service interval 24 mths / 30,000 km 08S3 Automatic locking during starting 08SM Car ident. number visible from outside 09AA Outer skin protection 0XL3 BMW Individual leather steering wheel A090 90 Ah AGM battery LEDE Leather equipment	Retrofitted optional equipment: This vehicle has no retrofits.
--	--

Vehicle histories

	Date	Type	Vehicle mileage	Retailer	Overview
—	15/01/2024	Warranty	229295 Km	05738	Job: F1x F2x F3x G0x G1x G3x B47O B47K B47U B47T Replacing EGR cooler (high-temperature) Job: E84 Fx Gx Bx7 Nx7 Customer notification exhaust gas

recirculation cooler
Job: G0x G3x B47O Programming
control units (DDE)

- Job: F1x F2x F3x G0x G1x G3x B47O B47K B47U B47T Replacing EGR cooler (high-temperature)

Description: F1x F2x F3x G0x G1x G3x B47O B47K B47U B47T Replacing EGR cooler (high-temperature)

Considered as a repeat visit No

Customer's own words

Replace exhaust gas recirculation cooler, including exhaust gas recirculation valve Flat rate unit I 00 74 649	23 FRU
---	--------

Additional work: run function test for pressure sensor system Flat rate unit I 00 74 650	3 FRU
---	-------

Additional work: enter component identification of new exhaust gas recirculation cooler in diagnostic system Flat rate unit I 00 74 651	1 FRU
--	-------

Additional work cleaning the exhaust gas recirculation pipe Flat rate unit I 00 74 652	6 FRU
---	-------

F1x F2x F3x G0x G1x G3x B47O B47K B47U B47T Replacing EGR cooler (high-temperature) Defect I 00 11 15 07 00	
--	--

Exhaust gas radiator high temperature Part I 11 71 7 822 347	1
---	---

EGR small parts set Part I 11 71 8 490 640	1
---	---

Pipe union Part I 11 71 7 799 853	2
--------------------------------------	---

Holder Part I 61 13 1 369 832	1
----------------------------------	---

Connection piece Part I 11 65 7 803 012	1
--	---

O-ring Part I 11 61 8 512 681	1
----------------------------------	---

Torx bolt Part I 11 71 2 249 909	2
-------------------------------------	---

Acoustic cover front Part I 11 14 8 490 577	1
--	---

- Job: E84 Fx Gx Bx7 Nx7 Customer notification exhaust gas recirculation cooler

Description: E84 Fx Gx Bx7 Nx7 Customer notification exhaust gas recirculation cooler

Considered as a repeat visit No

Customer's own words

Administrative effort Flat rate unit I 00 74 758	1 FRU
---	-------

E84 Fx Gx Bx7 Nx7 Customer notification exhaust gas recirculation cooler Defect I 00 11 35 07 00	
---	--

- Job: G0x G3x B47O Programming control units (DDE)

Description: G0x G3x B47O Programming control units (DDE)

Considered as a repeat visit No

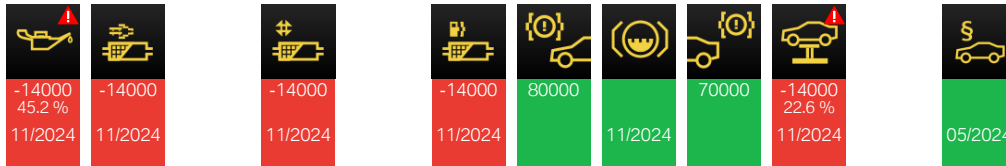
Customer's own words

Program control units
Flat rate unit I 00 71 940


8 FRU

G0x G3x B47O Programming control units (DDE)
Defect I 00 13 51 03 00

— 11/01/2024 Key 229294 Km 05738 Key 0



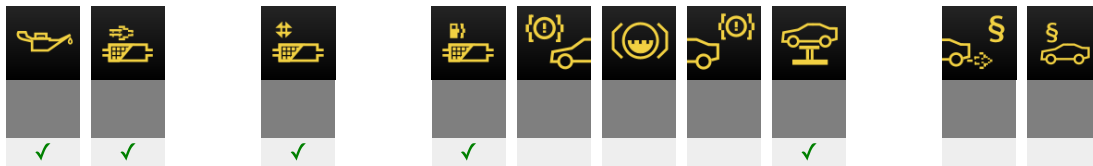— 11/01/2024 Service 229294 Km 05738 Jorssen Zuid, Aartselaar Manual



— 11/01/2024 Repair 229295 Km 05738, AARTSELAAR Job
Job
Job
Job
Job
Job
Job
Job
Job
Job

— Job

Description:

Considered as a repeat visit No

Customer's own words

Administrative effort
Flat rate unit I 00 74 758

1 FRU

Program control units
Flat rate unit I 00 71 940

8 FRU

Replace exhaust gas recirculation cooler, including exhaust gas
recirculation valve
Flat rate unit I 00 74 649

23 FRU

Additional work: run function test for pressure sensor system
Flat rate unit I 00 74 650

3 FRU

Additional work: enter component identification of new exhaust gas
recirculation cooler in diagnostic system
Flat rate unit I 00 74 651

1 FRU

Additional work cleaning the exhaust gas recirculation pipe
Flat rate unit I 00 74 652

6 FRU

Exhaust gas radiator high temperature
Part I 11 71 7 822 347

1

EGR small parts set
Part I 11 71 8 490 640

1

Vacuum hose Part I 11 65 8 595 650		1
Pipe union Part I 11 71 7 799 853		2
Holder Part I 61 13 1 369 832		1
Connection piece Part I 11 65 7 803 012		1
O-ring Part I 11 61 8 512 681		1
Torx bolt Part I 11 71 2 249 909		2
Acoustic cover front Part I 11 14 8 490 577		1
Koelvloeistof Frostox HT12 Part I WS10	Local	5
Cleaner Part I WS99	Local	1
Huurwagen 2CQY038 Part I HW	Local	1

— Job

Description:

Considered as a repeat visit No

Customer's own words

HUURWAGEN NRPLAAT VAN TOT Part I HW	Local	1
---	-------	---

— Job

Description:

Considered as a repeat visit No

Customer's own words

Replace left and right radial shaft seal for driven shafts on rear axle differential Flat rate unit I 33 10 524		22 FRU
Job time without allowance for / rear axle Flat rate unit I 33 99 000		12 FRU
Ruitensproeier vloeistof Part I WS17	Local	4
Assembly ring Part I 31 53 7 502 681		2
Hypoid axle oil G1 Part I 83 22 2 295 532		2
Sealing kit rear axle differential Part I 33 10 8 860 346		2

— Job

Description:

Considered as a repeat visit No

Customer's own words

Replacing tires for four wheels

Flat rate unit I 36 12 551

21 FRU

Goodyear Ultra Grip 8 Performance

Part I 85 45 2 593 580

4

RECYTYRE Milieubijdrage 4 X 4

Part I WS41

Local

4

— Job

Description:

Considered as a repeat visit No

Customer's own words

— Job

Description:

Considered as a repeat visit No

Customer's own words

— Job

Description:

Considered as a repeat visit No

Customer's own words

— Job

Description:

Considered as a repeat visit No

Customer's own words

— Job

Description:

Considered as a repeat visit No

Customer's own words

— Job

Description:

Considered as a repeat visit No

Customer's own words

— Job

Description:

Considered as a repeat visit No

Customer's own words

—


29/11/2022

Key

183370 Km


20736

Key 0




-16000
51.6 %
11/2023





-16000
11/2023







48000



03/2023



5000



15000
11/2025



05/2023

—

29/11/2022

Service

183370 Km

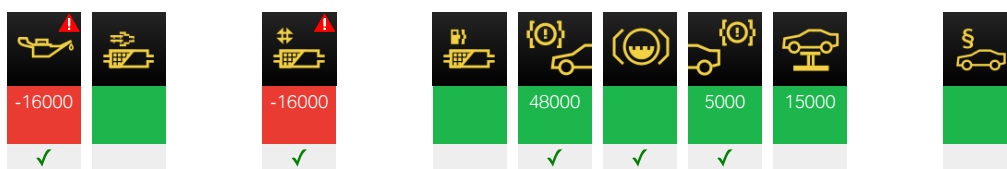
20736
Daeninck

Automatic

<https://myair-b2d.bmwgroup.com/air/faces/xhtml/fahrzeug/FahrzeugSingleView.xhtml?vin=WBA8J11040K630805>

7/12


Latem , St.
Martens Latem



— 15/11/2021 Key

136050 Km

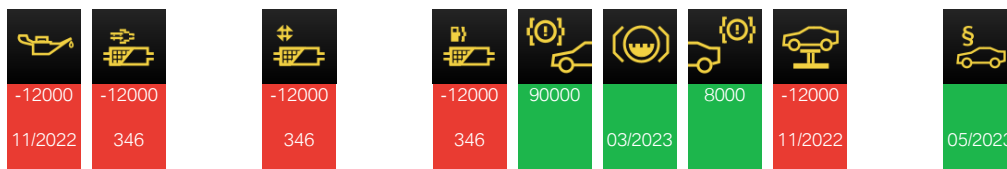Key 0




— 15/11/2021 Service

136050 Km

20736
Daeninck
Latem , St.
Martens Latem

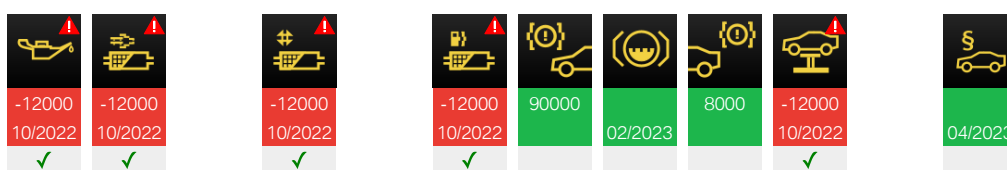
Automatic



— 24/06/2021 Key

117342 Km

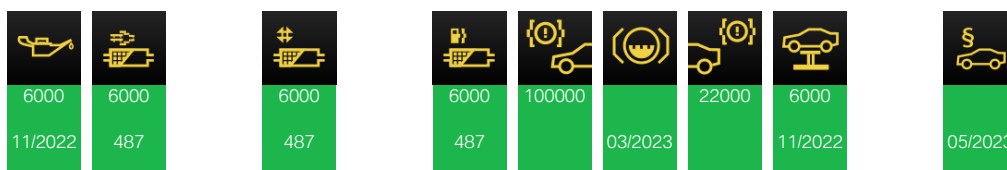
Key 0



— 10/03/2021 Key

104698 Km

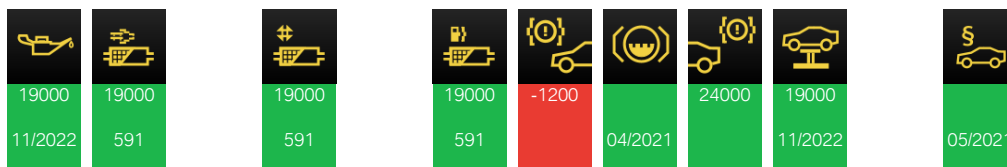Key 0




— 10/03/2021 Service

104698 Km

20736
Daeninck
Latem , St.
Martens Latem

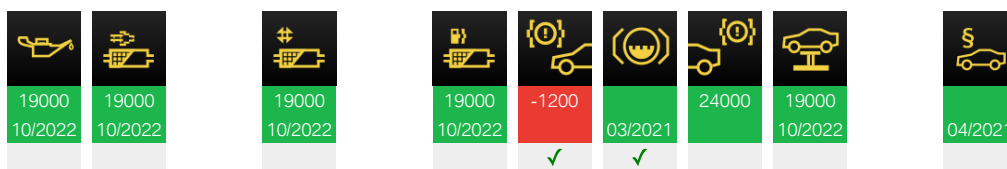
Automatic



— 12/11/2020 Key

92349 Km

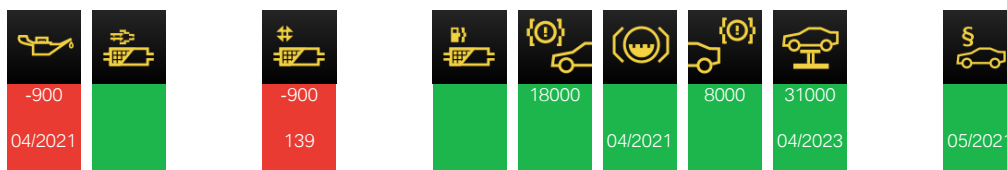Key 0
































— 12/11/2020 Service

92349 Km

20736
Daeninck
Latem , St.
Martens Latem

Automatic

 -900 03/2021 ✓	 ✓	 -900 03/2021 ✓	 ✓	 18000 ✓	 03/2021 ✓	 8000 ✓	 31000 03/2023 ✓	 04/2021 ✓
—	04/05/2020	Key	80426 Km	20736	Key 0			
 11000 04/2021 ✓	 ✓	 11000 328 ✓	 ✓	 35000 ✓	 04/2021 ✓	 16000 ✓	 42000 04/2023 ✓	 05/2021 ✓
—	20/11/2019	Key	72545 Km	20736	Key 0			
 19000 04/2021 ✓	 ✓	 19000 491 ✓	 ✓	 42000 04/2021 ✓	 04/2021 ✓	 22000 ✓	 50000 04/2023 ✓	 05/2020 ✓
—	25/04/2019	Key	60412 Km	20736	Key 0			
 2200 12/2019 ✓	 2200 216 ✓	 2200 216 ✓	 2200 216 ✓	 60000 ✓	 -24 3.3 % 04/2019 ✓	 32000 ✓	 2200 12/2019 ✓	 05/2020 ✓
—	25/04/2019	Service	60412 Km	20736	Automatic			
 2200 11/2019 ✓	 2200 11/2019 ✓	 2200 11/2019 ✓	 2200 11/2019 ✓	 60000 ✓	 04/2019 ✓	 32000 ✓	 2200 11/2019 ✓	 04/2020 ✓
—	25/04/2019	Repair	60412 Km	20736	Job			
				Daeninck Latem , St. Martens Latem				

— Job

Description:

Considered as a repeat visit No

Customer's own words

!!! unknown BMW-Id ESTIMATE Onderhoudshistorie door middel van Local 0 FRU
 ICOM naar het motorvoertuig overdragen !!!
 Flat rate unit I -

Service standaard omvang
 Package I 0000105

Service - standard scope
 Flat rate unit I 00 00 105

2

Service luchtfilterelement
 Package I 0000602

Service - air filter element
 Flat rate unit I 00 00 602

2

Air filter element

1

Part I 13718511668

Service brandstoffilter
Package I 0000604

Service fuel filter Flat rate unit I 00 00 604	3
Fuel filter cartridge Part I 13328572522	1

Service motorolie
Package I 0000610

Engine oil service Flat rate unit I 00 00 610	3
Set oil-filter element Part I 11428575211	1
BMW Engine Oil LL04 5W30 Part I 83212405948	5

Service microfilter
Package I 0000616

Microfilter service Flat rate unit I 00 00 616	2
Microfilter/activated Carbon container Part I 64119237555	1

Service remvloeistof
Package I 0000618

Brake fluid service Flat rate unit I 00 00 618	4
Brake fluid DOT4 LV, low viscosity Part I 83132184843	1

Service voertuig-check
Package I 0000624

Service, vehicle check Flat rate unit I 00 00 624	6
--	---

— 14/11/2018 Key

50957 Km

Key 0

									
12000	12000	12000	12000	60000	0	37000	12000	0	0
12/2019	412	412	412	04/2019		12/2019		05/2020	

— 25/10/2018 Key

49823 Km

Key 0

									
13000	13000	13000	13000	60000	0	38000	13000	0	0
12/2019	432	432	432	04/2019		12/2019		05/2020	

— 25/10/2018 Warranty

49823 Km

20736

Job: F10 F11 F25 F26 F31 F34
F36 B47O Replacing exhaust-gas
recirculation cooler

— Job: F10 F11 F25 F26 F31 F34 F36 B47O Replacing exhaust-gas recirculation cooler

Description: F10 F11 F25 F26 F31 F34 F36 B47O Replacing exhaust-gas recirculation cooler

Considered as a repeat visit No

Customer's own words

Replace exhaust gas recirculation cooler and clean exhaust gas recirculation pipe 28 FRU
Flat rate unit I 00 66 167

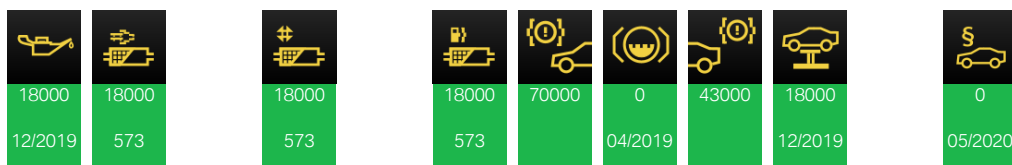
F10 F11 F25 F26 F31 F34 F36 B47O Replacing exhaust-gas recirculation cooler
Defect I 00 11 83 04 00

exhaust cooler 1
Part I 11 71 8 477 659

EGR small parts set 1
Part I 11 71 8 490 222

Pipe union 2
Part I 11 71 7 799 853

— 06/06/2018 Key 44827 Km 20736 Key 0



— 06/06/2018 Warranty 44827 Km 20736 Job: F1x F2x F3x B47 programming control units and if necessary, replacing the EGR valve

— Job: F1x F2x F3x B47 programming control units and if necessary, replacing the EGR valve

Description: F1x F2x F3x B47 programming control units and if necessary, replacing the EGR valve

Considered as a repeat visit No

Customer's own words

Carrying out the ABL, programming the control units and replacing the exhaust-gas recirculation valve 16 FRU
Flat rate unit I 00 64 942

F1x F2x F3x B47 programming control units and if necessary, replacing the EGR valve
Defect I 00 11 45 04 00

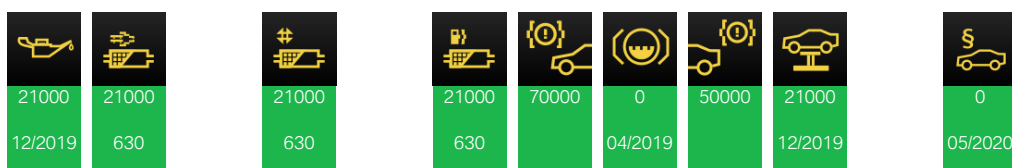
EGR-valve 1
Part I 11 71 8 594 492

Gasket Steel 1
Part I 11 71 8 579 364

Oval head screw 2
Part I 35 21 7 685 343

Hose clamp 2
Part I 07 12 9 952 104

— 09/04/2018 Key 42247 Km 20736 Key 0



— 01/12/2017 Key 31635 Km 20736 Key 0

 -600 04/2018	 0	 -600 150	 0	 70000	 0 04/2019	 50000	 31000	 0 05/2020
---	---	---	---	---	--	---	--	--

— 01/12/2017 Service

31635 Km

20736
Daeninck Peter
nv Daeninck
Latem , St.
Martens Latem

Automatic

 -600 04/2018 ✓	 0	 -600 04/2018 ✓	 0	 70000	 0 04/2019	 50000	 31000	 0 05/2020
---	--	---	--	--	---	--	---	---

— 12/04/2017 Key

18136 Km

20736

Key 0

 13000 04/2018	 0	 13000 383	 0	 60000	 0 04/2019	 50000	 44000	 0 05/2020
---	--	---	--	--	---	--	---	---

— 04/11/2016 Key

8571 Km

20736

Key 0

 23000 04/2018	 0	 23000 542	 0	 50000	 0 04/2019	 50000	 60000	 0 05/2020
---	--	---	--	--	---	--	---	---

— 22/09/2016 Key

6081 Km

20736

Key 0

 25000 04/2018	 0	 25000 584	 0	 50000	 0 04/2019	 50000	 60000	 0 05/2020
---	--	---	--	--	---	--	---	---