

Vehicle Details



BMW 318d, 150 HP



Vehicle identification number
WBA8C3103HK772127



Code
F30

 Production date 14 Jul 2016	 Delivery date 20 Jul 2016	 Steering Left Hand Drive	 Basic Type 8C31
 Engine code B47D20U0	 Drivetrain Rear Wheel Drive	 Transmission Automatic	 Transmission number 0461694WC5
 Body Sedan	 Color Schwarz II (668)	 Upholstery Stoff Corner/anthrazit/akzent Grau (CCL1)	 Factory Tires Bridgestone

Technical Campaigns

There's no technical campaigns available

Warranty and Service Contracts

This vehicle has no active warranty or service contracts

Restrictions

This vehicle has no restrictions

Optional Equipment

54 Optionals ^

Code	Description
01CA	Selection Of Cop-relevant Vehicles
01CB	Co2 Equipment
0205	Automatic Transmission
0216	Hydro Steering-servotronic
0230	Extra Package, Eu-speciifc
0258	Tyres With Runflat Properties
02FM	Bmw La Wheel, V-spoke 398
02PA	Locking Wheel Bolt
02VB	Tyre Pressure Display
02XE	Leather Sports Steering Wheel
0320	Deleted, Model Lettering
0322	Comfort Access
03AC	Trailer Coupling
0403	Glass Roof, Electrical
0417	Electric Sun Blind
0423	Floor Mats Velours
0425	Electric Sun Blind

0403	Glass Roof, Electrical
0417	Electric Sun Blind
0423	Floor Mats Velours
0428	Warning Triangle And First Aid Kit
0465	Through-loading System
0481	Sports Seat
0493	Storage Compartment Package
0494	Seat Heating Driver/passenger
04AE	Armrest Front, Retractable
04LU	Black High-gloss Accent Chrm. Perlglanz
0502	Headlight Cleaning System
0508	Park Distance Control (pdc)
0521	Rain Sensor
0534	Automatic Air Conditioning
0544	Cruise Control With Brake Function
0548	Kilometre Speedo
0563	Light Package
0575	Additional Plug Socket In Trunk
05A2	Led Headlight
05DA	Passenger Airbag Deactivation
0688	Harman/kardon Surround Sound System
0698	Area-code 2 For Dvd
06AC	Intelligent Emergency Call
06AE	Teleservices
06NH	Hands-free System With Usb Interface
0716	No Description Available
07AC	Sport Line
07LD	Modell Sport Line
0842	Cold-climate Version
0850	Additional Export Tank Filling
0853	Language Version, English
0885	On-board Literature, Swedish
08KA	Oil Service Interval 24 Mths / 30,000 Km
08R9	Refrigerant R1234yf
08SM	Car Ident. Number Visible From Outside
08TG	Thiefproofing Device
0993	Model Year Code In Vin
09AA	Outer Skin Protection
A090	No Description Available
CCL1	Stofff Corner/anthrazit/akzent Grau
POLS	No Description Available


Retrofitted Optional Equipment

This vehicle has no retrofits.

Retrofitted Optional Equipment

This vehicle has no retrofits.

Mileage Overview

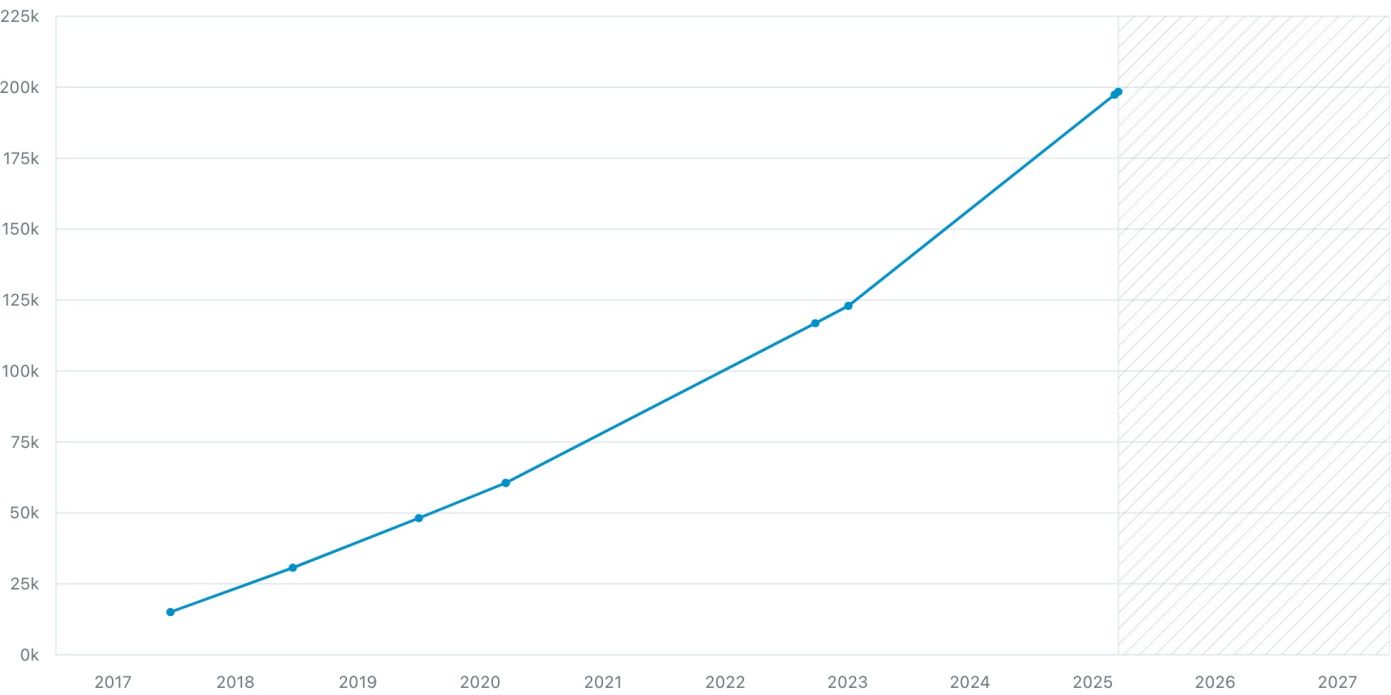

Vehicle history

Period: 21 Jun 2017 – 18 Mar 2025 • 19 entries

18 Mar 2025 • Key • All Good 198,430 km ^

Description	State	Due Date	Remaining Service Life
Rear brakes	Not Due		7000 km
Front Brake	Not Due		19000 km
Engine oil	Not Due	Dec 2026	22000 km • 623 days
Vehicle check	Not Due	Dec 2026	22000 km • 623 days
Brake fluid	Not Due	Dec 2026	623 days
Fuel filter	Not Due	Dec 2026	22000 km • 623 days
Air filter element	Not Due	Dec 2026	22000 km • 623 days
Microfilter	Not Due	Dec 2026	22000 km • 623 days

18 Mar 2025 • Warranty • 17 Jobs 198,430 km ^

N/a	Defect
-----	--------

Job: F1x F2x F3x G0x G1x G3x B47O B47K B47U B47T Replace exhaust-gas recirculation cooler (high temp)		
Replace Exhaust-gas Recirculation Cooler, Including Exhaust-gas Recirculation Valve	Work	N/A
Performing Additional Work For Pressure Sensor Functional Check	Work	N/A
Additional Work: Enter Component Identification Of New Exhaust-gas Recirculation Cooler In Diagnostic System	Work	N/A
Additional Work: Clean Egr Pipe	Work	N/A
Exhaust Gas Cooler High Temperature	Part	1 Unit
Agr Small Parts Set	Part	1 Unit
Pipe Union	Part	2 Units
Acoustic Cover Front	Part	1 Unit
Holder	Part	1 Unit
Connection Piece	Part	1 Unit

◦ Acoustic Cover Front	Part	🔧 1 Unit
◦ Holder	Part	🔧 1 Unit
◦ Connection Piece	Part	🔧 1 Unit
◦ O-ring	Part	🔧 1 Unit
◦ F1x F2x F3x G0x G1x G3x B47o B47k B47u B47t Replace Exhaust-gas Recirculation Cooler (high Temp)	Defect	

Job: E84 Fx Gx Bx7 Nx7 Customer notification exhaust-gas recirculation cooler

◦ Administrative Outlay	Work	N/A
◦ E84 Fx Gx Bx7 Nx7 Customer Notification Exhaust-gas Recirculation Cooler	Defect	

Job: Fx Checking driver's airbag and replacing if necessary (SDI conversion)

◦ Check Steering Wheel (airbag Module Not Affected)	Work	N/A
◦ Fx Checking Driver's Airbag And Replacing If Necessary (sdi Conversion)	Defect	

07 Mar 2025 • Key • All Good

197,400 km ^

Description	State	Due Date	Remaining Service Life
Rear brakes	Not Due		7000 km
Front Brake	Not Due		20000 km
Engine oil	Not Due	Dec 2026	23000 km • 634 days
Vehicle check	Not Due	Dec 2026	23000 km • 634 days
Brake fluid	Not Due	Dec 2026	634 days
Fuel filter	Not Due	Dec 2026	23000 km • 634 days
Air filter element	Not Due	Dec 2026	23000 km • 634 days
Microfilter	Not Due	Dec 2026	23000 km • 634 days

03 Jan 2023 • Key • ⚠ 1

122,970 km ^

Description	State	Due Date	Remaining Service Life
Front Brake	⚠ Due soon		1900 km
Engine oil	Not Due	Dec 2023	6000 km • 328 days
Vehicle check	Not Due	Dec 2023	6000 km • 328 days
Brake fluid	Not Due	Aug 2024	568 days
Rear brakes	Not Due		110000 km
Fuel filter	Not Due	Dec 2023	6000 km • 328 days
Air filter element	Not Due	Dec 2023	6000 km • 328 days
Microfilter	Not Due	Dec 2023	6000 km • 328 days

26 Sep 2022 • Key • All Good

116,850 km ^

Description	State	Due Date	Remaining Service Life
Front Brake	Not Due		6000 km
Engine oil	Not Due	Dec 2023	12000 km • 425 days
Vehicle check	Not Due	Dec 2023	12000 km • 425 days
Brake fluid	Not Due	Aug 2024	665 days
Rear brakes	Not Due		120000 km
Fuel filter	Not Due	Dec 2023	12000 km • 425 days
Air filter element	Not Due	Dec 2023	12000 km • 425 days
Microfilter	Not Due	Dec 2023	12000 km • 425 days

26 Sep 2022 • Warranty • 🛠 3 Jobs

116,850 km ^

◦ N/a	Defect	
-------	--------	--

Job: G0x G3x B47O Program control units (DDE)

◦ Program Control Units	Work	N/A
◦ G0x G3x B47o Program Control Units (dde)	Defect	

Job: G0x G3x B470 Program control units (DDE)

- Program Control Units

Work

N/A

- G0x G3x B470 Program Control Units (dde)

Defect

17 Mar 2020 • Key • ▲ 5

60,580 km ^

Description	State	Due Date	Remaining Service Life
Engine oil	▲ Due	Jun 2020	-500 km • 74 days
Vehicle check	▲ Due	Jun 2020	-500 km • 74 days
Rear brakes	Not Due		18000 km
Front Brake	Not Due		19000 km
Brake fluid	Not Due	Jul 2021	464 days
Fuel filter	▲ Due		-500 km • 74 days
Air filter element	▲ Due		-500 km • 74 days
Microfilter	▲ Due		-500 km • 74 days

17 Mar 2020 • Key • ▲ 5

60,570 km ^

Description	State	Due Date	Remaining Service Life
Engine oil	▲ Due	Jun 2020	-500 km • 75 days
Vehicle check	▲ Due	Jun 2020	-500 km • 75 days
Rear brakes	Not Due		18000 km
Front Brake	Not Due		19000 km
Brake fluid	Not Due	Jul 2021	465 days
Fuel filter	▲ Due		-500 km • 75 days
Air filter element	▲ Due		-500 km • 75 days
Microfilter	▲ Due		-500 km • 75 days

17 Mar 2020 • Service • ✔ 5

60,570 km ^

Förenade Bil AB, Malmö , Malmö

Description	State	Due Date	Remaining Service Life	Done
Engine oil	▲ Due	May 2020	-500 km • 74 days	✔
Front Brake	Not Due		19000 km	
Brake fluid	Not Due	Jun 2021	464 days	
Rear brakes	Not Due		18000 km	
Fuel filter	▲ Due	May 2020	-500 km • 74 days	✔
Air filter element	▲ Due	May 2020	-500 km • 74 days	✔
Vehicle check	▲ Due	May 2020	-500 km • 74 days	✔
Microfilter	▲ Due	May 2020	-500 km • 74 days	✔

02 Jul 2019 • Key • ▲ 1

48,190 km ^

Description	State	Due Date	Remaining Service Life
Brake fluid	▲ Due soon	Jul 2019	-1 days
Engine oil	Not Due	Jun 2020	12000 km • 329 days
Vehicle check	Not Due	Jun 2020	12000 km • 329 days
Rear brakes	Not Due		29000 km
Front Brake	Not Due		29000 km
Fuel filter	Not Due		12000 km • 329 days
Air filter element	Not Due		12000 km • 329 days
Microfilter	Not Due		12000 km • 329 days

02 Jul 2019 • Service • ✔ 1

48,190 km ^

Förenade Bil AB, Malmö , Malmö

Description	State	Due Date	Remaining Service Life	Done
Engine oil	Not Due	May 2020	12000 km • 329 days	
Front Brake	Not Due		29000 km	

Description	State	Due Date	Remaining Service Life	Done
Engine oil	Not Due	May 2020	12000 km • 329 days	
Front Brake	Not Due		29000 km	
Brake fluid	⚠ Due soon	Jul 2019	-1 days	✓
Rear brakes	Not Due		29000 km	
Fuel filter	Not Due	May 2020	12000 km • 329 days	
Air filter element	Not Due	May 2020	12000 km • 329 days	
Vehicle check	Not Due	May 2020	12000 km • 329 days	
Microfilter	Not Due	May 2020	12000 km • 329 days	

02 Jul 2019 • Warranty • 7 Jobs

48,190 km ^

Job: F10 F11 F25 F26 F31 F34 F36 B470 Replace exhaust-gas recirculation cooler

◦ Check Index For Egr Cooler Check	Work	N/A
◦ Replace Exhaust-gas Recirculation Cooler And Replace Or Remount Exhaust-gas Recirculation Valve; Clean Exhaust-gas Recirculation Pipe	Work	N/A
◦ Exhaust Cooler	Part	⊞ 1 Unit
◦ Pipe Union	Part	⊞ 2 Units
◦ Oval Head Screw	Part	⊞ 2 Units
◦ Set Of Small Parts	Part	⊞ 1 Unit
◦ F10 F11 F25 F26 F31 F34 F36 B470 Replace Exhaust-gas Recirculation Cooler	Defect	

02 Jul 2019 • Warranty • 3 Jobs

48,190 km ^

◦ Standard Scope Of Service	Work	N/A
◦ Brake Fluid Service	Work	N/A
◦ N/a	Defect	

21 Jun 2018 • Key • 2

30,690 km ^

Description	State	Due Date	Remaining Service Life
Engine oil	⚠ Due soon	Jul 2018	270 km • 11 days
Microfilter	⚠ Due soon		270 km • 11 days
Air filter element	Not Due		
Fuel filter	Not Due		
Brake fluid	Not Due	Jul 2019	371 days
Vehicle check	Not Due	Jul 2020	32000 km • 731 days
Rear brakes	Not Due		48000 km
Front Brake	Not Due		49000 km

21 Jun 2018 • Service • 2

30,690 km ^

Förenade Bil AB, Malmö

Description	State	Due Date	Remaining Service Life	Done
Engine oil	⚠ Due soon		270 km	✓
Front Brake	Not Due		49000 km	
Brake fluid	Not Due			
Rear brakes	Not Due		48000 km	
Fuel filter	Not Due			
Air filter element	Not Due			
Vehicle check	Not Due		32000 km	
Microfilter	⚠ Due soon	Jul 2018	270 km • 10 days	✓

21 Jun 2018 • Warranty • 2 Jobs

30,690 km ^

Job: F1x F2x F3x B47 Program control unit, replace exhaust-gas recirculation valve if necessary

Micronlitter

Due soon

Jul 2018

270 km • 10 days



21 Jun 2018 • Warranty • 2 Jobs

30,690 km ^

Job: F1x F2x F3x B47 Program control unit, replace exhaust-gas recirculation valve if necessary

Operating Test Module And Programming Control Unit	Work	N/A
F1x F2x F3x B47 Program Control Unit, Replace Exhaust-gas Recirculation Valve If Necessary	Defect	

21 Jun 2018 • Warranty • 7 Jobs

30,690 km ^

Engine Oil Service	Work	N/A
Standard Scope Of Service	Work	N/A
Set Oil-filter Element	Part	1 Unit
N/a	Defect	
Service - Microfilter	Work	N/A
Microfilter/activated Carbon Container	Part	1 Unit
N/a	Defect	

21 Jun 2017 • Key • All Good

15,060 km ^

Description	State	Due Date	Remaining Service Life
Engine oil	Not Due	Jul 2018	16000 km
Microfilter	Not Due		16000 km • 370 days
Air filter element	Not Due		
Fuel filter	Not Due		
Brake fluid	Not Due	Jul 2019	
Vehicle check	Not Due	Jul 2020	47000 km
Front Brake	Not Due		70000 km
Rear brakes	Not Due		70000 km

21 Jun 2017 • Warranty • 8 Jobs

15,060 km ^

Job: Exhaust-gas recirculation valve

Carrying Out Vehicle Test	Work	N/A
Supporting Voltage Of The Vehicle Electrical System/recharging Vehicle Battery	Work	N/A
Replacing The Exhaust-gas Recirculation Valve	Work	N/A
Egr-valve	Part	1 Unit
Gasket Steel	Part	1 Unit
Oval Head Screw	Part	2 Units
Hose Clamp	Part	2 Units
Exhaust-gas Recirculation Valve	Defect	

14 Jul 2016 • Produced in Muenchen

This Report is provided for informational purposes only on an "as-is" basis. All data originates from independent third-party providers; CheckVIN does not access BMW/MINI/Rolls-Royce internal databases and does not verify, update, or guarantee the accuracy or completeness of any information. Data may be incomplete, approximate, outdated, missing, or contain errors.

This is not an official manufacturer or dealer document and does not replace a professional inspection. Any decisions made using this Report are solely at the User's risk.

BMW, MINI, and Rolls-Royce are registered trademarks of BMW AG. CheckVIN is not affiliated with, endorsed by, or authorized by BMW AG.

By viewing this Report, the User accepts these limitations and releases CheckVIN from liability arising from the use of this information.