

Vehicle

BMW 440i, 240kW

WBA4J51040BN79909



Development code
Color
Actual integration level
Start of warranty

F36
black-sapphire metallic
F020-20-03-540
November 30, 2018

▼ Technical Campaigns

There are no campaigns available.

▼ Special information

There are no campaigns available.

▼ Live Diagnosis

⚠ An error has occurred. Please try again later.

▼ Service contracts

No BSI contracts available

You can find additional service contract information and selection options in the DCSNet warranty vehicle enquiry.

▼ Information on faults, workshop/Service Consultation

No information on faults is available.

▼ Navigation map

Note: The installed map cannot be identified. One of the following maps could be installed in the vehicle.

Installed map	Enabling code (subscription)	Latest navigation map included in subscription	Latest navigation map subject to charge
Road Map EUROPE EVO 2018-2 (as of: Jan 25, 2021)	-	-	-
Road Map EUROPE EVO 2018-2 (as of: Jan 25, 2021)	Release code valid for navigation maps with release date up to Dec 31, 2099 (SWID: 01200FFF).	Road Map EUROPE EVO 2025-2	-

▾ Vehicle details

Vehicle type	Passenger car
Brand	BMW
Model	440i
Body	COUPE
Vehicle identification number (last 7 characters)	BN79909
Vehicle identification number (17 characters)	WBA4J51040BN79909
Development code	F36
Steering	LL
Engine	B58M
Engine number	12675395
Exhaust re-treatment	Euro 6 BG
Transmission	AUT
Transmission number	1881909XEP
Head unit serial number	HB2240J8927773
Drive	HECK
Integration level	F020-18-07-521
Production date	Jul 20, 2018
Production works	Dingolfing
Delivery date	Jul 25, 2018
Delivering Retailers	Niederlassung Bremen, Bremen, DE
National-market version	EUR
Paint code	475
Upholstery code	LCNL
Model code	4J61
Base type	4J51
Lead type	4J61

▾ Optional equipment

Optional equipment fitted at the factory:

01CA Selection of COP relevant vehicles
01CB CO2 package
01DE Exhaust emission standards EU6 RDE
021W BMW LA wheel double spoke styling 704M
0230 Extra package, EU-specific

Retrofitted optional equipment:

This vehicle has no retrofits.

0258 Tire with run-flat functionality
02PA Wheel bolt retainer
02TB Sport automatic transmission
02VB Tire pressure display
02VL Variable Sport steering
0302 Alarm system
0322 Comfort access
0337 M Sports package
03AC Trailer coupling
0403 Glass roof, electrical
0423 Floor mats, velours
0428 Warning triangle and first aid kit
0431 Interior mirror with automatic-dip
0459 Seat adjuster, electric, with memory
0465 Through-loading system
0481 Sports seat
0493 Storage compartment package
0494 Seat heating driver/passenger
04AE Armrest front, retractable
04NE Blow-by heater
04WF Alu, hexagon, matt blue accent
0508 Park Distance Control (PDC)
0521 Rain sensor
0534 Automatic air conditioning
0544 Cruise control with brake function
0548 Kilometer-calibrated speedometer
0563 Light package
05A1 LED Fog lights
05DA Passenger airbag deactivation
0609 Navigation system Professional
0688 Harman/Kardon Surround Sound system
0698 Area-Code 2 for DVD
06AC Intelligent emergency SOS call
06AE Teleservices
06AK Connected Drive Services
06AM Real-Time Traffic Information
06AN Concierge Services
06AP Remote Services
06NW Phoning with wireless charging
06WB Multifunctional instrument display
06WD WLAN Hotspot
0704 M Sports suspension
0710 M leather steering wheel
0715 M Aerodynamics package
0760 High gloss shadow line
0775 Headlining anthracite
07LF Modell M Sport
07XP Navigation package, Connected Drive
0801 German version
0851 Language version German
0879 On-board vehicle literature German
08KA Oil service interval, 24 mos./30,000 km
08R9 Refrigerant R1234yf
09AA Outer skin protection
A090 90 AH AGM battery
LEDE Leather trim

▸ Software version control units

▾ Vehicle histories

	Date	Type	Vehicle mileage	Dealer	Overview
—	12/02/2022	Key	118108 km		Key 0

			
10000	10000	10000	10000
11/2023	11/2023	11/2023	11/2023

				
6000		9000	10000	
	07/2023		11/2023	12/2023

—	12/02/2022	Repair	118109 km	00096 Bobrink & Co. GmbH , Bremen	Job
---	------------	--------	-----------	-----------------------------------	-----

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Winterräder montieren Sommerräder an Kunden übergeben, Flat rate unit I 36 13 360	Local	6 FRU
--	-------	-------

—	04/30/2022	Key	114206 km	00096	Key 0
---	------------	-----	-----------	-------	-------

			
14000	14000	14000	14000
11/2023	541	541	541

				
6000		10000	14000	
	07/2023		11/2023	12/2023

—	04/30/2022	Repair	114206 km	00096 Bobrink & Co. GmbH , Bremen	Job Job Job Job
---	------------	--------	-----------	-----------------------------------	--------------------------

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Service Beratung am Fahrzeug mit Kunde ohne Service Ticket Flat rate unit I 00 52 053	Local	1 FRU
--	-------	-------

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Sommerräder montieren Winterräder zur Ei nlagerung vorbereiten Flat rate unit I 36 12 360	Local	6 FRU
--	-------	-------

Einlagerung Räder Part I 99 99 0 000 005	Local	1
---	-------	---

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Kühlmittel ergänzen Flat rate unit I O-TON	Local	1 FRU
CC-Meldung: Kühlmittel nachfüllen Flat rate unit I ORT01	Local	1 FRU

— Job

Description:
Is interpreted as a repeat visit: No
Customer's own words:

Maschinenwäsche und Fußraum aussaugen im Wert von 11,50 EURO kostenlos Flat rate unit I WASCHEN	Local	1 FRU
--	-------	-------

— 11/06/2021 Key 93269 km Key 0

 900 01/2023			 900 415	 5000	 07/2023	 8000	 34000 1135	 -5 0.7 %
---	---	---	---	---	--	---	---	--

— 11/06/2021 Repair 1 km 00096 Bobrink & Co. GmbH , Bremen Job Job Job

— Job

Description:
Is interpreted as a repeat visit: No
Customer's own words:

Schnellservice und Service Ticket mit Kompakt-Check oder Service Beratung Flat rate unit I 00 52 051	Local	1 FRU
---	-------	-------

— Job

Description:
Is interpreted as a repeat visit: No
Customer's own words:

Winterräder montieren Sommerräder zur Einlagerung vorbereiten Flat rate unit I 36 11 360	Local	6 FRU
Einlagerung Räder Part I 99 99 0 000 005	Local	1

— Job

Description:
Is interpreted as a repeat visit: No
Customer's own words:

Winter Komfortcheck Flat rate unit I 36WRAKT	Local	5 FRU
---	-------	-------

—	10/20/2021	Key	91313 km	Remote KeyRead				
								
2700			2700	5000		8000	36000	
01/2023			431		07/2023		1151	11/2021
—	07/29/2021	Key	81740 km	Key 0				
								
12000			12000	6000	-28 3.8 %	14000	44000	
01/2023			512				1232	11/2021
—	07/29/2021	Service	81740 km	00088	Automatic			
				Niederlassung Bremen , Bremen				
								
12000			12000	6000	07/2021	14000	44000	
12/2022			12/2022		✓		12/2024	10/2021
—	07/29/2021	Repair	81740 km	00088	Job			
				Job				
				Job				
				Job				
				Job				

— Job

Description:
Is interpreted as a repeat visit: No
Customer's own words:

Standard scope of service
Flat rate unit I 00 00 1052 FRU

— Job

Description:
Is interpreted as a repeat visit: No
Customer's own words:

Brake fluid service
Flat rate unit I 00 00 6184 FRU

Brake fluid DOT4 LV, low viscosity
Part I 83 13 0 443 0301

— Job

Description:
Is interpreted as a repeat visit: No
Customer's own words:

kostenlose Fahrzeugoberwäsche
Part I 0011319

Local

1

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Füllstände ggf. kostenpflichtig ergänzen
Flat rate unit I AZ00 00 4

Local

1 FRU








Windshield Washer Antifreeze
Part I 83 12 2 413 061

1

— 05/03/2021 Key

70864 km

Key 0



— 05/03/2021 Repair

70864 km

00096 Bobrink
& Co. GmbH ,
Bremen

Job
Job: Replace windshield
Job
Job
Job

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Package I MM0104

Local

Vehicle check in frame of acceptance
Flat rate unit I 00 52 054

0

— Job: Replace windshield

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Replace windshield
Package I 5131011

Replace windshield
Flat rate unit I 51 31 011

24

Clamp
Part I 07147142116

2

Repair flat rate, window, cold, 1 hr.
Part I 83192289285

1

Cover, windshield, top
Part I 51317285915

1

Drip molding, right Part I 51317285928	1
Cleaner R1 Part I 83192211217	1
Drip moulding, left Part I 51317285927	1
Green windshield Part I 51317285897	1
Bump stop Part I 51317288462	11

— Job		
Description:		
Is interpreted as a repeat visit: No		
Customer's own words:		
Additional work with rain/light sensor Flat rate unit I 61 35 994		3 FRU

— Job		
Description:		
Is interpreted as a repeat visit: No		
Customer's own words:		
Package I MM0201	Local	
Maschinenwäsche und Fußraum aussaugen im Flat rate unit I -	Local	0

— Job		
Description:		
Is interpreted as a repeat visit: No		
Customer's own words:		
!!! unknown BMW-Id ESTIMATE 0174-3479090 !!! Flat rate unit I -	Local	0 FRU

—	05/03/2021	Repair	70870 km	00096 Bobrink & Co. GmbH , Bremen	Job Job Job Job
---	------------	--------	----------	-----------------------------------	--------------------------

— Job		
Description:		
Is interpreted as a repeat visit: No		
Customer's own words:		
SB am Fzg mit iPad ohne Kunden Flat rate unit I 00 52 054	Local	1 FRU

— Job		
-------	--	--

Description:**Is interpreted as a repeat visit:** No**Customer's own words:**

Frontscheibe ersetzen Flat rate unit I 51 31 011	Local	24 FRU
Zusatzarbeit mit Regen-Licht-Sensor Flat rate unit I 61 35 994	Local	3 FRU
Repair flat rate, window, cold, 1 hr. Part I 83 19 2 289 285		1
Cover, windshield, top Part I 51 31 7 285 915		1
Drip molding, right Part I 51 31 7 285 928		1
Cleaner R1 Part I 83 19 2 211 217		1
Drip moulding, left Part I 51 31 7 285 927		1
Green windshield Part I 51 31 7 285 897		1
Bump stop Part I 51 31 7 288 462		11
Sound insulation f apron Part I 51 48 7 325 890		1
Replacemt.small plates, low beam sensor Part I 61 35 9 856 157		1

— Job**Description:****Is interpreted as a repeat visit:** No**Customer's own words:**

Sommerräder montieren Winterräder zur Einlagerung vorbereiten Flat rate unit I 36 12 360	Local	6 FRU
Einlagerung Räder Part I 99 99 0 000 005	Local	1

— Job**Description:****Is interpreted as a repeat visit:** No**Customer's own words:**

Maschinenwäsche und Fußraum aussaugen im Wert von 11,50 EURO kostenlos Flat rate unit I WASCHEN	Local	1 FRU
---	-------	-------

—	05/03/2021	Repair	70870 km	00096 Bobrink & Co. GmbH, Bremen	Job Job Job
---	------------	--------	----------	--	-------------------

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

SB am Fzg mit Ipad ohne Kunden
Flat rate unit I 00 52 054

Local

1 FRU

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Sommerräder montieren Winterräder zur Einlagerung vorbereiten
Flat rate unit I 36 12 360

Local

6 FRU

Einlagerung Räder
Part I 99 99 0 000 005

Local

1

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Maschinenwäsche und Fußraum aussaugen im Wert von 11,50 EURO
kostenlos
Flat rate unit I WASCHEN

Local

1 FRU

— 01/20/2021 Service 61235 km 34269 Autohaus M&M Parchim GmbH , Parchim Automatic

2800	2800	2800	2800
06/2022	06/2022	06/2022	06/2022
✓	✓	✓	✓

13000	0	34000	2800
08/2021			06/2022
			✓

0
12/2021

— 01/20/2021 Repair 61235 km 34269 Autohaus M & M Parchim GmbH , Parchim Job: Standard scope of service
Job: Spark plugs service
Job: Service - microfilter
Job: Vehicle check service
Job: Service - air filter insert
Job: Engine oil service
Job

— Job: Standard scope of service

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Standard scope of service

Package I 0000105

Standard scope of service	2
Flat rate unit I 00 00 105	

— Job: Spark plugs service

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Spark plugs service

Package I 0000622

Spark plugs service	12
Flat rate unit I 00 00 622	

Spark plug, High Power	6
Part I 12120040551	

Torx screw with collar	4
Part I 07147270121	

— Job: Service - microfilter

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Service - microfilter

Package I 0000616

Service - microfilter	2
Flat rate unit I 00 00 616	

Microfilter/activated Carbon container	1
Part I 64119237555	

— Job: Vehicle check service

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Vehicle check service

Package I 0000624

Vehicle check service	6
Flat rate unit I 00 00 624	

— Job: Service - air filter insert

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Service - air filter insert

Package I 0000602

Service - air filter insert	1
Flat rate unit I 00 00 602	

Air filter element
Part I 13718605164

1

— Job: Engine oil service

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Engine oil service
Package I 0000610

Engine oil service 3
Flat rate unit I 00 00 610

!!! unknown BMW-Id FT99999200130 TwinPower TurboTwinPower Local 6.5
Turbo !!!
Part I FT99999200130

Set oil-filter element 1
Part I 11428583898

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

!!! unknown BMW-Id ESTIMATE 0421/627790 !!! Local 0 FRU
Flat rate unit I -

— 01/19/2021 Key 61235 km Key 0

								
2800	2800	2800	2800	13000	0	34000	2800	0
05/2022	497	497	497		07/2021		05/2022	11/2021

— 01/19/2021 Repair 61247 km 34269 Job
Autohaus M &
M Parchim
GmbH,
Parchim

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Fahrzeug- und Teileverbring ungzum Lackieren 00000000 Local 1 FRU
Flat rate unit I 99 99 999

Luftführung Stoßfänger vorn rechts ersetzen Local 2 FRU
Flat rate unit I 51 99 123

Luftführung vorn links und rechts ersetzen Bremskanal Local 2 FRU
Flat rate unit I 51 99 234

Lackierung 00000000 Local 1 FRU

Flat rate unit | 99 99 999

Kleinmaterial 2% 00000000 Flat rate unit 99 99 999	Local	1 FRU
Removing and installing/replacing air conditioning condenser Flat rate unit 64 53 551		6 FRU
Discharging, evacuating and filling air conditioner Flat rate unit 64 50 510		6 FRU
Work time without specification/body equipment Flat rate unit 51 99 000		2 FRU
Removing and installing front bumper panel Flat rate unit 51 11 656		9 FRU
Removing and installing/replacing both supports for bumper cover, front Flat rate unit 51 11 566		11 FRU
Replace bumper cover, front Flat rate unit 51 11 592		11 FRU
Additional work with Park Distance Control Flat rate unit 66 20 614		2 FRU
Removing and installing/replacing both deformation elements, top Flat rate unit 51 11 772		23 FRU
Replacing all cooling air routings for coolant radiator Flat rate unit 51 71 600		6 FRU
Removing and installing/replacing front left or right wheel arch cover Flat rate unit 51 71 538		4 FRU
Removing and installing coolant radiator Flat rate unit 17 11 510		16 FRU
Removing and installing or replacing left module carrier Flat rate unit 17 11 652		2 FRU
Removing and installing or replacing right module carrier Flat rate unit 17 11 654		2 FRU
Removing and installing/replacing low-temperature coolant radiator Flat rate unit 17 11 576		1 FRU
Performing vehicle test Flat rate unit 00 00 556		2 FRU
Performing vehicle test Flat rate unit 00 00 556		2 FRU
Supporting the voltage of the vehicle electrical system/recharging the vehicle electrical system battery Flat rate unit 61 21 528		1 FRU
Replacing the fan cowl for the electric fan Flat rate unit 17 11 536		1 FRU
Replacing coolant hose Flat rate unit 11 53 762		4 FRU
Kühlerfrostschutz HT-12 Part FT99 99 9 407 4	Local	10.5

Kältemittel 1234yf / 100g Part I FT83 19 2 354 7	Local	5.4
Kältemaschinenöl R1234yf 1g Part I FT83 22 2 339 9	Local	10
Mount, bumper, front, lower Part I 51 64 8 054 575		1
Deformation element left Part I 51 11 8 051 189		1
Cover,top Part I 17 11 8 625 432		1
Expanding rivet Part I 17 12 7 620 959		2
Deformation element right Part I 51 11 8 051 190		1
Blind rivet Part I 07 14 7 234 212		4
Trim cover, bumper, primed, front Part I 51 11 8 060 877		1
Trim cover, grill, left Part I 51 11 8 054 549		1
Grill, bumper, front, right Part I 51 11 8 054 508		1
Grill, bumper, front, left Part I 51 11 8 054 507		1
Insert, air intake, center Part I 51 11 8 054 503		1
Repair kit for bracket, bumper, front Part I 51 11 8 065 982		1
Air duct, bottom Part I 51 74 8 054 591		1
Air duct, brake, left Part I 51 74 8 054 529		1
Air duct, brake, right Part I 51 74 8 054 530		1
Air ducts to radiator Part I 51 74 7 290 610		1
Air duct, exterior radiator, right Part I 51 74 8 054 538		1
Badge Part I 51 76 7 288 752		1
Rock guard Part I 17 11 8 485 042		2
Radiator Part I 17 11 8 741 830		1
Radiator		1

Covering Lower Part I 17 11 8 625 433	1
Seal, lower Part I 17 11 8 625 434	1
Fan housing with fan Part I 17 42 8 625 440	1
Hose, radiator Part I 17 12 8 616 560	1
Hose, radiator Part I 17 12 8 662 837	1
Cover, bottom left Part I 51 71 8 054 551	1
Cover, bottom right Part I 51 71 8 054 552	1
Underhood shield Part I 51 75 7 241 814	1
Adapter underhood shield Part I 51 11 8 054 523	1
Condenser air conditioning with drier Part I 64 50 9 471 521	1
Gasket ring Part I 64 53 9 284 018	1
Gasket ring Part I 64 53 9 284 020	1
Module mount, left Part I 17 11 9 487 032	1
Module mount, right Part I 17 11 9 487 033	1
Bracket upper Part I 17 11 7 596 922	2
Frame Part I 17 21 9 452 275	1
Absorber for engine bay insulation Part I 51 71 7 376 346	1
Expanding rivet Part I 51 16 1 881 149	2
Fillister head screw Part I 07 14 9 321 070	2
Expanding rivet Part I 51 47 1 911 992	8
C-clip nut Part I 51 71 7 065 773	12
Oval-head screw with washer Part I 07 14 7 406 384	6

—	01/19/2021	Repair	61247 km	34269 Autohaus M & M Parchim GmbH , Parchim	Job Job Job Job Job Job
---	------------	--------	----------	---	--

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Outside car wash Flat rate unit I 00 11 319	0 FRU
--	-------

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Standard scope of service Flat rate unit I 00 00 105	2 FRU
---	-------

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Spark plugs service Flat rate unit I 00 00 622	12 FRU
---	--------

Spark plug, High Power Part I 12 12 0 040 551	6
--	---

Torx screw with collar Part I 07 14 7 270 121	4
--	---

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Service - microfilter Flat rate unit I 00 00 616	2 FRU
---	-------

Microfilter/activated Carbon container Part I 64 11 9 237 555	1
--	---

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Vehicle check service	6 FRU
Flat rate unit I 00 00 624	

BMW-Scheibenklar mit Frostschutz	Local	2
Part I FT99 99 9 100 1		

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Service - air filter insert	1 FRU
Flat rate unit I 00 00 602	

Air filter element	1
Part I 13 71 8 605 164	

— Job

Description:

Is interpreted as a repeat visit: No


Customer's own words:

Engine oil service	3 FRU
Flat rate unit I 00 00 610	


TwinPower Turbo LL004 0W-30	Local	6.5
Part I FT99 99 9 200 1		

Set oil-filter element	1
Part I 11 42 8 583 898	

— 11/09/2020 Key 54375 km 00096 Key 0

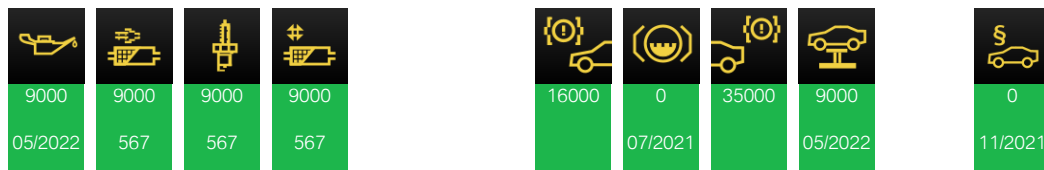

— 11/07/2020 Key 54314 km Key 0

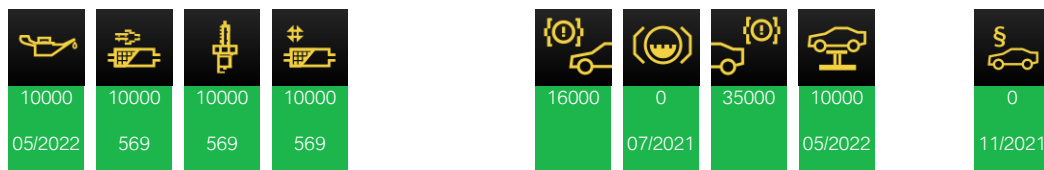

— 11/06/2020 Repair 54314 km 00096 Bobrink & Co. GmbH , Bremen Job Job Job Job

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Winterräder montieren Sommerräder zur Einlagerung vorbereiten Flat rate unit I 36 11 360	Local	6 FRU
Einlagerung Räder Part I 99 99 0 000 005	Local	1

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Winter Komfortcheck Flat rate unit I 36WRAKT	Local	1 FRU
---	-------	-------

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Klimaanlagendesinfektion Flat rate unit I 00 11 008	Local	2 FRU
--	-------	-------

— 05/04/2020 Key31246 km00096Key 0

 -600 07/2020	 0	 0	 -600 57	 34000	 0 07/2021	 49000	 31000 07/2022	 11/2021
--	--	--	---	--	---	--	--	--

— 05/04/2020 Service31246 km00096Automatic
Bobrink&Co.
GmbH ,
Bremen

 -600 07/2020 ✓	 0	 0	 -600 07/2020 ✓	 34000	 0 07/2021	 49000	 31000 07/2022	 0 11/2021
---	--	--	---	--	---	--	--	---

— 05/04/2020 Repair31246 km00096 Bobrink & Co. GmbH , Bremen

Job
Job: Standard scope of service
Job
Job: Engine oil service
Job: Service - microfilter
Job
Job
Job

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Package I MM0103

Local

Service consultation at the vehicle with customer without service ticket

0

Flat rate unit I 00 52 053

— Job: Standard scope of service

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Standard scope of service

Package I 0000105

Standard scope of service

2

Flat rate unit I 00 00 105

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words: Seriensandverbesserung offen Steuergeräte programmieren 0012880400

Program control units

8 FRU

Flat rate unit I 00 67 736

— Job: Engine oil service

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Engine oil service

Package I 0000610

Engine oil service

3

Flat rate unit I 00 00 610

BMW Engine Oil LL04 5W30

6.5

Part I 83212405948

Set oil-filter element

1

Part I 11428583898

— Job: Service - microfilter

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Service - microfilter
Package I 0000616

Service - microfilter	2
Flat rate unit I 00 00 616	
Microfilter/activated Carbon container	1
Part I 64119237555	

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words: Sommerräder liegen im Kofferraum

!!! unknown BMW-Id 3612360 Sommerräder montieren Winterräder zur	Local	6 FRU
!!!		
Flat rate unit I 36 12 360		

!!! unknown BMW-Id 99990000005 Einlagerung Räder !!!	Local	1
Part I 99 99 0 000 005		

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Package I MM0201	Local	
Maschinenwäsche und Fußraum aussaugen im	Local	0
Flat rate unit I -		

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

!!! unknown BMW-Id ESTIMATE 0174-3479090 !!!	Local	0 FRU
Flat rate unit I -		

— 11/16/2019 Key 23866 km 00088 Key 0

			
7000	0	0	7000
07/2020			258

					
36000	0	48000	37000		0
	07/2021		07/2022		11/2021

— 11/16/2019 Repair 23866 km 00088 Job
Niederlassung Job
Bremen BMW Job
AG, Bremen

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Serviceberatung am Fahrzeug
Part I 52050

Local

1

— Job**Description:**

Is interpreted as a repeat visit: No

Customer's own words: Winterreifen auslagern, Sommerräder insFz legen,

Rädersatz komplett ummontieren
Flat rate unit I AZ80 00 1

Local

6 FRU

Tyre protection sleeves
Part I 83 19 0 140 584

4

— Job**Description:**

Is interpreted as a repeat visit: No









Customer's own words:

— 05/24/2019 Key

17742 km

00088

Key 0



— 05/24/2019 Repair

17742 km

00088
Niederlassung
Bremen BMW
AG, Bremen

Job
Job
Job

— Job**Description:**

Is interpreted as a repeat visit: No

Customer's own words:

Rädersatz komplett ummontieren
Flat rate unit I AZ80 00 1

Local

6 FRU

Einlagerungsgebühr Saison-Radsatz
Part I 0099444

Local

1

— Job**Description:**

Is interpreted as a repeat visit: No

Customer's own words:

kostenlose Fahrzeugoberwäsche
Part I 0011319

Local

1

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

—	01/17/2019	Repair	1 km	00088 Niederlassung Bremen BMW AG, Bremen	Job	
---	------------	--------	------	--	-----	--

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Nachrüstung Service-Inclusive Kunde Grüt Part I 5100102	Local	1
--	-------	---

—	11/28/2018	Repair	1 km	00088 Niederlassung Bremen BMW AG, Bremen	Job Job	
---	------------	--------	------	--	------------	--

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words: Fzg ist hier - AL 30.11. - um 16:00 - VK Stefan Sehn,

Auslieferungsdurchsicht Flat rate unit I AZ00 03 3	Local	3 FRU
---	-------	-------

It. Vereinbarung kostenl. Räderwechsel Flat rate unit I AZ36 11 7	Local	6 FRU
--	-------	-------

Performing vehicle test Flat rate unit I 00 00 556		2 FRU
---	--	-------

— Job

Description:


Is interpreted as a repeat visit: No

Customer's own words:

Ersteinlagerungsgebühr Saison-Radsatz Part I 0099442	Local	1
---	-------	---

RDCi Winter wheel and tire Ferricgrey Part I 36 11 2 456 814		4
---	--	---

—	08/13/2018	Service	3 km	00088 BMW AG NL Hannover, Bremen	Manual	
---	------------	---------	------	---	--------	--



—	08/06/2018	Repair	1 km	00088 Niederlassung Bremen BMW AG, Bremen	Job
---	------------	--------	------	--	-----

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words: Fzg kommt am 10.8. - für Ausstellung,

Navigationsstraßenkarte installieren/ Na	Local	2 FRU
Flat rate unit I AZ65 90 6		

Free pre-delivery check	9 FRU
Flat rate unit I 00 00 009	